



2025 年 7 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
27	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand)：EBL 品名(Name)：充電器 (Charger) 型號 (Model)：EBL-906	<p>接地保護不足，產品絕緣不良，導致帶電部件易觸及。用戶可能接觸到易觸及的帶電部件並遭受電擊。 本產品不符合低電壓指令的要求。</p> <p>The earthing protection is inadequate and the product's insulation is inappropriate, leaving live parts accessible. The user could touch the accessible live parts and receive an electric shock.</p> <p>This product does not comply with the requirements of the Low Voltage Directive.</p>	邊境拒絕進口 Import rejected at border	
27	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand)：NUISION 品名(Name)：美髮器 (Hair styler) 型號 (Model)：WT-631	<p>插頭內的保險絲顆粒填充不足，尺寸過小。這可能導致插頭過熱和/或爆炸，從而引發火災。 本產品不符合低電壓指令的要求。</p> <p>The fuse within the plug has insufficient granular filler and is too small. This can lead to the plug overheating and/or exploding, causing a fire.</p> <p>This product does not comply with the requirements of the Low Voltage Directive.</p>	邊境拒絕進口 Import rejected at border	
27	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand)：不詳 (unknown) 品名(Name)：電烙鐵 (Soldering iron) 型號 (Model)：不詳 (unknown)	<p>該產品包含一些連接品質低劣的部件，電線直接焊接在印刷電路板上。如果將該產品插入主電源，使用者可能會觸電。 該產品不符合低電壓指令的要求。</p> <p>The product contains parts with poor-quality connections with wires soldered directly to the Printed Circuit Board. If the product is plugged into the mains power supply, the user could receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace	

2025 年 7 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
27	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : Baoshishan 品名(Name) : 旋轉展示架 (Rotating display stand) 型號 (Model) : 不詳 (unknown)	<p>正常使用過程中，絕緣層可能會損壞。如果使用者在產品開啟時觸摸外殼的金屬部分，導致絕緣層失效，則可能觸電。此外，產品插頭插針的套管部分與插針的金屬部分尺寸不同。這導致兩者之間出現明顯的臺階，可能損壞插座並導致套管過度磨損，從而導致過熱並有火災風險。該產品不符合低電壓指令的要求。</p> <p>The insulation can break down during normal use. If the user touches the metal part of the casing whilst the item is switched on and the insulation fails, the user could receive an electric shock. Moreover, the dimensions of the sleeved parts of the product plug's pins differed from the metal parts of the pins. This results in a distinct step between the two and may cause damage to the socket and undue wear and tear to the sleeve, leading to overheating with the risk of fire.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product	
29	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : Wire Xtra 品名(Name) : 電源適配器 (Power adaptor) 型號 (Model) : EC-1165	<p>該產品的電源插頭尺寸不合適。用戶可能會被可觸及的帶電部件觸電。</p> <p>該產品不符合低電壓指令的要求。</p> <p>The mains plug dimensions of the product are inadequate. The user could receive an electric shock from accessible live parts.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	邊境拒絕進口 Import rejected at border	
30	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : Shen Zhen San Zhi Electric Company Limited 品名(Name) : 旅行適配器 (Travel adaptor) 型號 (Model) : WN-06 WN-07	<p>該產品的帶電部件易於觸及，且接地插腳的電氣絕緣不足。因此，使用者可能會觸及產品的帶電部件並遭受電擊。</p> <p>該產品不符合低電壓指令的要求。</p> <p>The live parts of the product are easily accessible and the electrical insulation of the earth pin is inadequate. As a consequence, users may touch live parts of the product and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	終端使用者手中召回產品 Recall of the product from end users	

2025年7月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
30	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	<p>品牌(Brand) : Online Home Shop 品名(Name) : 電熱毯 (Electric blanket) 型號 (Model) : Electric Fluffy Heated Over Blanket Charcoal Electric Fluffy Heated Over Blanket Grey Electric Heated Waffle Fleece Over Blanket Charcoal Electric Sherpa Reverse Heated Over Blanket Electric Teddy Fleece Heated Over Blanket Charcoal</p>	<p>電源線會隨著時間的推移而老化。用戶可能會觸碰可接觸的帶電部件並遭受電擊。此外，帶電部件還可能產生火花，從而引發火災。 本產品不符合低電壓指令的要求。 The mains cable can deteriorate over time. The user can touch the accessible live parts and receive an electric shock. Moreover, the live parts could emit sparks, potentially leading to fire. This product does not comply with the requirements of the Low Voltage Directive.</p>	<p>終端使用者手中召回產品 Recall of the product from end users</p>	
30	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	<p>品牌(Brand) : Moongiantgo 品名(Name) : 食物乾燥機 (Food dehydrator) 型號 (Model) : 不詳 (unknown)</p>	<p>該產品的保險絲顆粒填充不足。如果產品在使用過程中發生電氣故障，可能會起火或爆炸。 本產品不符合低電壓指令的要求。 The product's fuse has insufficient granular filler. If the product experiences an electrical fault whilst in use, it may catch fire or explode. This product does not comply with the requirements of the Low Voltage Directive.</p>	<p>邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product</p>	
30	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	<p>品牌(Brand) : EBL 品名(Name) : 智能電池充電器 (Smart Battery Charger) 型號 (Model) : C9042W</p>	<p>接地保護不足，產品絕緣不良，導致帶電部件易觸及。用戶可能接觸到易觸及的帶電部件並遭受電擊。 本產品不符合低電壓指令的要求。 The earthing protection is inadequate and the product's insulation is inappropriate, leaving live parts accessible. The user could touch the accessible live parts and receive an electric shock. This product does not comply with the requirements of the Low Voltage Directive.</p>	<p>邊境拒絕進口 Import rejected at border</p>	
30	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	<p>品牌(Brand) : 不詳 (unknown) 品名(Name) : 空氣泵 (Air pump) 型號 (Model) : SH-505</p>	<p>該產品的電源線電阻過大，可能導致其過熱，並隨著時間的推移損壞電纜，從而引發火災。 本產品不符合低電壓指令的要求。 The product's mains supply cord has an excessive resistance, which may cause it to overheat and over time damage the cable, leading to a fire. This product does not comply with the requirements of the Low Voltage Directive.</p>	<p>邊境拒絕進口 Import rejected at border</p>	




2025年7月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
31	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : Youngine 品名(Name) : 門警燈 (Door alarm light) 型號 (Model) : 不詳 (unknown)	<p>電池倉很容易打開，鈕扣電池很容易接觸到。兒童可能會將電池放入口中吞咽，這可能會導致兒童胃腸道損傷和/或窒息。</p> <p>該產品不符合《通用產品安全法規》。</p> <p>The battery compartment can be easily opened, leaving the button batteries accessible. A child may put them in the mouth and swallow them, which could cause damage to the child's gastrointestinal tract and/or choking.</p> <p>The product does not comply with the General Product Safety Regulation.</p>	邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product	
31	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : 不詳 (unknown) 品名(Name) : 牆壁插座 (Wall socket) 型號 (Model) : MS589	<p>該壁式插座的輸入和輸出電路之間的擊穿隔離以及電路間的爬電距離和電氣間隙不足。此外，USB 輸入電路未安裝過流保護裝置。這可能導致壁式插座過熱並引發火災。</p> <p>該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 62368-1。</p> <p>The breakdown isolation between the input and output circuits and the creepage and clearance distances between circuits of the wall socket are insufficient. Moreover there is no overcurrent protection device fitted to the USB input circuit. This can lead to overheating of the wall socket and cause a fire.</p> <p>The product does not comply with the requirements of the Low Voltage Directive, nor with the European standard EN 62368-1.</p>	邊境拒絕進口 Import rejected at border	
31	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : 不詳 (unknown) 品名(Name) : 電動牙刷充電器 (Electric toothbrush charger) 型號 (Model) : HYC3757A	<p>保險絲端蓋固定不牢固。如果發生電湧或故障，插頭可能會過熱並起火，從而引發火災。</p> <p>該產品不符合低壓指令的要求。</p> <p>The fuse endcaps are insecurely fixed. In the event of an electrical surge or fault, the plug may overheat and ignite, causing a fire.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	終端使用者手中召回產品 Recall of the product from end users 線上市場刪除了該產品清單 Removal of this product listing by the online marketplace	

2025年7月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
28	愛爾蘭 (Ireland)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：暖風機 (Fan heater) 型號 (Model)：XH-1201</p>	<p>該產品後部的排氣格柵易被刺穿或損壞，導致帶電部件觸及。用戶可能觸碰這些部件並遭受電擊。 該產品不符合低壓指令的要求，也不符合歐洲標準 EN 60335-1 和 EN 60335-2-30。 The back exhaust grille of the product is easily penetrable or broken leaving live parts accessible. A user could touch them and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60335-1 and EN 60335-2-30.</p>	<p>終端使用者手中召回產品 Recall of the product from end users</p>	
30	愛爾蘭 (Ireland)	<p>品牌(Brand)：Tower 品名(Name)：空氣炸鍋 (Air fryer) 型號 (Model)：T17023 T17061BLK T17067</p>	<p>濕氣或污染物可能會影響門聯鎖微動開關，引起電弧和過熱，從而可能導致觸電或火災。 該產品不符合低壓指令的要求。 Moisture or contaminants may affect the door interlock microswitch, causing electrical arcing and overheating, which may result in electric shock or fires. The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users</p>	
30	愛爾蘭 (Ireland)	<p>品牌(Brand)：Tower 品名(Name)：空氣炸鍋 (Air fryer) 型號 (Model)：T17087</p>	<p>溫控器感測器線絕緣不足可能導致產品在使用過程中過熱並起火。 該產品不符合低電壓指令的要求。 Insufficient insulation of the thermostat sensor wire may result in the product overheating and igniting during use. The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users</p>	
31	立陶宛 (Latvia)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：JH-2420</p>	<p>LED 元件連接處的電線耐壓性不足，導致帶電部件在受到機械應力時容易接觸。用戶可能會接觸到這些帶電部件並遭受電擊。這還會造成火災隱患。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60598-1 和 EN 60335-2-20。 The wire at the point of connection of the LED elements is not resistant enough, leaving live parts accessible if subjected to mechanical stress. The user could touch the accessible live parts and receive an electric shock. This also creates a fire hazard. The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-1 and EN 60335-2-20.</p>	<p>產品銷毀 Destruction of the product</p>	


2025 年 7 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
29	匈牙利 (Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：不詳 (unknown)</p>	<p>該產品設計不當，防觸電保護不足。擺動式插座僅支援單極連接。因此，用戶可能會觸及可接觸帶電部件，從而導致觸電。 該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。 The product is improperly designed and not adequately protected against electric shock. The swinging socket enables a one-pole connection. As a result, the user could touch accessible live parts, which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures 從市場撤回 Withdrawal of the product from the market 產品銷毀 Destruction of the product</p>	
30	匈牙利 (Hungary)	<p>品牌(Brand)：Bo Yang 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：025</p>	<p>該產品的電源與電子單元的連接不牢固，且產品絕緣不足，導致帶電部件容易接觸。用戶可能接觸到這些帶電部件並遭受電擊。 該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。 The power supply of the product is not securely anchored to the electronic unit, and the product has inadequate insulation, which makes live parts accessible. The user could touch the accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users</p>	
30	匈牙利 (Hungary)	<p>品牌(Brand)：SOPLE 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：785W</p>	<p>該產品絕緣性能不佳，僅允許單極插頭插入，且插頭與第一個插座之間的連接線長度不足，導致帶電部件容易接觸。用戶可能接觸到可接觸的帶電部件並遭受電擊。 該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。 The product insulation is inappropriate, it allows single pole plug insertion and has insufficient cable length between plug and the first socket leaving live parts accessible. The user could touch the accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive and the European standard EN 60598.</p>	<p>從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users</p>	




2025年7月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
30	匈牙利 (Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：XM-100-C-L-LO</p>	<p>由於產品機械強度不足，可能接觸帶電部件。電源線未牢固地固定在控制器上，且未充分固定以防止被拉出。這可能導致用戶觸電。 該產品不符合低壓指令和歐洲標準 EN 60598。 Due to the insufficient mechanical strength of the product, access to live parts is possible. Moreover, the product does not meet the declared requirements for protection against moisture. This may result in the user receiving an electric shock. The product does not comply with the requirements Low Voltage Directive nor with the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users</p>	
30	匈牙利 (Hungary)	<p>品牌(Brand)：Digital Light Series 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：C-28</p>	<p>該產品絕緣性能不佳，僅允許單極插頭插入，且插頭與第一個插座之間的連接線長度不足，導致帶電部件容易接觸。用戶可能接觸到可接觸的帶電部件並遭受電擊。 該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。 The product insulation is inappropriate, it allows single pole plug insertion and has insufficient cable length between plug and the first socket leaving live parts accessible. The user could touch the accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive and the European standard EN 60598.</p>	<p>從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users</p>	
31	匈牙利 (Hungary)	<p>品牌(Brand)：Yoto 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：不詳 (unknown)</p>	<p>電纜固定不當，產品絕緣不足，導致帶電部件觸及。此外，產品不符合聲明的防潮要求。這可能導致用戶觸電。 該產品不符合低壓指令和歐洲標準 EN 60598。 The cable is not properly anchored and the product has inadequate insulation, which makes live parts accessible. Moreover, the product does not meet the declared requirements for protection against moisture. This may result in the user receiving an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users</p>	

2025年7月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
28	波蘭 (Poland)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：風扇 (Electric fan) 型號 (Model)：34793900 FT-30A</p>	<p>該產品絕緣不足，導致設備電機的帶電部件容易接觸。用戶可能接觸到這些易接觸的帶電部件並遭受電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60598-1 和 EN 60335-2-80。 The product's insulation is inadequate, leaving live parts of the device's motor accessible. The user could touch the accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-1 and EN 60335-2-80.</p>	<p>從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks 終端使用者手中召回產品 Recall of the product from end users</p>	
29	波蘭 (Poland)	<p>品牌(Brand)：RED Technic 品名(Name)：焊接機 (Welding machine) 型號 (Model)：RTSIT0004</p>	<p>電源線和焊接線過細。電線可能過熱並導致絕緣層損壞，使帶電部件易於接觸。用戶可能接觸到這些易接觸的帶電部件並遭受電擊。 該產品不符合低壓指令的要求，也不符合歐洲標準 EN 60974-1 和 EN 60974-11。 The power supply and welding cables are too thin. The wires may overheat and cause the insulation to become damaged, leaving live parts accessible. The user could touch the accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60974-1 and EN 60974-11.</p>	<p>從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks</p>	
29	波蘭 (Poland)	<p>品牌(Brand)：RED Technic 品名(Name)：焊接機 (Welding machine) 型號 (Model)：RTMSTF001</p>	<p>電源線和焊接線過細。電線可能過熱並導致絕緣層損壞，使帶電部件易於接觸。用戶可能接觸到這些易接觸的帶電部件並遭受電擊。 該產品不符合低壓指令的要求，也不符合歐洲標準 EN 60974-1 和 EN 60974-11。 The power supply and welding cables are too thin. The wires may overheat and cause the insulation to become damaged, leaving live parts accessible. The user could touch the accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60974-1 and EN 60974-11.</p>	<p>從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks</p>	

2025 年 7 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
29	波蘭 (Poland)	<p>品牌(Brand) : RED Technic 品名(Name) : 逆變焊機 (Inverter welder) 型號 (Model) : RTSI0048</p>	<p>電源線和焊接線過細。電線可能過熱並導致絕緣層損壞，使帶電部件易於接觸。用戶可能接觸到這些易接觸的帶電部件並遭受電擊。 該產品不符合低壓指令的要求，也不符合歐洲標準 EN 60974-1 和 EN 60974-11。 The power supply and welding cables are too thin. The wires may overheat and cause the insulation to become damaged, leaving live parts accessible. The user could touch the accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60974-1 and EN 60974-11.</p>	<p>從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks</p>	
31	波蘭 (Poland)	<p>品牌(Brand) : LED line LITE 品名(Name) : 固定燈 (Fixed lamp) 型號 (Model) : 不詳 (unknown)</p>	<p>產品絕緣不適當，導致帶電部件觸及。用戶可能接觸到可觸及的帶電部件並遭受電擊。 該產品不符合低壓指令和歐洲標準 EN 60598。 The product insulation is inappropriate, leaving live parts accessible. The user could touch the accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks</p>	
27	捷克 (Czechia)	<p>品牌(Brand) : 不詳 (unknown) 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : TP24-6048</p>	<p>電源未牢固地固定在電子裝置上，且固定不夠牢固。此外，電子裝置的蓋子很容易被拆卸，導致帶電部件觸及。用戶可能會接觸到這些可觸及的帶電部件，從而遭受電擊。 該產品不符合低電壓指令的要求。 The power supply is not securely anchored to the electronic unit and sufficiently secured. Moreover, the cover of the electronic unit can be easily removed leaving live parts accessible. The user could touch the accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	

2025 年 7 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
30	捷克 (Czechia)	品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：不詳 (unknown)	<p>由於產品機械強度不足，可能接觸帶電部件。電源線未牢固地固定在控制器上，且未充分固定以防止被拉出。這可能導致用戶觸電。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598。</p> <p>Due to the insufficient mechanical strength of the product, access to live parts is possible. The power supply cord is not securely anchored to the controller and not sufficiently secured against being pulled out. This may result in the user receiving an electric shock.</p> <p>The product does not comply with the requirements Low Voltage Directive nor with the European standard EN 60598.</p>	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	
30	捷克 (Czechia)	品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：V8F50	<p>由於產品機械強度不足，可能接觸帶電部件。此外，電源未牢固地固定在電子裝置上，容易脫落。這可能導致用戶觸電。</p> <p>該產品不符合低壓指令的要求，也不符合歐洲標準 EN 60598。</p> <p>Due to the insufficient mechanical strength of the product, access to live parts is possible. Moreover, the power supply is not securely anchored to the electronic unit and can easily detach. This may result in the user receiving an electric shock.</p> <p>The product does not comply with the requirements Low Voltage Directive not with the European standard EN 60598.</p>	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	
30	捷克 (Czechia)	品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：不詳 (unknown)	<p>由於產品機械強度不足，可能接觸帶電部件。電源線未牢固地固定在控制器上，且未充分固定以防止被拉出。這可能導致用戶觸電。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598。</p> <p>Due to the insufficient mechanical strength of the product, access to live parts is possible. The power supply cord is not securely anchored to the controller and sufficiently secured against being pulled out. This may result in the user receiving an electric shock.</p> <p>The product does not comply with the requirements Low Voltage Directive nor with the European standard EN 60598.</p>	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	

2025 年 7 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
27	斯洛伐克 (Slovakia)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：DN-74</p>	<p>由於產品機械強度不足，可能接觸帶電部件。此外，該產品的導體標稱截面不足，僅允許單極插頭插入，插頭與第一個插座之間的電纜長度不足，並且不符合聲明的防潮要求。這可能導致觸電。 該產品不符合低壓指令以及歐洲標準 EN 60598-1 和 EN 60598-2-20 的要求。 Due to the insufficient mechanical strength of the product, access to live parts is possible. Moreover, the product has an insufficient nominal cross-section of the conductors, it allows single-pole plug insertion, has insufficient cable length between plug and the first socket and also does not meet the declared requirements for protection against moisture. This may result in an electric shock. The product does not comply with the requirements of the Low Voltage Directive and the European standards EN 60598-1 and EN 60598-2-20.</p>	<p>從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks 終端使用者手中召回產品 Recall of the product from end users</p>	
27	斯洛伐克 (Slovakia)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：JY-WD-007</p>	<p>由於產品機械強度不足，可能接觸帶電部件。此外，該產品的導體標稱截面不足，僅允許單極插頭插入，插頭與第一個插座之間的電纜長度不足，並且不符合聲明的防潮要求。這可能導致觸電。 該產品不符合低壓指令以及歐洲標準 EN 60598-1 和 EN 60598-2-20 的要求。 Due to the insufficient mechanical strength of the product, access to live parts is possible. Moreover, the product has an insufficient nominal cross-section of the conductors, it allows single-pole plug insertion, has insufficient cable length between plug and the first socket and also does not meet the declared requirements for protection against moisture. This may result in an electric shock. The product does not comply with the requirements of the Low Voltage Directive and the European standards EN 60598-1 and EN 60598-2-20.</p>	<p>停止銷售 Stop of sales</p>	

2025 年 7 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
27	斯洛伐克 (Slovakia)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：505B</p>	<p>由於燈串機械強度不足，可能接觸帶電部件，從而導致觸電。該產品還存在其他技術缺陷，可能對消費者的安全或健康構成風險，例如導體標稱截面不足、設計缺陷（當擴展插座允許單極插頭插入時），以及不符合聲明的防潮要求。該產品不符合低壓指令的要求，也不符合歐洲標準 EN 60598-1 和 EN 60598-2-20。</p> <p>Due to the insufficient mechanical strength of the lighting chain, access to live parts is possible, which may result in an electric shock. The product has other technical deficiencies that could pose a risk to the safety or health of consumers such as insufficient nominal cross-section of the conductors, insufficient design, when the extension socket allows a single-pole plug insertion and also does not meet the declared requirements for protection against moisture.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-1 and EN 60598-2-20.</p>	<p>從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks 終端使用者手中召回產品 Recall of the product from end users</p>	
27	斯洛伐克 (Slovakia)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：CSP6066</p>	<p>由於產品機械強度不足，可能接觸帶電部件。此外，該產品的導體標稱截面不足，且不符合聲明的防潮要求。這可能導致用戶觸電。</p> <p>該產品不符合低壓指令的要求，也不符合歐洲標準 EN 60598-1 和 EN 60598-2-20。</p> <p>Due to the insufficient mechanical strength of the product, access to live parts is possible. Moreover, the product has an insufficient nominal cross-section of the conductors and does not meet the declared requirements for protection against moisture. This may result in the user receiving an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor the European standards EN 60598-1 and EN 60598-2-20.</p>	<p>從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks 終端使用者手中召回產品 Recall of the product from end users</p>	

2025 年 7 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
27	斯洛伐克 (Slovakia)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：50050</p>	<p>由於產品機械強度不足，可能接觸帶電部件。此外，該產品的導體標稱截面不足，僅支援單極插頭插入，插頭與第一個插座之間的電纜長度不足，並且不符合聲明的防潮要求。這可能導致用戶觸電。 該產品不符合低壓指令的要求，也不符合歐洲標準 EN 60598-1 和 EN 60598-2-20。 Due to the insufficient mechanical strength of the product, access to live parts is possible. Moreover, the product has an insufficient nominal cross-section of the conductors, it allows single-pole plug insertion, has insufficient cable length between plug and the first socket and also does not meet the declared requirements for protection against moisture. This may result in the user receiving an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor the European standards EN 60598-1 and EN 60598-2-20.</p>	<p>從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks 終端使用者手中召回產品 Recall of the product from end users</p>	
28	斯洛伐克 (Slovakia)	<p>品牌(Brand)：L&S 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：AK-28LED</p>	<p>該產品的導體標稱截面不足，可能導致觸電或火災。 該產品不符合低壓指令的要求，也不符合歐洲標準 EN 60598-1 和 EN 60598-2-20。 The product has an insufficient nominal cross-section of the conductors, which may result in an electric shock or fire. The product does not comply with the requirements of the Low Voltage Directive nor the European standards EN 60598-1 and EN 60598-2-20.</p>	<p>從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks 終端使用者手中召回產品 Recall of the product from end users</p>	
28	斯洛伐克 (Slovakia)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：V8F50</p>	<p>該產品的導體標稱截面不足，可能導致觸電或火災。 該產品不符合低壓指令的要求，也不符合歐洲標準 EN 60598-1 和 EN 60598-2-20。 The product has an insufficient nominal cross-section of the conductors, which may result in an electric shock or fire. The product does not comply with the requirements of the Low Voltage Directive nor the European standards EN 60598-1 and EN 60598-2-20.</p>	<p>從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks 終端使用者手中召回產品 Recall of the product from end users</p>	

2025 年 7 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
27	瑞典 (Sweden)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：兒童燈 (Children's lamp) 型號 (Model)：L40</p>	<p>該產品焊料中的鉛含量超標 (經測量，含量高達 58.2% (重量百分比))。鉛對環境構成威脅。 該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》(RoHS 2.0) 的要求。 The solders in the product have an excessive concentration of lead. (measured value up to 58.2% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users</p>	
27	瑞典 (Sweden)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：6610</p>	<p>產品中的焊料鉛含量超標 (測量值：52.4% 重量百分比)。鉛對環境構成威脅。此外，電纜的塑膠材料中鄰苯二甲酸二(2-乙基己基)酯 (DEHP) 含量超標 (測量值：3% 重量百分比)。這種鄰苯二甲酸酯可能損害生殖系統，從而危害健康。 該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》(RoHS 2.0 指令) 和《歐盟化學品及限制使用指令》(REACH) 的要求。 The solders in the product have an excessive concentration of lead. (measured value: 52.4 % by weight). Lead poses a risk to the environment. Moreover, the plastic material of the cable has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value: 3 % by weight). This phthalate may harm the health by causing possible damage to the reproductive system. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive) nor with the REACH Regulation.</p>	<p>從市場撤回 Withdrawal of the product from the market</p>	

2025 年 7 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
27	瑞典 (Sweden)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：檯燈 (Desk lamp) 型號 (Model)：TYX-8102/RM-KAXKD-LV</p>	<p>該產品焊料中的鉛含量超標（經測量，含量高達 82.2%（重量百分比））。鉛對環境構成威脅。 該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》（RoHS 2.0）的要求。 The solders in the product have an excessive concentration of lead (measured value up to 82.2% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>從市場撤回 Withdrawal of the product from the market</p>	
27	瑞典 (Sweden)	<p>品牌(Brand)：JustEvo 品名(Name)：按摩枕 (Massage pillow) 型號 (Model)：8662215789</p>	<p>產品焊料中的鉛含量超標（測量值高達：37.8% 重量百分比）。電纜塑膠材質中的鄰苯二甲酸二（2-乙基己基）酯 (DEHP) 含量超標（測量值：1.2% 重量百分比）。鉛對環境構成威脅。DEHP 對人類健康和環境構成威脅。 該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》（RoHS 指令）的要求。 The solders in the product have an excessive concentration of lead (measured value up to: 37,8 % by weight). The plastic material of the cable has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value:1.2 % by weight). Lead poses a risk to the environment. DEHP poses a risk to human health and the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS Directive).</p>	<p>從市場撤回 Withdrawal of the product from the market</p>	

2025 年 7 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
27	瑞典 (Sweden)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：加熱腰帶 (Heating belt) 型號 (Model)：HW04</p>	<p>該產品焊料中的鉛和鎘含量超標（經測量，含量分別高達 83%和 0.4%（重量百分比））。鉛和鎘對環境構成威脅。該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》（RoHS 2.0）的要求。</p> <p>The solders in the product have an excessive concentration of lead and cadmium (measured values up to 83% and 0.4% by weight, respectively). Lead and cadmium pose a risk to the environment.</p> <p>The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>從市場撤回 Withdrawal of the product from the market</p>	
27	瑞典 (Sweden)	<p>品牌(Brand)：Mikikit 品名(Name)：揚聲器 (Speaker) 型號 (Model)：WL2PWN1017CERJH312MD98AO2</p>	<p>該產品焊料中的鉛含量超標（經測量，含量高達 64%（重量百分比））。鉛對環境構成威脅。該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》（RoHS 2.0）的要求。</p> <p>The solders in the product have an excessive concentration of lead (measured value up to 64 % by weight). Lead poses a risk to the environment.</p> <p>The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>線上市場刪除了該產品清單 Removal of this product listing by the online marketplace</p>	

2025 年 7 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
28	瑞典 (Sweden)	品牌(Brand) : 不詳 (unknown) 品名(Name) : 耳機 (Headphones) 型號 (Model) : 20240913-B39	<p>產品中的焊料鉛和鎘的濃度超標 (測量值分別高達 67.8% 和 0.054% (按重量計))。電纜的塑膠材料中 DEHP、DPB 和 DIBP 的濃度超標 (測量值分別高達 1.8%、1.2% 和 0.4% (按重量計))。塑膠中的短鏈氯化石蠟 (SCCP) 濃度也超標 (測量值高達 0.6% (按重量計))。鉛和鎘對環境構成威脅。DEHP、DPB 和 DIBP 可能損害生殖系統，從而危害健康。SCCP 在環境中持久存在，低濃度下對水生生物有毒，並在野生動物和人類體內生物累積，對人類健康和環境構成威脅。</p> <p>該產品不符合《限制在電氣和電子設備中使用某些有害物質的指令》(RoHS 2 指令) 的要求，也不符合《持久性有機污染物》(POP) 法規的要求。</p> <p>The solders in the product have an excessive concentration of lead and cadmium (measured values up to 67.8 % and 0.054% by weight respectively). The plastic material of the cable has an excessive concentration of DEHP, DPB and DIBP (measured values up to 1.8%, 1.2% and 0.4% by weight respectively). The plastic also has an excessive concentration of short-chain chlorinated paraffins (SCCPs) (measured value up to 0.6 % by weight). Lead and cadmium pose a risk to the environment. DEHP, DPB and DIBP may harm the health by causing possible damage to the reproductive system. SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bio-accumulate in wildlife and humans, posing a risk to human health and the environment.</p> <p>The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive) nor with the Persistent Organic Pollutants (POP) Regulation.</p>	從市場撤回 Withdrawal of the product from the market	



2025 年 7 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
29	瑞典 (Sweden)	<p>品牌(Brand) : Pawcutter 品名(Name) : 修爪器 (Paw trimmer) 型號 (Model) : 11275 A16-03-01</p>	<p>產品中的焊料鉛含量超標 (測量值高達 77.9% (重量百分比))。鉛對環境構成威脅。此外，產品塑膠材質中鄰苯二甲酸二(2-乙基己基)酯 (DEHP) 和鄰苯二甲酸二丁酯 (DBP) 的含量超標 (測量值分別高達 0.93% 和 5.11% (重量百分比))。這些鄰苯二甲酸酯可能對人類健康和環境構成威脅。此外，產品中短鏈氯化石蠟 (SCCP) 的含量超標 (測量值高達 0.7% (重量百分比))。SCCP 會在環境中持續存在，低濃度時對水生生物具有毒性，並在野生動物和人類體內生物累積，對人類健康和環境構成威脅。長期通過皮膚接觸這些物質可能會致癌。</p> <p>該產品不符合《限制在電子電氣設備中使用某些有害物質的指令》(RoHS 2 指令) 的要求，也不符合《持久性有機污染物》(POP) 法規和《REACH》法規的要求。</p> <p>The solders in the product have an excessive concentration of lead. (measured value up to 77.9% by weight). Lead poses a risk to the environment. Moreover, the plastic material of the product has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) and dibutyl phthalate (DBP) (measured values up to 0.93% and 5.11% by weight, respectively). These phthalates may pose a risk to human health and the environment. Additionally, the product has an excessive concentration of short chain chlorinated paraffins (SCCPs) (measured value up to 0.7 % by weight). SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bio-accumulate in wildlife and humans, posing a risk to human health and the environment. Prolonged exposure to them through the skin may cause cancer.</p> <p>The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive) nor with the Persistent Organic Pollutants (POP) Regulation and the REACH Regulation.</p>	<p>從市場撤回 Withdrawal of the product from the market</p>	

2025年7月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
29	瑞典 (Sweden)	品牌(Brand) : Hand of Weimei 品名(Name) : 磨腳器 (Foot polisher) 型號 (Model) : BD613	<p>產品中的焊料鉛含量超標 (測量值高達 72.7% (重量百分比))。鉛對環境構成威脅。此外，產品塑膠材質中鄰苯二甲酸二(2-乙基己基)酯 (DEHP) 含量超標 (測量值高達 1.21% (重量百分比))。這種鄰苯二甲酸酯可能損害生殖系統，從而危害健康。此外，產品中短鏈氯化石蠟 (SCCP) 含量超標 (測量值高達 0.61% (重量百分比))。SCCP 會在環境中持續存在，低濃度時對水生生物具有毒性，並在野生動物和人類體內生物累積，對人類健康和環境構成威脅。長期通過皮膚接觸這些物質可能會致癌。該產品不符合《限制在電氣和電子設備中使用某些有害物質的指令》(RoHS 2 指令) 的要求，也不符合《持久性有機污染物》(POP) 法規的要求。</p> <p>The solders in the product have an excessive concentration of lead. (measured value up to 72.7% by weight). Lead poses a risk to the environment. Moreover, the plastic material of the product has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 1.21% by weight). This phthalate may harm the health by causing possible damage to the reproductive system. Additionally, the product has an excessive concentration of short chain chlorinated paraffins (SCCPs) (measured value up to 0.61 % by weight). SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bio-accumulate in wildlife and humans, posing a risk to human health and the environment. Prolonged exposure to them through the skin may cause cancer.</p> <p>The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive) nor with the Persistent Organic Pollutants (POP) Regulation.</p>	從市場撤回 Withdrawal of the product from the market	




2025 年 7 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
29	瑞典 (Sweden)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：LED 頭燈 (LED head lamp) 型號 (Model)：不詳 (unknown)</p>	<p>該產品短鏈氯化石蠟 (SCCP) 濃度超標 (測得值高達 2.66% 重量百分比)。SCCP 會在環境中持續存在，低濃度時對水生生物具有毒性，並在野生動物和人類體內生物累積，對人類健康和環境構成風險。長期通過皮膚接觸這些物質可能致癌。</p> <p>該產品不符合《持久性有機污染物 (POP) 法規》。</p> <p>The product has an excessive concentration of short chain chlorinated paraffins (SCCPs) (measured value up to 2.66% by weight). SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bio-accumulate in wildlife and humans, posing a risk to human health and the environment. Prolonged exposure to them through the skin may cause cancer.</p> <p>The product does not comply with the Persistent Organic Pollutants (POP) Regulation.</p>	<p>停止銷售 Stop of sales</p>	
29	瑞典 (Sweden)	<p>品牌(Brand)：AIR 品名(Name)：空氣淨化器 (Air purifier) 型號 (Model)：不詳 (unknown)</p>	<p>該產品焊料中的鉛含量超標 (測量值：69% (重量百分比))。鉛對環境構成威脅。</p> <p>該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》(RoHS 2.0) 的要求。</p> <p>The solders in the product have an excessive concentration of lead (measured value: 69% by weight). Lead poses a risk to the environment.</p> <p>The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>停止銷售 Stop of sales</p>	
30	瑞典 (Sweden)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：數位溫度計 (Digital thermometer) 型號 (Model)：TP101</p>	<p>該產品焊料中的鉛含量超標 (經測量，含量高達 66% (重量百分比))。鉛對環境構成威脅。</p> <p>該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》(RoHS 2.0) 的要求。</p> <p>The solders in the product have an excessive concentration of lead (measured value up to 66% by weight). Lead poses a risk to the environment.</p> <p>The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>邊境拒絕進口 Import rejected at border</p>	


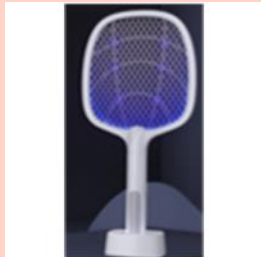

2025 年 7 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
27	德國 (Germany)	品牌(Brand) : Cecotec 品名(Name) : 空氣炸鍋 (Air fryer) 型號 (Model) : 04982	<p>該產品漏電流較大。如果觸摸故障產品的外殼，可能會導致用戶觸電。此外，持續的高漏電流可能會導致產品過熱。該產品不符合低電壓指令和歐洲標準 EN 60335-1 的要求。</p> <p>The product has a high leakage current. If the casing of a faulty product is touched, it can result in an electric shock to the user. Moreover, the consistently high leakage current may lead to overheating.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users	
27	德國 (Germany)	品牌(Brand) : Mzvue 品名(Name) : 投影儀 (Projector) 型號 (Model) : 不詳 (unknown)	<p>雷射光束功率過高 (測量值高達 4.1 mW)，且標籤錯誤。直視雷射光束可能會損害視力。</p> <p>該產品不符合《通用產品安全法規》以及歐洲標準 EN 50689 和 EN 60825-1。</p> <p>The laser beam is too powerful (measured value up to 4.1 mW) and not properly labelled. Direct viewing of the laser beam could cause damage to sight.</p> <p>The product does not comply with the General Product Safety Regulation nor with the European standards EN 50689 and EN 60825-1.</p>	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace	
31	德國 (Germany)	品牌(Brand) : SUNBEYOND 品名(Name) : LED 燈 (LED light) 型號 (Model) : COB-288	<p>該產品可按照說明書進行截斷和縮短，但缺少防止縮短後接觸帶電部件的元件和資訊。用戶可能通過可接觸的帶電部件觸電。此外，該產品標稱可防止任何角度的噴水 (噴嘴)，但其歐盟扁平插頭卻不具備此保護功能。因此，用戶可能觸電。</p> <p>該產品不符合低壓指令的要求，也不符合歐洲標準 EN 60598-2-4 和 EN 60598-1。</p> <p>The product can be cut off to be shortened according to the instructions but is missing components and information to prevent contact with live parts after shortening. The user could receive an electric shock via accessible live parts. Moreover, the product is described as being protected against water jets (nozzle) from any angle but has an EU flat plug that does not offer this protection. The user could therefore receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-2-4 and EN 60598-1.</p>	邊境拒絕進口 Import rejected at border	

2025年7月電子電氣產品召回案例 (北美地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
27	美國 (America)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：鏈鋸和高枝鋸 (Chainsaws and Pole Saws) 型號 (Model)：HT21-401-002-01, WG305, WG309, SKU 58949, UPC 193175451774</p>	<p>召回的鏈鋸和高枝鋸上的主開關可能會發生故障，導致鋸子在開關鬆開後仍會繼續運轉，從而造成割傷危險。 The main switch on the recalled chainsaws and pole saws can fail, allowing the saws to continue to run even after the switch is released, posing a laceration hazard.</p>	<p>替換 Replace</p>	
27	美國 (America)	<p>品牌(Brand)：CasaClean 品名(Name)：手持蒸汽機 (Handheld Steamers) 型號 (Model)：DF-958</p>	<p>蒸汽機可能會洩漏蒸汽或噴出滾燙的水，對使用者造成嚴重燒傷的危險。 The steamers can leak steam or spew hot boiling water, posing a risk of serious burn injury to users.</p>	<p>退款 Refund</p>	
29	美國 (America)	<p>品牌(Brand)：iStore 品名(Name)：無線充電器 (Wireless Power Banks) 型號 (Model)：IST-09991/W05</p>	<p>被召回的充電寶中的鋰離子電池在充電時可能過熱並引燃，對消費者構成火災和燒傷危險。 The lithium-ion battery in the recalled power banks can overheat and ignite while charging, posing fire and burn hazards to consumers.</p>	<p>退款 Refund</p>	
30	美國 (America)	<p>品牌(Brand)：Frigidaire 品名(Name)：迷你冰箱 (Minifridges) 型號 (Model)：EFMIS129, EFMIS137, EFMIS149 and EFMIS175</p>	<p>迷你冰箱的內部電子元件可能短路並點燃周圍的塑膠外殼，造成火災和燃燒危險。 The minifridges' internal electrical components can short circuit and ignite the surrounding plastic housing, posing fire and burn hazards.</p>	<p>退款 Refund</p>	

2025年7月電子電氣產品召回案例 (北美地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
30	美國 (America)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：智能家居香氛擴散器 (Smart Home Fragrance Diffusers) 型號 (Model)：不詳 (unknown)</p>	<p>內蓋上的磁鐵可能會脫落，對兒童構成吞食危險。吞咽高能磁鐵後，磁鐵可能會相互吸引，或與其他金屬物體發生吸引，最終卡在消化系統中。這可能導致腸道穿孔、扭曲和/或堵塞、感染、血液中毒，甚至死亡。</p> <p>The magnets on the inside cover can detach, posing an ingestion hazard to children. When high-powered magnets are swallowed, the ingested magnets can attract each other, or other metal objects, and become lodged in the digestive system. This can result in perforations, twisting and/or blockage of the intestines, infection, blood poisoning and death.</p>	<p>修理 Repair</p>	
30	美國 (America)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：可充電電動滅蟲拍、蒼蠅拍和蚊子拍 (Rechargeable Electric Bug Zapper Racket, Fly Swatter, and Mosquito Swatter) 型號 (Model)：BZ-001</p>	<p>電動滅蟲拍、蒼蠅拍和蚊子拍中的充電電池如果長時間使用可能會著火。</p> <p>The rechargeable battery in the Electric Bug Zapper Racket, Fly Swatter, and Mosquito Swatter can catch fire when used for extended periods of time.</p>	<p>退款 Refund</p>	
31	美國 (America)	<p>品牌(Brand)：RIDGID 品名(Name)：框架釘槍 (Framing Nailers) 型號 (Model)：R09894 - 18</p>	<p>釘槍上的雙動啣合系統可能會發生故障，僅扣動扳機就會意外射出釘子，對消費者構成割傷危險。該釘槍需要同時按下工件接觸元件 (鼻托) 並扣動扳機才能射出釘子。</p> <p>The dual action engagement system on the nailers can malfunction and involuntarily discharge a nail by pulling the trigger alone, posing a laceration hazard to consumers. The nailer should require both the work piece contact element (nose-piece) to be depressed and the trigger to be pulled at the same time in order to discharge a nail.</p>	<p>修理 Repair</p>	

2025 年 7 月 電子電氣產品召回案例 (亞太地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
29	韓國(Korea)	<p>品牌(Brand)：건식</p> <p>品名(Name)：LED 燈 (LED luminaires)</p> <p>型號 (Model)：CH3755XX 18W 320*320 6500K</p>	<p>與產品表面接觸有觸電危險</p> <p>Risk of electric shock when in contact with product surfaces</p>	<p>擁有該產品的消費者應立即停止使用。</p> <p>聯繫或訪問客服中心接受維修、換貨、退款等。</p> <p>Consumers who have the product should stop using it immediately.</p> <p>Contact or visit the contact center to receive repairs, exchanges, refunds, etc.</p>	
29	韓國(Korea)	<p>品牌(Brand)：不詳 (unknown)</p> <p>品名(Name)：LED 燈 (LED luminaires)</p> <p>型號 (Model)：Y-10</p>	<p>過電流混濁時，存在因過熱而著火或爆炸的風險 存在著火和爆炸的風險 存在誤傳的風險</p> <p>There is a risk of ignition or explosion due to overcurrent when the overcurrent is cloudy</p> <p>There is a risk of ignition and explosion There is a risk of misinformation</p>	<p>擁有該產品的消費者應立即停止使用。</p> <p>聯繫或訪問客服中心接受維修、換貨、退款等。</p> <p>Consumers who have the product should stop using it immediately.</p> <p>Contact or visit the contact center to receive repairs, exchanges, refunds, etc.</p>	
29	韓國(Korea)	<p>品牌(Brand)：不詳 (unknown)</p> <p>品名(Name)：睫毛熱成型機 (Eyelash Thermoforming Machine)</p> <p>型號 (Model)：OD-HB110</p>	<p>有提供錯誤資訊的風險，有被燒傷的風險，因為溫升過高</p> <p>There is a risk of providing misinformation</p> <p>There is a risk of burns due to excessive temperature rise</p>	<p>擁有該產品的消費者應立即停止使用。</p> <p>聯繫或訪問客服中心接受維修、換貨、退款等。</p> <p>Consumers who have the product should stop using it immediately.</p> <p>Contact or visit the contact center to receive repairs, exchanges, refunds, etc.</p>	

2025 年 7 月 電子電氣產品召回案例 (亞太地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
28	澳大利亞 (Australia)	<p>品牌(Brand)：Anker 品名(Name)：充電寶 (Power Bank) 型號 (Model)：A1257, A1647, A1681, A1689</p>	<p>充電寶可能會過熱而著火。 如果充電寶過熱著火，有嚴重燒傷和/或財產損失的風險。 海外發生事故，造成財產損失。 The power bank may overheat and catch fire. Risk of serious burn injuries and/or property damage if the power bank overheats and catches fire. Incidents have occurred overseas, resulting in property damage.</p>	<p>請立即停止使用受影響的充電寶。 在 Anker 的網站上查看你的充電寶序號，以確定設備是否受到影響。 在 Anker 的網站上註冊更換充電寶的詳細資訊。 按照當地要求處置受影響的充電寶。在處理更換之前，將尋求處理確認。 安可還將在其網站上為消費者提供如何處置充電寶的說明 Stop using the affected power banks immediately. Check your power bank's serial number on Anker's website to determine if the device is affected. Register your details for a replacement power bank on Anker's website. Dispose of affected Power Banks in accordance with local requirements. Confirmation of disposal will be sought prior to processing a replacement. Anker will also provide instructions for consumers on how to dispose of the power bank on Anker's website</p>	
31	澳大利亞 (Australia)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：LED 蝴蝶棒 (LED Butterfly Wand) 型號 (Model)：不詳 (unknown)</p>	<p>如果幼兒接觸鈕扣/硬幣電池並吞食或將其放入體內，則存在窒息、重傷或死亡的風險。消費者可能並未意識到產品中含有鈕扣電池。 Risk of choking, serious injury or death to young children if they gain access to the button/coin batteries and swallow or place them inside their body. Consumers may be unaware the product contains a button battery.</p>	<p>1. 消費者應立即停止使用該產品，並將其放在兒童接觸不到的地方。 2. 請聯繫 info@electricwonderland.com.au 瞭解如何獲得全額退款以及如何安全處置。 1. Consumers should immediately stop using the product and keep it away from children. 2. Contact info@electricwonderland.com.au for information on how to receive a full refund and information on safe disposal.</p>	