

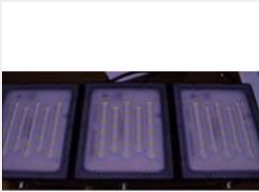

2025 年 6 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
24	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : JVMJUM LEIYA 品名(Name) : 焊接機 (Welding machine) 型號 (Model) : 不詳 (unknown)	<p>缺乏明確的國家語言 (英語) 標籤來指示如何使用按鈕可能會導致使用者誤用產品。使用者可能會意外打開產品並因此燒傷自己。</p> <p>該產品不符合低電壓指令的要求。</p> <p>The lack of clear labels in the national language (English) indicating how to use the buttons could lead to the product being misused by the user. The user may accidentally turn the product on and burn themselves as a result.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product	
24	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : Sedom 品名(Name) : 檯燈 (Table Lamp) 型號 (Model) : SD-T10	<p>插頭和電纜的額定值不足以阻止進水。然而，該產品在說明書上注明可以在室外使用。因此，如果使用者將產品放置在室外，可能會因進水而導致觸電。</p> <p>本產品不符合低電壓指令的要求。</p> <p>The plug and cabling are not adequate ratings to stop water ingress. The product however states it can be used outside on the instructions. Therefore, if the user were to place the product outside, it could cause an electric shock due to water damage.</p> <p>This product does not comply with the requirements of the Low Voltage Directive.</p>	產品銷毀 Destruction of the product	
25	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : MS 品名(Name) : 連接器 (Connector) 型號 (Model) : 不詳 (unknown)	<p>連接器上的插頭隨附的保險絲不含足夠的顆粒填充物。如果發生故障並且保險絲失靈，插頭可能會從牆上爆炸並引起火災。如果用戶靠近電源，也可能會被燒傷。</p> <p>該產品不符合低電壓指令的要求。</p> <p>The plug attached to the connector is supplied with a fuse that does not contain a sufficient granular filler. If a fault occurs and the fuse malfunctions, the plug can explode from the wall and cause a fire. If the user is near the power source, they may also receive burns.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	邊境拒絕進口 Import rejected at border	

2025 年 6 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
25	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : EZEGO 品名(Name) : 充電器 (Charger) 型號 (Model) : STC-8139LC (Charger) TD-10/EZE024-014-15-G (E-Bike)	充電器電源線電阻過大。隨著時間的推移，這可能會導致充電器過熱並著火。 該產品不符合機械指令的要求。 The charger supply cord has excessive resistance. This can lead to the charger overheating over time and catching fire. The product does not comply with the requirements of the Machinery Directive.	邊境拒絕進口 Import rejected at border	
25	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : Shenzhen Mingchuan lighting technology Co Ltd 品名(Name) : 感應燈 (Sensor light) 型號 (Model) : 603 608	插頭插腳尺寸不正確且不適合塑膠外殼。因此，用戶可能會觸摸帶電部件並受到電擊。此外，這個問題可能會導致銷隨著時間的推移不均勻磨損或在使用過程中損壞。損壞或磨損的銷釘可能會過熱並著火。 本產品不符合低電壓指令的要求。 The plug pins are incorrectly sized and do not fit in the plastic casing. The user could consequently touch live parts and receive an electric shock. Moreover, this issue can cause the pins to wear down unevenly over time or become damaged during use. Damaged or worn pins can overheat and catch fire. This product does not comply with the requirements of the Low Voltage Directive.	終端使用者手中召回產品 Recall of the product from end users	
25	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : Li-ion Charger 品名(Name) : 充電器 (Charger) 型號 (Model) : 4220 LP-60L	插頭插腳尺寸不正確，無法安全插入插座。用戶可能會因可觸及的帶電部件而遭受電擊。 該產品不符合低電壓指令的要求。 The plug pins are incorrectly sized and cannot be safely plugged into the socket. A user could receive an electric shock from accessible live parts. The product does not comply with the requirements of the Low Voltage Directive.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 終端使用者手中召回產品 Recall of the product from end users	

2025 年 6 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
25	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : STASUN 品名(Name) : LED 燈 (LED light) 型號 (Model) : 110	<p>說明書錯誤地指出該產品適合戶外使用。電源線橫截面不適合長時間暴露在戶外，隨著時間的推移會導致性能惡化並暴露帶電部件，從而產生火災風險。</p> <p>該產品不符合低電壓指令的要求。</p> <p>The instructions incorrectly state that the product is suitable for outdoor use. The supply cord cross-section is not suitable for prolonged exposure outdoors, leading to a deterioration over time and exposing live parts, creating a risk of fire.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	邊境拒絕進口 Import rejected at border	
25	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : JINNUOYI 品名(Name) : 電池充電器 (Battery charger) 型號 (Model) : NY-12-B	<p>插頭沒有顆粒狀填料。如果在使用過程中發生電氣故障，產品可能會起火。</p> <p>該產品不符合低電壓指令的要求。</p> <p>The plug has no granular filler. If an electrical failure occurs during use, the product may catch fire.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product	
25	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : 不詳 (unknown) 品名(Name) : 空氣壓縮機 (Air compressor) 型號 (Model) : SS906	<p>3 針“三葉草”式插頭沒有保險絲裝置。如果在使用過程中出現故障，插頭可能會過熱並著火。</p> <p>該產品不符合低電壓指令的要求。</p> <p>The 3-pin 'clover' style plug does not have the facility for a fuse link. If a fault occurs during use, the plug can overheat and catch fire.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	邊境拒絕進口 Import rejected at border	

2025 年 6 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
25	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : POWAROBOR 品名(Name) : 電池充電器 (Battery charger) 型號 (Model) : DCB112	<p>電源線電阻過大。如果產品處於充電狀態，隨著時間的推移，它可能會過熱並著火。</p> <p>該產品不符合低電壓指令的要求。</p> <p>The mains supply cord has excessive resistance. If the product is placed on charge, it can overheat over time and catch fire.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	邊境拒絕進口 Import rejected at border	
25	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : Guangzhou Welltop Intelligent Appliance Co. Ltd 品名(Name) : 直發器 (Hair straightener) 型號 (Model) : RC01	<p>該產品包含與未接地的易觸及金屬部件接觸的絕緣接線。此外，保險絲的長度低於最小指定長度並且額定值不正確。在故障情況下，它可能無法提供所需的保護，並且設備可能會短路，從而產生觸電風險。</p> <p>該產品不符合低電壓指令的要求。</p> <p>The product contains insulation wiring which is in contact with unearthed, accessible metal parts. Moreover, the fuse is below the minimum specified length and is incorrectly rated. Under fault conditions, it may not provide the required protection and the appliance could short-circuit, creating a risk of electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 終端使用者手中召回產品 Recall of the product from end users	
25	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : Wefomey 品名(Name) : 電源 (Power supply) 型號 (Model) : LGY-363000	<p>接地保護不充分，產品絕緣不合適，容易觸及帶電部件。用戶可能會觸摸可觸及的帶電部件並受到電擊。</p> <p>該產品不符合低電壓指令的要求。</p> <p>The earthing protection is inadequate and the product insulation is inappropriate, leaving live parts accessible. The user could touch the accessible live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	邊境拒絕進口 Import rejected at border	

2025年6月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
25	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand)：Baoshishan 品名(Name)：電鍋 (Electric cooker) 型號 (Model)：不詳 (unknown)	<p>插頭插腳尺寸不正確且接地保護不充分，導致帶電部件容易觸及。用戶可能會觸摸可觸及的帶電部件並受到電擊。該產品不符合低電壓指令的要求。</p> <p>The plug pins are incorrectly sized and the earthing protection is inadequate, leaving live parts accessible. The user could touch the accessible live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product	
26	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand)：不詳 (unknown) 品名(Name)：LED 燈 (LED light) 型號 (Model)：HD-M6X	<p>插頭裝有不適當的保險絲，且沒有顆粒填充物。另外，插頭上的插腳距離產品的週邊太近。插頭可能會過熱並點燃，從而引起火災。</p> <p>本產品不符合低電壓指令的要求。</p> <p>The plug is fitted with an inadequate fuse with no granular filler. Additionally, the pins on the plug are too close to the periphery of the product. The plug can overheat and ignite, causing a fire.</p> <p>This product does not comply with the requirements of the Low Voltage Directive.</p>	邊境拒絕進口 Import rejected at border	
26	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand)：Chongzheng(HK)Co Ltd 品名(Name)：USB 充電器 (USB charger) 型號 (Model)：RE-PD3509	<p>初級和次級電路之間的電氣間隙和爬電距離不足。此外，電源線尺寸過小，內部電源線也沒有充分固定。因此，產品可能會著火。此外，該產品的插頭中沒有顆粒狀填充物，可確保故障情況下的安全運行。如果產品在使用過程中發生電氣故障，可能會引起火災。</p> <p>本產品不符合低電壓指令的要求。</p> <p>The clearance and creepage distances between the primary and secondary circuits are inadequate. Moreover, the supply cord is undersized and internal mains wiring is not adequately secured. Therefore, the product may catch fire. Additionally, there is no granular filler in the product's plug to ensure safe operations under fault conditions. If the product has an electrical failure during use, it may catch fire.</p> <p>This product does not comply with the requirements of the Low Voltage Directive.</p>	邊境拒絕進口 Import rejected at border	

2025年6月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
26	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	<p>品牌(Brand) : Bozan 品名(Name) : 電熱板 (Electronic Hot Plate) 型號 (Model) : 946C</p>	<p>插頭內的保險絲顆粒填充物不足。填充物需要確保保險絲在故障情況下安全運行，如果沒有填充物可能會導致插頭過熱和/或爆炸，從而產生燒傷和火災的風險。 該產品不符合低電壓指令的要求。 The fuse within the plug has insufficient granular filler. The filler is required to ensure the safe operation of the fuse under fault conditions, and its absence could lead to the plug overheating and/or exploding, creating a risk of burns and fire. The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product</p>	
26	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	<p>品牌(Brand) : Wefomey 品名(Name) : 電源適配器 (Power adaptor) 型號 (Model) : WFM-2406</p>	<p>接地保護不充分，產品絕緣不合適，容易觸及帶電部件。用戶可能會觸摸可觸及的帶電部件並受到電擊。 本產品不符合低電壓指令的要求。 The earthing protection is inadequate and the product's insulation is inappropriate, leaving live parts accessible. The user could touch the accessible live parts and receive an electric shock. This product does not comply with the requirements of the Low Voltage Directive.</p>	<p>邊境拒絕進口 Import rejected at border</p>	
26	立陶宛 (Lithuania)	<p>品牌(Brand) : 不詳 (unknown) 品名(Name) : 熱水器 (Water heater) 型號 (Model) : RX-005</p>	<p>電氣絕緣不充分、不夠充分。用戶可能會因可觸及的帶電部件而受到電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335。 The electrical insulation is inadequate and insufficient. The user could receive an electric shock from accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335.</p>	<p>從市場撤回 Withdrawal of the product from the market</p>	

2025 年 6 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
23	匈牙利 (Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：303M</p>	<p>電纜未正確固定（缺少電纜應力消除裝置），可觸及的電線絕緣層不足，並且電線延長插座的結構允許插頭單極插入。此外，儘管建議在戶外使用，但該產品並未防潮。水可能會滲入產品，或者使用者可能會接觸到可觸及的帶電部件並遭受電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60598。</p> <p>The cable is not properly anchored (missing cable strain relief), the accessible wires have inadequate insulation, and the structure of the cord extension socket allows single-pole insertion of plugs. Moreover, the product is not protected against moisture although it is recommended for outdoor use. Water could penetrate the product or the user could touch the accessible live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market 產品銷毀 Destruction of the product 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	
23	匈牙利 (Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：505 AJ-1003</p>	<p>電纜未正確固定（缺少電纜應力消除裝置）並且可觸及的電線絕緣層不足。此外，電源線延長插座允許插頭單極插入。此外，連接插頭的尺寸不符合規格。此外，儘管建議在戶外使用，但該產品並未防潮。水可能會滲入產品，或者使用者可能會接觸到可觸及的帶電部件，從而可能導致觸電。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60598。</p> <p>The cable is not properly anchored (missing cable strain relief) and the accessible wires have inadequate insulation. Moreover, the cord extension socket allows for single-pole insertion of plugs. Furthermore, the dimensions of the connection plug do not comply with the specifications. Additionally, the product is not protected against moisture although it is recommended for outdoor use. Water could penetrate the product or the user could touch accessible live parts, which may cause an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market</p>	

2025 年 6 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
23	匈牙利 (Hungary)	<p>品牌(Brand)：IBHDME TPSTER 品名(Name)：USB 充電器 (USB charger) 型號 (Model)：63912</p>	<p>產品的絕緣性不足。用戶可能會因可觸及的帶電部件而受到電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1。 The insulation of the product is inadequate. The user could receive an electric shock from accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	<p>從市場撤回 Withdrawal of the product from the market</p>	
23	匈牙利 (Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：XM-144-C-N-LO</p>	<p>電纜未正確固定且產品絕緣不足。用戶可能會觸摸可觸及的帶電部件，從而可能導致觸電。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60598。 The cable is not properly anchored and the product has inadequate insulation. The user could touch accessible live parts, which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	
23	匈牙利 (Hungary)	<p>品牌(Brand)：ORIGINAL 品名(Name)：USB 充電器 (USB charger) 型號 (Model)：A-08 APD-889</p>	<p>產品的絕緣性不足。用戶可能會因可觸及的帶電部件而遭受電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1。 The insulation of the product is inadequate. The user could receive an electric shock from accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	<p>從市場撤回 Withdrawal of the product from the market</p>	

2025年6月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
23	匈牙利 (Hungary)	品牌(Brand) : HAOJUE 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : LCF-123 H105	<p>產品的絕緣性不足。用戶可能會因可觸及的帶電部件而受到電擊。</p> <p>該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1。</p> <p>The insulation of the product is inadequate. The user could receive an electric shock from accessible live parts.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	從市場撤回 Withdrawal of the product from the market	
23	匈牙利 (Hungary)	品牌(Brand) : INKAX 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : HC-02	<p>該產品絕緣性能不足。用戶可能會觸摸可觸及的帶電部件並受到電擊。</p> <p>該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1。</p> <p>The product has inadequate insulation. The user could touch accessible live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	
23	匈牙利 (Hungary)	品牌(Brand) : EZRA 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : HC-03	<p>該產品絕緣性能不足。用戶可能會觸摸可觸及的帶電部件並受到電擊。</p> <p>該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1。</p> <p>The product has inadequate insulation. The user could touch accessible live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	

2025年6月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
23	匈牙利 (Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：XM-180-R-I-LN</p>	<p>產品絕緣不良，連接插頭、插座尺寸不符合規範。因此，用戶可能會觸摸可觸及的帶電部件並受到電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60598。</p> <p>The product has inadequate insulation, and the dimensions of the connection plug and socket do not comply with the specifications. The user could consequently touch accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market</p>	
23	匈牙利 (Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：505M</p>	<p>電纜未正確固定（缺少電纜應力消除裝置），可觸及的電線絕緣層不足，並且電線延長插座的結構允許插頭單極插入。此外，儘管建議在戶外使用，但該產品並未防潮。水可能會滲入產品，或者使用者可能會接觸到可觸及的帶電部件並遭受電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60598。</p> <p>The cable is not properly anchored (the cable strain relief is missing), the accessible wires have inadequate insulation, and the structure of the cord extension socket allows single-pole insertion of plugs. Moreover, the product is not protected against moisture although it is recommended for outdoor use. The water could penetrate the product or the user could touch the accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market 產品銷毀 Destruction of the product 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	
24	匈牙利 (Hungary)	<p>品牌(Brand)：SINKAL STAR 品名(Name)：USB 充電器 (USB charger) 型號 (Model)：SK-1102</p>	<p>產品的絕緣層和電源插頭尺寸不足。用戶可能會因可觸及的帶電部件而受到電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1。</p> <p>The insulation and the mains plug's dimensions of the product are inadequate. The user could receive an electric shock from accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	<p>從市場撤回 Withdrawal of the product from the market</p>	

2025年6月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
24	匈牙利 (Hungary)	品牌(Brand) : TREQA 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : CH-642	<p>該產品絕緣性能不足。用戶可能會觸摸可觸及的帶電部件，從而可能導致觸電。</p> <p>該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1。</p> <p>The product has inadequate insulation. The user could touch accessible live parts, which may cause an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	
24	匈牙利 (Hungary)	品牌(Brand) : JOKADE 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : JB043	<p>該產品絕緣性能不足。用戶可能會觸摸可觸及的帶電部件，從而可能導致觸電。</p> <p>該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1。</p> <p>The product has inadequate insulation. The user could touch accessible live parts, which may cause an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	從市場撤回 Withdrawal of the product from the market	
24	匈牙利 (Hungary)	品牌(Brand) : TREQA 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : CH-634	<p>該產品絕緣性能不足。用戶可能會觸摸可觸及的帶電部件，從而可能導致觸電。</p> <p>該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1。</p> <p>The product has inadequate insulation. The user could touch accessible live parts, which may cause an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	


2025年6月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
24	匈牙利 (Hungary)	品牌(Brand) : INKAX 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : HC-03	<p>該產品絕緣性能不足。用戶可能會觸摸可觸及的帶電部件，從而可能導致觸電。</p> <p>該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1。</p> <p>The product has inadequate insulation. The user could touch accessible live parts, which may cause an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	
24	匈牙利 (Hungary)	品牌(Brand) : 不詳 (unknown) 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : A1004	<p>該產品絕緣性能不足。用戶可能會觸摸可觸及的帶電部件，從而可能導致觸電。</p> <p>該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1。</p> <p>The product has inadequate insulation. The user could touch accessible live parts, which may cause an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	
24	匈牙利 (Hungary)	品牌(Brand) : TREQA 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : CH-630	<p>該產品絕緣性能不足。用戶可能會觸摸可觸及的帶電部件，從而可能導致觸電。</p> <p>該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1。</p> <p>The product has inadequate insulation. The user could touch accessible live parts, which may cause an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	

2025 年 6 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
24	匈牙利 (Hungary)	<p>品牌(Brand) : CIRI 品名(Name) : 美甲和足療套裝 (Manicure and pedicure set) 型號 (Model) : 不詳 (unknown)</p>	<p>該產品絕緣性能不足。連接插頭和插座的尺寸不符合規範。用戶可能會觸摸可觸及的帶電部件，從而可能導致觸電。該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335。</p> <p>The product has inadequate insulation. The dimensions of the connection plug and the socket do not comply with the specifications. The user could touch accessible live parts, which may cause an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335.</p>	<p>邊境拒絕進口 Import rejected at border</p>	
25	匈牙利 (Hungary)	<p>品牌(Brand) : VFAN 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : E03</p>	<p>產品的絕緣性不足。用戶可能會因可觸及的帶電部件而受到電擊。</p> <p>該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1</p> <p>The insulation of the product is inadequate. The user could receive an electric shock from accessible live parts.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1</p>	<p>終端使用者手中召回產品 Recall of the product from end users</p>	
25	匈牙利 (Hungary)	<p>品牌(Brand) : ORIGINAL 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : 3A7554-AJ-H-0200-002</p>	<p>產品的絕緣性不足。用戶可能會因可觸及的帶電部件而受到電擊。</p> <p>該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1</p> <p>The insulation of the product is inadequate. The user could receive an electric shock from accessible live parts.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1</p>	<p>從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	

2025 年 6 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
25	匈牙利 (Hungary)	<p>品牌(Brand) : JOKADE 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : JB007 JB008</p>	<p>產品的絕緣性不足。用戶可能會因可觸及的帶電部件而受到電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1。 The insulation of the product is inadequate. The user could receive an electric shock from accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	<p>禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures 終端使用者手中召回產品 Recall of the product from end users</p>	
25	匈牙利 (Hungary)	<p>品牌(Brand) : EZRA 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : HC19</p>	<p>產品的絕緣性不足。用戶可能會因可觸及的帶電部件而受到電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1。 The insulation of the product is inadequate. The user could receive an electric shock from accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	<p>從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users</p>	
25	匈牙利 (Hungary)	<p>品牌(Brand) : XO 品名(Name) : 旅行適配器 (Travel adaptor) 型號 (Model) : XO-WL01</p>	<p>在使用過程中，產品的帶電部件變得容易觸及。此外，產品的絕緣性也不夠。用戶可能會因可觸及的帶電部件而受到電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1。 The live parts of the product become accessible during use. Moreover, the insulation of the product is inadequate. The user could receive an electric shock from accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	<p>線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 終端使用者手中召回產品 Recall of the product from end users</p>	

2025 年 6 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
25	匈牙利 (Hungary)	品牌(Brand) : XO 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : XO-L100	產品的絕緣性不足。用戶可能會因可觸及的帶電部件而受到電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1 The insulation of the product is inadequate. The user could receive an electric shock from accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1	終端使用者手中召回產品 Recall of the product from end users	
25	匈牙利 (Hungary)	品牌(Brand) : Letang 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : LT-CT-45	產品的絕緣性不足。用戶可能會因可觸及的帶電部件而受到電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1 The insulation of the product is inadequate. The user could receive an electric shock from accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1	從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users	
25	匈牙利 (Hungary)	品牌(Brand) : EZRA 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : HC-46	產品的絕緣性不足。用戶可能會因可觸及的帶電部件而受到電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1 The insulation of the product is inadequate. The user could receive an electric shock from accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1	終端使用者手中召回產品 Recall of the product from end users	
25	匈牙利 (Hungary)	品牌(Brand) : TREQA 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : CH_9038	產品的絕緣性不足。用戶可能會因可觸及的帶電部件而受到電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1。 The insulation of the product is inadequate. The user could receive an electric shock from accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.	從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	

2025 年 6 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
25	匈牙利 (Hungary)	<p>品牌(Brand) : Hongyu 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : HY-27</p>	<p>產品的絕緣性不足。用戶可能會因可觸及的帶電部件而受到電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1。 The insulation of the product is inadequate. The user could receive an electric shock from accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	<p>禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	
25	西班牙 (Spain)	<p>品牌(Brand) : D8 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : 111802</p>	<p>電線直徑太小，導致產品過熱起火。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60598。 The diameter of the wire is too small, leading the product to overheat and catch fire. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	
23	法國 (France)	<p>品牌(Brand) : ANILAR 品名(Name) : 防蟲燈 (Anti-insect lamp) 型號 (Model) : HYD-91B HYD-91D</p>	<p>產品絕緣不足，燒烤架的帶電部件容易觸及，產品關閉後仍然存在過大電流。因此，用戶可能會觸摸帶電部件並受到電擊。此外，呼吸機的移動部件容易觸及，可能會傷害用戶。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1 和 60335-2。 The product has insufficient insulation, the live parts of the grill are accessible and excessive electric current is still present after the product is turned off. The user could consequently touch live parts and receive an electric shock. In addition, the mobile parts of the ventilator are accessible and could injure the user. The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60335-1 and 60335-2.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market</p>	




2025年6月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
26	法國 (France)	<p>品牌(Brand) : Akashi 品名(Name) : 旅行適配器 (Travel adaptor) 型號 (Model) : ALTWP200WH</p>	<p>產品的帶電部件易於觸及。用戶可能會觸摸它們並受到電擊。 該產品不符合低電壓指令的要求。 The live parts of the product are easily accessible. The user could touch them and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>停止銷售 Stop of sales 終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market</p>	
26	法國 (France)	<p>品牌(Brand) : Eglo 品名(Name) : 吸頂燈 (Ceiling lamp) 型號 (Model) : 3X E27 28W SABLE ET NOIR</p>	<p>產品未正確接地。如果發生電氣故障，產品將無法斷開連接，從而增加用戶觸電的風險。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 62368-1 和 EN 60598-2-1。 The product is incorrectly earthed. If an electrical fault occurred, the product would not disconnect, increasing the risk of electric shock to the user. The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 62368-1 and EN 60598-2-1.</p>	<p>從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users</p>	
23	波蘭 (Poland)	<p>品牌(Brand) : 不詳 (unknown) 品名(Name) : 吊燈 (Ceiling lamp) 型號 (Model) : 40-60 ZQ-1X-ZQ</p>	<p>電線僅受到基本絕緣的保護，並與燈具的金屬部件接觸。如果絕緣損壞，帶電部件可能會被觸及，從而導致觸電風險。 該產品不符合低電壓指令和歐洲標準 EN 60598-1 的要求。 The wires are protected with basic insulation only and are in contact with metal parts of the luminaire. In case of insulation damage live parts may become accessible, leading to a risk of electric shock. The product does not comply with the requirements of the Low Voltage Directive and the European standard EN 60598-1.</p>	<p>邊境拒絕進口 Import rejected at border</p>	

2025年6月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
23	波蘭 (Poland)	品牌(Brand)：不詳 (unknown) 品名(Name)：吊燈 (Ceiling lamp) 型號 (Model)：9001-400GD	<p>產品上的電線開口具有鋒利的邊緣，電源線可能會因接觸帶電部件而損壞。此外，燈具的金屬部件並未永久連接至接地端子，存在觸電危險。</p> <p>該產品不符合低電壓指令或歐洲標準 EN 60598-1 的要求。</p> <p>The wire opening on the product has sharp edges and the power supply cable could be damaged giving access to live parts. Moreover, the metal parts of the luminaire are not permanently connected to the earthing terminal, leading to a risk of electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor the European standard EN 60598-1.</p>	邊境拒絕進口 Import rejected at border	
24	波蘭 (Poland)	品牌(Brand)：Msonic 品名(Name)：USB 充電器 (USB charger) 型號 (Model)：MY6613K	<p>該產品絕緣性能不足。用戶可能會觸摸可觸及的帶電部件，從而可能導致觸電。</p> <p>該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1。</p> <p>The product has inadequate insulation. The user could touch accessible live parts, which may cause an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	產品銷毀 Destruction of the product 從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks	
24	波蘭 (Poland)	品牌(Brand)：不詳 (unknown) 品名(Name)：吊燈 (Ceiling lamp) 型號 (Model)：CD109	<p>電線僅受到基本絕緣的保護，並與燈具的金屬部件接觸。如果絕緣損壞，用戶可能會觸摸可觸及的帶電部件並遭受電擊。</p> <p>該產品不符合低電壓指令或歐洲標準 EN 60598-1 的要求。</p> <p>The wires are protected with basic insulation only and are in contact with metal parts of the luminaire. In case of insulation damage the user could touch accessible live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor the European standard EN 60598-1.</p>	邊境拒絕進口 Import rejected at border	

2025年6月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
24	波蘭 (Poland)	品牌(Brand)：不詳 (unknown) 品名(Name)：吊燈 (Ceiling lamp) 型號 (Model)：ZQ-1X-ZQ	<p>電線僅受到基本絕緣的保護，並與燈具的金屬部件接觸。如果絕緣損壞，用戶可能會觸摸可觸及的帶電部件並遭受電擊。</p> <p>該產品不符合低電壓指令或歐洲標準 EN 60598-1 的要求。The wires are protected with basic insulation only and are in contact with metal parts of the luminaire. In case of insulation damage the user could touch accessible live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor the European standard EN 60598-1.</p>	邊境拒絕進口 Import rejected at border	
25	波蘭 (Poland)	品牌(Brand)：ORO by LED POL 品名(Name)：燈具 (Lighting fixture) 型號 (Model)：ORO33011	<p>由於對光源的訪問有限，使用者可能被迫使用金屬工具來更換它們。金屬工具可能會接觸帶電部件，從而導致觸電。該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60598-1。</p> <p>Due to limited access to the light sources, the user may be forced to use metal tools to replace them. The metal tool may come into contact with live parts, resulting in electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598-1.</p>	警告消費者風險 Warning consumers of the risks 從市場撤回 Withdrawal of the product from the market	
25	波蘭 (Poland)	品牌(Brand)：不詳 (unknown) 品名(Name)：吊燈 (LCeiling light) 型號 (Model)：不詳 (unknown)	<p>電線僅受到基本絕緣的保護，並與燈具的金屬部件接觸。如果絕緣損壞，可能會觸及帶電部件。用戶可能會受到電擊。該產品不符合低電壓指令或歐洲標準 EN 60598-1 的要求。The wires are protected with basic insulation only and are in contact with metal parts of the luminaire. In case of insulation damage, live parts may become accessible. The user could receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor the European standard EN 60598-1.</p>	邊境拒絕進口 Import rejected at border	

2025年6月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
25	波蘭 (Poland)	品牌(Brand) : GREENBERRY 品名(Name) : 電風扇 (Electric fan) 型號 (Model) : VENETO-40GR	<p>風扇的葉片很容易接觸到。設備運行時，使用者可能會觸摸葉片並受傷或割傷。此外，該產品的絕緣性能不足。用戶可能會因可觸及的帶電部件而受到電擊。</p> <p>該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1 和 EN 60335-2-80。</p> <p>The fan's shoulder blades are easily accessible. The user may touch shoulder blades while the device operates and suffer injuries or cuts. Additionally, the product's insulation is inadequate. The user could receive an electric shock from accessible live parts.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60335-1 and EN 60335-2-80.</p>	從市場撤回 Withdrawal of the product from the market 產品銷毀 Destruction of the product 警告消費者風險 Warning consumers of the risks	
26	芬蘭 (Finland)	品牌(Brand) : 不詳 (unknown) 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : DA_7136846798	<p>產品的絕緣性不足。用戶可能會因可觸及的帶電部件而受到電擊。</p> <p>該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 62368-1。</p> <p>The insulation of the product is inadequate. The user could receive an electric shock from accessible live parts.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 62368-1.</p>	終端使用者手中召回產品 Recall of the product from end users	
26	芬蘭 (Finland)	品牌(Brand) : Apokin 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : PC802V AP-60220 PC802	<p>產品的絕緣性不足。用戶可能會因可觸及的帶電部件而受到電擊。</p> <p>該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 62368-1。</p> <p>The insulation of the product is inadequate. The user could receive an electric shock from accessible live parts.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 62368-1.</p>	終端使用者手中召回產品 Recall of the product from end users	

2025年6月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
26	芬蘭 (Finland)	<p>品牌(Brand) : mietubi 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : MTB-CS02E</p>	<p>產品的絕緣性不足。用戶可能會因可觸及的帶電部件而受到電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 62368-1。 The insulation of the product is inadequate. The user could receive an electric shock from accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 62368-1.</p>	<p>終端使用者手中召回產品 Recall of the product from end users</p>	
26	芬蘭 (Finland)	<p>品牌(Brand) : ellietech 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : CD403</p>	<p>產品的絕緣性不足。用戶可能會因可觸及的帶電部件而受到電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 62368-1。 The insulation of the product is inadequate. The user could receive an electric shock from accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 62368-1.</p>	<p>終端使用者手中召回產品 Recall of the product from end users</p>	
25	捷克 (Czechia)	<p>品牌(Brand) : 不詳 (unknown) 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : 50L / HLT1615E</p>	<p>電源未正確固定且蓋子未緊固。用戶可能會觸摸可觸及的帶電部件並受到電擊。 該產品不符合低電壓指令的要求。 The power supply is not properly anchored and its cover is not securely fastened. The user could touch the accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	
26	捷克 (Czechia)	<p>品牌(Brand) : 不詳 (unknown) 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : DN-100</p>	<p>產品的電源未牢固地固定在電子單元上，這使得帶電部件容易被觸及。用戶可能會觸摸可觸及的帶電部件並受到電擊。 該產品不符合低電壓指令的要求。 The power supply of the product is not securely anchored to the electronic unit, which makes live parts accessible. The user could touch the accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>停止銷售 Stop of sales</p>	

2025 年 6 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
26	捷克 (Czechia)	品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：LAI-80LED.G	產品的電源未牢固地固定在電子單元上，這使得帶電部件容易被觸及。用戶可能會觸摸可觸及的帶電部件並受到電擊。該產品不符合低電壓指令的要求。 The power supply of the product is not securely anchored to the electronic unit, which makes live parts accessible. The user could touch the accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive.	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	
26	斯洛伐克 (Slovakia)	品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：ART NO: 303B	由於產品機械強度不足，可能會觸及帶電部件。此外，該產品的導體標稱橫截面積不足，也不符合聲明的防潮要求。這可能會導致用戶觸電。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60598-1 和 EN 60598-2-20。 Due to the insufficient mechanical strength of the product, access to live parts is possible. Moreover, the product has an insufficient nominal cross-section of the conductors and also does not meet the declared requirements for protection against moisture. This may result in a user receiving an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-1 and EN 60598-2-20.	從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks 終端使用者手中召回產品 Recall of the product from end users	
26	斯洛伐克 (Slovakia)	品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：100ML	由於產品機械強度不足，可能會觸及帶電部件。此外，該產品的導體標稱橫截面積不足，也不符合聲明的防潮要求。這可能會導致用戶觸電。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60598-1 和 EN 60598-2-20。 Due to the insufficient mechanical strength of the product, access to live parts is possible. Moreover, the product has an insufficient nominal cross-section of the conductors and also does not meet the declared requirements for protection against moisture. This may result in a user receiving an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-1 and EN 60598-2-20.	從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks 終端使用者手中召回產品 Recall of the product from end users	

2025 年 6 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
26	斯洛伐克 (Slovakia)	品牌(Brand) : Five pointed star 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : 20L-600L	<p>由於產品機械強度不夠、電線截面不夠、叉叉與第一插座之間的電纜長度不夠，用戶可能會觸及帶電部件而觸電。該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60598-1 和 EN 60598-2-20。</p> <p>Due to insufficient mechanical strength of the product, an insufficient cross-section of the wires, and an insufficient length of the cable between the fork and the first socket, the user may access live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-1 and EN 60598-2-20.</p>	從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks 終端使用者手中召回產品 Recall of the product from end users	
26	斯洛伐克 (Slovakia)	品牌(Brand) : 不詳 (unknown) 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : 588	<p>由於燈鏈的機械強度不足，可能會接觸到帶電部件，從而可能導致觸電。該產品還存在其他技術缺陷，可能對消費者的安全或健康構成風險，例如導體標稱橫截面不足、設計不足、擴展插座允許單極插頭插入且不符合聲明的防潮要求。該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60598-1 和 EN 60598-2-20。</p> <p>Due to the insufficient mechanical strength of the lighting chain, access to live parts is possible, which may result in an electric shock. The product has other technical deficiencies that could pose a risk to the safety or health of consumers such as insufficient nominal cross-section of the conductors, insufficient design, when the extension socket allows a single-pole plug insertion and also does not meet the declared requirements for protection against moisture.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-1 and EN 60598-2-20.</p>	從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks 終端使用者手中召回產品 Recall of the product from end users	

2025年6月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
26	斯洛伐克 (Slovakia)	品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：SD72RGB	<p>由於產品機械強度不夠、電線截面不夠、叉叉與第一插座之間的電纜長度不夠，用戶可能會觸及帶電部件而觸電。該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60598-1 和 EN 60598-2-20。</p> <p>Due to insufficient mechanical strength of the product, an insufficient cross-section of the wires, and an insufficient length of the cable between the fork and the first socket, the user may access live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-1 and EN 60598-2-20.</p>	從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks 終端使用者手中召回產品 Recall of the product from end users	
26	斯洛伐克 (Slovakia)	品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：3025	<p>由於產品機械強度不夠、電線截面不夠、叉叉與第一插座之間的電纜長度不夠，用戶可能會觸及帶電部件而觸電。此外，該產品不符合聲明的防潮要求。該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60598-1 和 EN 60598-2-20。</p> <p>Due to insufficient mechanical strength of the product, an insufficient cross-section of the wires, and an insufficient length of the cable between the fork and the first socket, the user may access live parts and receive an electric shock. In addition, the product does not meet the declared requirements for protection against moisture.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-1 and EN 60598-2-20.</p>	從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks 終端使用者手中召回產品 Recall of the product from end users	

2025 年 6 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
26	斯洛伐克 (Slovakia)	品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：37490	<p>由於產品機械強度不足，可能會觸及帶電部件。此外，該產品的導體標稱橫截面積不足，也不符合聲明的防潮要求。這可能會導致用戶觸電。</p> <p>該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60598-1 和 EN 60598-2-20。</p> <p>Due to the insufficient mechanical strength of the product, access to live parts is possible. Moreover, the product has an insufficient nominal cross-section of the conductors and also does not meet the declared requirements for protection against moisture. This may result in the user receiving an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-1 and EN 60598-2-20.</p>	從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks 終端使用者手中召回產品 Recall of the product from end users	

2025 年 6 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
26	瑞典 (Sweden)	<p>品牌(Brand) : Muarron 品名(Name) : 頭戴式耳機 (Headphones) 型號 (Model) : 不詳 (unknown)</p>	<p>該產品的塑膠材料中鄰苯二甲酸二 (2-乙基己基) 酯 (DEHP) 和短鏈氯化石蠟 (SCCP) 濃度過高 (測量值: 按重量計分別高達 0.22%和 1.6%)。產品中的焊料鎘含量超標。(測量值 0.4%重量)。DEHP 對人類健康和環境構成風險。短鏈氯化石蠟在環境中持續存在, 低濃度時對水生生物有毒, 並在野生動物和人類體內生物累積, 對人類健康和環境構成風險。鎘具有生物累積性, 對環境構成風險。該產品不符合關於限制在電氣和電子設備中使用某些有害物質的指令 (RoHS 2 指令) 的要求, 也不符合持久性有機污染物 (POP) 法規的要求。</p> <p>The plastic material of the product has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) and short chain chlorinated paraffins (SCCPs) (measured values: up to 0.22% and 1.6% by weight, respectively). The solders in the product have an excessive concentration of cadmium. (measured value 0.4% by weight). DEHP poses a risk to human health and the environment. SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bio-accumulate in wildlife and humans, posing a risk to human health and the environment. Cadmium is bio-accumulates and poses a risk to the environment.</p> <p>The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive) nor with the Persistent Organic Pollutants (POP) Regulation.</p>	<p>線上市場刪除了該產品清單 Removal of this product listing by the online marketplace</p>	
23	德國 (Germany)	<p>品牌(Brand) : POWER STRIP (LUF EIS) 品名(Name) : 電源延長線 (Extension lead) 型號 (Model) : F09U</p>	<p>電源電纜中沒有保護導體, 如果發生故障, 所連接設備的裸露導電部分就會帶電, 從而導致電擊風險。該產品不符合低電壓指令的要求。</p> <p>There is no protective conductor in the supply cable, leading to a risk of electric shock since exposed conductive parts of the connected devices become live in the event of a fault.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks</p>	

2025 年 6 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
25	德國 (Germany)	<p>品牌(Brand) : AOFO 品名(Name) : 電源延長線 (Extension lead) 型號 (Model) : SE3631</p>	<p>初級和次級電路之間的電氣間隙和爬電距離不足。由於僅安裝了焊點，因此未滿足與接地連接相關的設計要求。因此，用戶可能會因觸摸可觸及的帶電部件而受到電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 62368-1。 The clearance and creepage distances between the primary and secondary circuits are inadequate. The design requirements relating to earthing connections are not met, since only a solder joint has been fitted. Consequently, the user can receive an electric shock from touching accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 62368-1.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures 產品銷毀 Destruction of the product</p>	
25	德國 (Germany)	<p>品牌(Brand) : GRN-FLASHING 品名(Name) : 投影儀 (Projector) 型號 (Model) : HC19</p>	<p>雷射光束太強大，產品缺乏必要的標籤。因此該產品會對視力造成損害。 該產品不符合通用產品安全法規的要求，也不符合歐洲標準 EN 50689 和 EN 60825-1。 The laser beam is too powerful and the product lacks the necessary labelling. Therefore the product can cause damage to sight. The product does not comply with the requirements of the General Product Safety Regulation nor with the European standards EN 50689 and EN 60825-1.</p>	<p>線上市場刪除了該產品清單 Removal of this product listing by the online marketplace</p>	
25	德國 (Germany)	<p>品牌(Brand) : SUNBEYOND 品名(Name) : LED 燈 (LED light) 型號 (Model) : 2835-120 White 6000K-3m/9.84ft</p>	<p>該產品可以根據說明進行切斷以縮短，但缺少部件和資訊以防止縮短後接觸帶電部件。用戶可能會因可觸及的帶電部件而遭受電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60598-2-21 和 EN 60598-1。 The product can be cut off to be shortened according to the instructions but is missing components and information to prevent contact with live parts after shortening. The user could receive an electric shock via accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-2-21 and EN 60598-1.</p>	<p>邊境拒絕進口 Import rejected at border</p>	

2025年6月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
25	德國 (Germany)	<p>品牌(Brand) : ZGREDED 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : HB-DJDD-120</p>	<p>該產品可以按照說明進行切斷以縮短，但缺少部件和資訊以防止縮短後接觸帶電部件。用戶可能會因可觸及的帶電部件而遭受電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60598-2-21 和 EN 60598-1。 The product can be cut off to be shortened according to the instructions, but is missing components and information to prevent contact with live parts after shortening. The user could receive an electric shock via accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598-2-21 and EN 60598-1.</p>	<p>邊境拒絕進口 Import rejected at border</p>	
25	德國 (Germany)	<p>品牌(Brand) : 不詳 (unknown) 品名(Name) : 投影儀 (Projector) 型號 (Model) : HR-A1</p>	<p>雷射光束太強大，產品缺乏必要的標籤。因此該產品會對視力造成損害。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60825-1 和 EN 50689。 The laser beam is too powerful and the product lacks the necessary labelling. Therefore the product can cause damage to sight. The product does not comply with the requirements of Low Voltage Directive nor with the European standards EN 60825-1 and EN 50689.</p>	<p>停止銷售 Stop of sales</p>	
26	德國 (Germany)	<p>品牌(Brand) : Axiwolntl 品名(Name) : 投影儀 (Projector) 型號 (Model) : YLQ-L3</p>	<p>雷射光束太強大，產品缺乏必要的標籤。因此，該產品會對視力造成損害。 該產品不符合通用產品安全法規，也不符合歐洲標準 EN 60825-1 和 EN 50689。 The laser beam is too powerful, and the product lacks the necessary labelling. Therefore, the product can cause damage to sight. The product does not comply with the General Product Safety Regulation nor with the European standards EN 60825-1 and EN 50689.</p>	<p>線上市場刪除了該產品清單 Removal of this product listing by the online marketplace</p>	

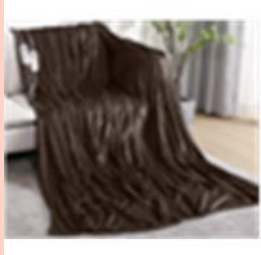
2025 年 6 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
26	德國 (Germany)	<p>品牌(Brand) : 不詳 (unknown) 品名(Name) : 投影儀 (Projector) 型號 (Model) : BL-XK01</p>	<p>雷射光束太強大，產品缺乏必要的標籤。因此，該產品會對視力造成損害。 該產品不符合通用產品安全法規，也不符合歐洲標準 EN 60825-1 和 EN 50689。 The laser beam is too powerful, and the product lacks the necessary labelling. Therefore, the product can cause damage to sight. The product does not comply with the General Product Safety Regulation nor with the European standards EN 60825-1 and EN 50689.</p>	<p>在產品上標記適當的風險警告 Marking the product with appropriate warnings on the risks 停止銷售 Stop of sales</p>	

2025 年 6 月 電子電氣產品召回案例 (北美地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
23	美國 (America)	<p>品牌(Brand) : Lutron-branded 品名(Name) : LED 帶燈電源介面 (power interfaces for LED tape lights) 型號 (Model) : LU-PH3-B</p>	<p>電源介面可能會在大幅電湧 (例如雷擊) 期間出現故障, 如果消費者觸摸 LED 燈帶, 則會造成電擊危險。 The power interface can fail during a significant power surge (e.g., lightning strike), posing a shock hazard to consumers if they touch the LED tape lights.</p>	<p>替換 Replace</p>	
23	美國 (America)	<p>品牌(Brand) : 不詳 (unknown) 品名(Name) : 鋰離子電池供電的鏈鋸 (lithium-ion battery-powered chainsaws) 型號 (Model) : 414170, 414181, 41418 and 414170R</p>	<p>召回的電鋸的電機控制器在操作過程中可能會過熱, 造成火災和燒傷危險。 The motor controller of the recalled chainsaw can overheat during operation of the unit, posing fire and burn hazards.</p>	<p>退款 Refund</p>	
23	美國 (America)	<p>品牌(Brand) : Anker 品名(Name) : 移動電源 (power banks) 型號 (Model) : A1263</p>	<p>移動電源中的鋰離子電池可能會過熱, 對消費者造成火災和燒傷危險。 The lithium-ion battery in the power bank can overheat, posing fire and burn hazards to consumers.</p>	<p>替換 Replace</p>	
25	美國 (America)	<p>品牌(Brand) : AstroAI 品名(Name) : mini 冰箱 (Minifridges) 型號 (Model) : LY0204A</p>	<p>召回的迷你冰箱的電氣開關可能會短路, 造成火災和燒傷危險。 The recalled minifridges' electrical switch can short circuit, posing fire and burn hazards.</p>	<p>替換 Replace</p>	

2025 年 6 月 電子電氣產品召回案例 (北美地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
25	美國 (America)	品牌(Brand) : MaxKare 品名(Name) : 電熱毯 (Electric Blankets) 型號 (Model) : HB18A-7284-1, HB18A-8490-2 and HB18A-6284-1	召回的毯子可能會過熱並點燃，造成燒傷和火災危險。 The recalled blankets can overheat and ignite, posing burn and fire hazards.	退款 Refund	

2025 年 6 月電子電氣產品召回案例 (亞太地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
24	澳大利亞 (Australia)	<p>品牌(Brand)：不詳 (unknown)</p> <p>品名(Name)：充電式除濕機 (Rechargeable Dehumidifier)</p> <p>型號 (Model)：RDEHM</p>	<p>除濕機可能會過熱和短路。 如果除濕機在使用過程中或充電過程中過熱，可能會導致火災或受傷。</p> <p>The dehumidifer may overheat and short circuit.</p> <p>Risk of fire or injury if the dehumidifier overheats during use or while charging.</p>	<p>1. 顧客應立即停止使用該產品。</p> <p>2. 斷開產品電源。</p> <p>3. 將受影響的設備連同從 Innovations Direct 收到的信件副本發送至以下地址，以申請全額退款： Reply Paid 6010 Innovations Direct PO Box 6010 CHULLORA NSW 14054. 如果您尚未收到該信件或需要有關此次召回的進一步幫助，請聯繫 Innovations Direct。</p> <p>1. Customers should stop using the product immediately.</p> <p>2. Disconnect the product from power supply.</p> <p>3. Send the affected unit along with a copy of the letter received from Innovations Direct to the address below to claim a full refund: Reply Paid 6010 Innovations Direct PO Box 6010 CHULLORA NSW 1405</p> <p>4. Contact Innovations Direct if you have not received the letter or require further assistance with this recall.</p>	
26	澳大利亞 (Australia)	<p>品牌(Brand)：不詳 (unknown)</p> <p>品名(Name)：LED 燈具 (LED Lights)</p> <p>型號 (Model)：不詳 (unknown)</p>	<p>如果幼兒接觸鈕扣/鈕扣電池並將其吞下或放入體內，可能會導致窒息、嚴重內燒傷或死亡。2 小時或更短時間內可能會發生嚴重或致命傷害。如果幼兒吞咽小零件，可能會因窒息而嚴重受傷或死亡。</p> <p>Risk of choking, severe internal burn injuries or death to young children if they gain access to the button/coin batteries and swallow or place them inside their body. Severe or fatal injuries can happen in 2 hours or less. Risk of serious injury or death from choking if small children swallow small parts.</p>	<p>立即停止使用該產品並將產品放置在兒童接觸不到的地方。</p> <p>將商品退回您的購買地點。</p> <p>如果您不再擁有該物品，或無法退回，請聯繫木制遊戲室討論後續步驟和處置選項。</p> <p>Stop using the product immediately and place the product out of reach of children.</p> <p>Return the item(s) to your place of purchase.</p> <p>If you no longer have the item(s), or are unable to return it, contact Wooden Playroom to discuss next steps and disposal options.</p>	