



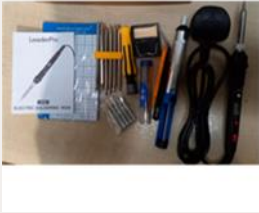
2025 年 3 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
9	北愛爾蘭 (Northern Ireland)	品牌(Brand)：不詳 (unknown) 品名(Name)：吊燈 (Ceiling light) 型號 (Model)：JFL-039	<p>該產品的飛線只是簡單地連接到接線端子上，金屬部件與帶電部件之間僅通過基本絕緣進行絕緣。如果基本絕緣失效，可觸及的金屬部件可能會帶電，導致用戶觸電。 該產品不符合低壓指令的要求，也不符合歐洲標準 EN 60598-1。</p> <p>The flying leads of the product are simply connected to a terminal block, leaving metal parts insulated from live parts by basic insulation only. Should this basic insulation fail, accessible metal parts can become live, causing the user to receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598-1.</p>	邊境拒絕進口 Import rejected at border	
9	北愛爾蘭 (Northern Ireland)	品牌(Brand)： Guangzhoushizhryuanmeoyiyouxiangongsu 品名(Name)：熱風扇 (Fan heater) 型號 (Model)：不詳 (unknown)	<p>插頭與主電源線連接時，保險絲不安全。這可能導致電氣故障，保險絲爆炸，造成火災風險。此外，主電源線電阻過大，產品固定不當。 該產品不符合低壓指令的要求，也不符合歐洲標準 EN 60335-2-30。</p> <p>The plug is fitted to the main supply cord with an unsafe fuse. This can lead to an electric fault and to the fuse exploding, creating a risk of fire. Moreover, the mains supply cord had excessive resistance and the product is not properly anchored.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-2-30.</p>	邊境拒絕進口 Import rejected at border	
9	北愛爾蘭 (Northern Ireland)	品牌(Brand)：X-Go 品名(Name)：熱風扇 (Fan heater) 型號 (Model)：OY361OSH	<p>電池內部連接不正確，電線卡住，焊點直接在剝去護套的電線上。這會導致電池過熱並起火。 該產品不符合低壓指令的要求，也不符合歐洲標準 EN 62133-2。</p> <p>The inside of the battery was incorrectly connected, with wires trapped and solder joints directly on wires with removed sheathing. This can cause the battery to overheat and catch fire.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 62133-2.</p>	邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product	

2025年3月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
10	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : Invospar 品名(Name) : 電源 (Power supply) 型號 (Model) : TD12200	<p>該電源的輸入和輸出連接品質差，電線直接焊接到電源電路板上，沒有二次固定。此外，輸入端沒有保險絲來保護產品免受過流相關故障的影響。這可能導致產品短路，從而存在火災風險。</p> <p>該產品不符合低電壓指令的要求。</p> <p>The power supply has poor quality connections to its input and output, with wires soldered directly to the power circuit board with no secondary fixing. Moreover, the input has no fuse to protect the product from overcurrent related faults. This could cause the product to short circuit, presenting a risk of fire.</p> <p>The product does not comply with the requirements of the Low Voltage Directive</p>	終端使用者手中召回產品 Recall of the product from end users	
10	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : Dunelm 品名(Name) : 加熱晾衣架 (Heated airer) 型號 (Model) : 30752153	<p>如果產品在穿著最大重量的衣物時仍能使用，則產品可能會過熱，從而導致火災。</p> <p>該產品不符合低壓指令的要求。</p> <p>If the product is used to its maximum weight of clothing on, the product can overheat, leading to a fire.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	終端使用者手中召回產品 Recall of the product from end users	
10	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : Dinsheng 品名(Name) : 電熱水袋 (Electric hot water bottle) 型號 (Model) : 不詳 (unknown)	<p>使用者注水時，產品可能處於活動狀態或帶電狀態。如果熱水袋漏水，可能會接觸帶電部件並導致觸電。此外，插頭尺寸不足，接地不良。因此，用戶可能會接觸到可觸及的帶電部件並遭受觸電。</p> <p>該產品不符合低壓指令的要求。</p> <p>The product can be active or energised whilst the user is filling the product. If the hot water bottle leaks it can touch live parts and cause electric shock. Moreover, the plug also had insufficient dimensions and was inadequately earthed. A user could consequently touch accessible live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 從市場撤回 Withdrawal of the product from the market	

2025年3月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
11	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : Leader Pro 品名(Name) : 電烙鐵 (Soldering iron) 型號 (Model) : FSK-1020	由於保險絲熔斷不足，產品在使用過程中可能出現故障。同時，無需工具即可接觸帶電部件。由於帶電部件易於接觸，產品故障可能導致火災或使用者觸電。 該產品不符合低電壓指令的要求。 The product may develop a fault during use, because of being inadequately fused. At the same time live parts can be accessed without tools. Due to the easy access of the live parts, the fault with the product may lead to a fire, or the user receiving an electric shock The product does not comply with the requirements of the Low Voltage Directive.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 產品銷毀 Destruction of the product	
12	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : 不詳 (unknown) 品名(Name) : LED 吸頂燈 (LED ceiling light) 型號 (Model) : 不詳 (unknown)	該產品絕緣性能不足，可能會隨著時間的推移而損壞。電流浪湧可能導致產品帶電，從而導致消費者觸電。 該產品不符合低電壓指令的要求。 The product's insulation is insufficient and may break down over time. A surge in current could cause it to become live, causing the consumer to receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive.	邊境拒絕進口 Import rejected at border	
9	西班牙 (Spain)	品牌(Brand) : Pepco 品名(Name) : LED 燈鏈 (LED chain) 型號 (Model) : 597176	該產品的電纜直徑太小。這可能導致過熱，增加火災風險。 該產品不符合低壓指令的要求，也不符合歐洲標準 EN 60598。 The products cables'diameter is too small. This can cause overheating, increasing the risk of fire. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	
10	法國 (France)	品牌(Brand) : MANDINE 品名(Name) : 油炸鍋 (Fryer) 型號 (Model) : MDF-10-19	製造錯誤導致電源線和內部地線的溫升超過極限，存在火災風險。 該產品不符合低壓指令的要求。 A manufacturing error allows the temperature-increase limits of the power cable and the internal earth wire to be exceeded, posing a risk of fire. The product does not comply with the requirements of the Low Voltage Directive.	從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users	

2025 年 3 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
11	法國 (France)	<p>品牌(Brand) : LIFT MTB 品名(Name) : 電池 (Battery) 型號 (Model) : 600WH plate 250WH 300WH 400WH</p>	<p>即使超出電池的工作溫度範圍，電池也不會停止充電。這可能會導致電池起火。 該產品不符合低電壓指令的要求。 The battery does not stop charging even when it is beyond the range of its operating temperature. This can cause the battery to catch fire. The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>終端使用者手中召回產品 Recall of the product from end users</p>	
10	芬蘭 (Finland)	<p>品牌(Brand) : Kulz 品名(Name) : 旅行適配器 (Travel adaptor) 型號 (Model) : KUUTA3USBC</p>	<p>當歐規插頭連接到電源電壓時，英規插頭可能會同時被拔出。用戶可能會因可觸及的帶電部件而觸電。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 62368-1 和 EN 60884-1。 When the EU-plug is connected to mains voltage, the UK plug can be simultaneously pulled out. The user could receive an electric shock from accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 62368-1 and EN 60884-1.</p>	<p>終端使用者手中召回產品 Recall of the product from end users</p>	
10	芬蘭 (Finland)	<p>品牌(Brand) : 不詳 (unknown) 品名(Name) : 鋰離子充電器 (Li-ion Charger) 型號 (Model) : SJT-48E</p>	<p>帶電一次部件與二次連接器之間的絕緣不足。用戶可能因接觸帶電部件而觸電。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 61558-1 和 EN 61558-2。 The insulation between the live primary parts and the secondary connector is not adequate. A user could receive an electric shock from accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 61558-1 nor EN 61558-2.</p>	<p>終端使用者手中召回產品 Recall of the product from end users</p>	
10	芬蘭 (Finland)	<p>品牌(Brand) : BOROFONE 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : BA20A</p>	<p>帶電初級電路和次級電路之間的絕緣不足。用戶可能因可觸及的帶電部件而觸電。 該產品不符合低電壓指令和歐洲標準 EN 62368-1。 The insulation between the live primary circuit and the secondary circuit is not adequate. A user could receive an electric shock from the accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 62368-1.</p>	<p>終端使用者手中召回產品 Recall of the product from end users</p>	

2025年3月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
9	荷蘭 (The Netherlands)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：煙霧機 (Fog machine) 型號 (Model)：ZQ10025</p>	<p>可能使用連接器和插頭的組合來承載電源電壓，而不是通常預期的較低電壓，這會帶來火災、觸電或短路的風險。此外，由於相位連接可能會接觸到設備外殼，因此使用者可能會接觸帶電部件並受到觸電。</p> <p>該產品不符合無線電設備指令 (RED) 的要求，也不符合歐洲標準 EN 60335 和 EN 62368-1。</p> <p>The possible use of a combination of the type connector and plug to carry mains voltage, instead of the normally expected lower voltage, poses a risk of fire, electric shock or short circuit. Moreover, the user can have access to live parts and receive an electric shock, as the phase connection may come into contact with the casing of the apparatus.</p> <p>The product does not comply with the requirements of the Radio Equipment Directive (RED) nor with the European standards EN 60335 and EN 62368-1.</p>	<p>停止銷售 Stop of sales</p>	
10	奧地利 (Austria)	<p>品牌(Brand)：Steinbach Pool Professional 品名(Name)：泳池清潔機器人 (Pool cleaner robot) 型號 (Model)：061207PP</p>	<p>充電站或電池的技術缺陷可能導致火災並燙傷用戶。</p> <p>該產品不符合低電壓指令。</p> <p>A technical defect in the charging station or the battery could cause a fire and burns to the user.</p> <p>The product does not comply with the Low Voltage Directive.</p>	<p>終端使用者手中召回產品 Recall of the product from end users</p>	
10	愛爾蘭 (Ireland)	<p>品牌(Brand)：Yoto 品名(Name)：藍牙音箱 (Bluetooth speaker) 型號 (Model)：不詳 (unknown)</p>	<p>插頭適配器插入插座時可能會斷裂。這會導致帶電插針在連接到主電源時裸露在外。用戶可能會接觸到這些帶電部件並遭受電擊。</p> <p>該產品不符合低電壓指令的要求。</p> <p>The plug adaptor can break when plugged into the socket. This can result in live pins being exposed while connected to mains power. The user can touch these live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>從市場撤回 Withdrawal of the product from the market</p>	

2025 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
9	瑞典 (Sweden)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：無線中繼器 (WiFi Repeater) 型號 (Model)：Wireless-N</p>	<p>產品中的焊料鉛含量過高 (測量值高達 33% 重量)。鉛對環境構成威脅。 該產品不符合《限制在電氣和電子設備中使用某些有害物質的指令》(RoHS 2 指令) 的要求。 The solders in the product have an excessive concentration of lead (measured value up to 33 % by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>邊境拒絕進口 Import rejected at border</p>	
10	瑞典 (Sweden)	<p>品牌(Brand)：Grundig 品名(Name)：LED 燈帶 (LED Strip) 型號 (Model)：17741</p>	<p>該產品焊料中的鉛含量超標 (經測量，含量高達 76.1% (重量百分比))。鉛對環境構成威脅。 該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》(RoHS 2.0) 的要求。 The solders in the product have an excessive concentration of lead (measured value up to 76.1 % by weight). Lead poses a risk to the environment. The product does not comply with the requirements of Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>從市場撤回 Withdrawal of the product from the market</p>	
11	瑞典 (Sweden)	<p>品牌(Brand)：Senz 品名(Name)：空冷器 (air cooler) 型號 (Model)：SEACLmini</p>	<p>該產品焊料中的鉛含量超標 (測量值高達 44% (重量百分比))。產品中的塑膠中多溴二苯醚 (PBDEs) 含量超標 (測量值高達 0.145% (重量百分比))。鉛對環境構成威脅。多溴二苯醚對環境和人類健康構成威脅。 該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》(RoHS 2.0) 的要求。 The solders of the product have an excessive concentration of lead (measured value up to 44% by weight). The plastic in the product has an excessive concentration of Polybrominated Diphenyl Ethers (PBDEs) (measured value up to 0.145% by weight). Lead poses a risk to the environment. PBDEs pose a risk to the environment and to human health. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>從市場撤回 Withdrawal of the product from the market</p>	

2025年3月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
11	瑞典 (Sweden)	品牌(Brand) : hantech 品名(Name) : 空調 (Air conditioner) 型號 (Model) : Ac801	<p>該產品焊料中的鉛含量超標 (經測量, 含量高達 42% (重量百分比))。鉛對環境構成威脅。</p> <p>該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》(RoHS 2.0) 的要求。</p> <p>The solders of the product have an excessive concentration of lead (measured value up to 42% by weight). Lead poses a risk to the environment.</p> <p>The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	從市場撤回 Withdrawal of the product from the market	
11	瑞典 (Sweden)	品牌(Brand) : Velamp 品名(Name) : 頭燈 (Head lamp) 型號 (Model) : IH511	<p>該產品焊料中的鉛含量超標 (經測量, 含量高達 69.8% (重量百分比))。鉛對環境構成威脅。</p> <p>該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》(RoHS 2.0) 的要求。</p> <p>The solders in the product have an excessive concentration of lead (measured value up to 69.8% by weight). Lead poses a risk to the environment.</p> <p>The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	從市場撤回 Withdrawal of the product from the market	
12	瑞典 (Sweden)	品牌(Brand) : PowewrPal 品名(Name) : 夜燈 (Night lamp) 型號 (Model) : T-rex	<p>該產品焊料中的鉛含量超標 (經測量, 含量高達 4.90% (重量百分比))。鉛對環境構成威脅。</p> <p>該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》(RoHS 2.0) 的要求。</p> <p>The solders in the product have an excessive concentration of lead (measured value up to 4.90% by weight). Lead poses a risk to the environment.</p> <p>The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	邊境拒絕進口 Import rejected at border	

2025年3月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
12	瑞典 (Sweden)	品牌(Brand) : PowewrPal 品名(Name) : 夜燈 (Night lamp) 型號 (Model) : Football	<p>該產品焊料中的鉛含量超標 (經測量, 含量高達 89% (重量百分比))。鉛對環境構成威脅。</p> <p>該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》(RoHS 2.0) 的要求。</p> <p>The solders in the product have an excessive concentration of lead (measured value up to 89 % by weight). Lead poses a risk to the environment.</p> <p>The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	邊境拒絕進口 Import rejected at border	
12	瑞典 (Sweden)	品牌(Brand) : PowewrPal 品名(Name) : 夜燈 (Night lamp) 型號 (Model) : Gamer Zone	<p>該產品焊料中的鉛含量超標 (經測量, 含量高達 89% (重量百分比))。鉛對環境構成威脅。</p> <p>該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》(RoHS 2.0) 的要求。</p> <p>The solders in the product have an excessive concentration of lead (measured value up to 89 % by weight). Lead poses a risk to the environment.</p> <p>The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	邊境拒絕進口 Import rejected at border	
12	瑞典 (Sweden)	品牌(Brand) : PowewrPal 品名(Name) : 夜燈 (Night lamp) 型號 (Model) : Unicorn	<p>該產品焊料中的鉛含量超標 (經測量, 含量高達 89% (重量百分比))。鉛對環境構成威脅。</p> <p>該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》(RoHS 2.0) 的要求。</p> <p>The solders in the product have an excessive concentration of lead (measured value up to 89 % by weight). Lead poses a risk to the environment.</p> <p>The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	邊境拒絕進口 Import rejected at border	

2025 年 3 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
10	義大利 (Italy)	品牌(Brand) : GINMA 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : 不詳 (unknown)	<p>由於導體橫截面積不足，產品可能過熱並引發火災。此外，如果發生短路，帶電部件可能會被觸及。用戶可能觸及這些部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-2-20 的要求。</p> <p>Due to an insufficient cross-section of the conductors, the product can overheat and cause a fire. Moreover, in the event of a short-circuit, live parts can become accessible. A user may touch them and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-2-20.</p>	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	
10	義大利 (Italy)	品牌(Brand) : GINMA 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : XN - 8096 XN - 8097	<p>由於導體橫截面積不足，產品可能過熱並引發火災。此外，如果發生短路，帶電部件可能會被觸及。用戶可能觸及這些部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-2-20 的要求。</p> <p>Due to an insufficient cross-section of the conductors, the product can overheat and cause a fire. Moreover, in the event of a short-circuit, live parts can become accessible. A user may touch them and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-2-20.</p>	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	
10	義大利 (Italy)	品牌(Brand) : GINMA 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : XN - 8088 XN - 8089 XN - 8090 XN - 8093	<p>由於導體橫截面積不足，產品可能過熱並引發火災。此外，如果發生短路，帶電部件可能會被觸及。用戶可能觸及這些部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-2-20 的要求。</p> <p>Due to an insufficient cross-section of the conductors, the product can overheat and cause a fire. Moreover, in the event of a short-circuit, live parts can become accessible. A user may touch them and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-2-20.</p>	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	

2025 年 3 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
10	義大利 (Italy)	品牌(Brand) : GINMA 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : XN - 8009 XN - 8010 XN - 8011	<p>由於導體橫截面積不足，產品可能過熱並引發火災。此外，如果發生短路，帶電部件可能會被觸及。用戶可能觸及這些部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-2-20 的要求。</p> <p>Due to an insufficient cross-section of the conductors, the product can overheat and cause a fire. Moreover, in the event of a short-circuit, live parts can become accessible. A user may touch them and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-2-20.</p>	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	
10	義大利 (Italy)	品牌(Brand) : GINMA 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : XN - 8111	<p>由於導體橫截面積不足，產品可能過熱並引發火災。此外，如果發生短路，帶電部件可能會被觸及。用戶可能觸及這些部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-2-20 的要求。</p> <p>Due to an insufficient cross-section of the conductors, the product can overheat and cause a fire. Moreover, in the event of a short-circuit, live parts can become accessible. A user may touch them and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-2-20.</p>	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	
10	義大利 (Italy)	品牌(Brand) : GINMA 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : XN-8123	<p>由於導體橫截面積不足，產品可能過熱並引發火災。此外，如果發生短路，帶電部件可能會被觸及。用戶可能觸及這些部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-2-20 的要求。</p> <p>Due to an insufficient cross-section of the conductors, the product can overheat and cause a fire. Moreover, in the event of a short-circuit, live parts can become accessible. A user may touch them and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-2-20.</p>	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	

2025 年 3 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
10	義大利 (Italy)	品牌(Brand) : GINMA 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : XN-8095	<p>由於導體橫截面積不足，產品可能過熱並引發火災。此外，如果發生短路，帶電部件可能會被觸及。用戶可能觸及這些部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-2-20 的要求。</p> <p>Due to an insufficient cross-section of the conductors, the product can overheat and cause a fire. Moreover, in the event of a short-circuit, live parts can become accessible. A user may touch them and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-2-20.</p>	<p>禁止銷售產品及任何附帶措施</p> <p>Ban on the marketing of the product and any accompanying measures</p>	
10	義大利 (Italy)	品牌(Brand) : GINMA 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : XN - 8103	<p>由於導體橫截面積不足，產品可能過熱並引發火災。此外，如果發生短路，帶電部件可能會被觸及。用戶可能觸及這些部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-2-20 的要求。</p> <p>Due to an insufficient cross-section of the conductors, the product can overheat and cause a fire. Moreover, in the event of a short-circuit, live parts can become accessible. A user may touch them and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-2-20.</p>	<p>禁止銷售產品及任何附帶措施</p> <p>Ban on the marketing of the product and any accompanying measures</p>	
10	義大利 (Italy)	品牌(Brand) : GINMA 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : XN-8100	<p>由於導體橫截面積不足，產品可能過熱並引發火災。此外，如果發生短路，帶電部件可能會被觸及。用戶可能觸及這些部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-2-20 的要求。</p> <p>Due to an insufficient cross-section of the conductors, the product can overheat and cause a fire. Moreover, in the event of a short-circuit, live parts can become accessible. A user may touch them and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-2-20.</p>	<p>禁止銷售產品及任何附帶措施</p> <p>Ban on the marketing of the product and any accompanying measures</p>	

2025 年 3 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
10	義大利 (Italy)	品牌(Brand) : GINMA 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : XN - 8007	<p>由於導體橫截面積不足，產品可能過熱並引發火災。此外，如果發生短路，帶電部件可能會被觸及。用戶可能觸及這些部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-2-20 的要求。</p> <p>Due to an insufficient cross-section of the conductors, the product can overheat and cause a fire. Moreover, in the event of a short-circuit, live parts can become accessible. A user may touch them and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-2-20.</p>	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	
10	義大利 (Italy)	品牌(Brand) : GINMA 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : XN 8128	<p>由於導體橫截面積不足，產品可能過熱並引發火災。此外，如果發生短路，帶電部件可能會被觸及。用戶可能觸及這些部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-2-20 的要求。</p> <p>Due to an insufficient cross-section of the conductors, the product can overheat and cause a fire. Moreover, in the event of a short-circuit, live parts can become accessible. A user may touch them and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-2-20.</p>	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	
10	義大利 (Italy)	品牌(Brand) : GINMA 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : XN - 8046 XN - 8047	<p>由於導體橫截面積不足，產品可能過熱並引發火災。此外，如果發生短路，帶電部件可能會被觸及。用戶可能觸及這些部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-2-20 的要求。</p> <p>Due to an insufficient cross-section of the conductors, the product can overheat and cause a fire. Moreover, in the event of a short-circuit, live parts can become accessible. A user may touch them and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-2-20.</p>	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	

2025 年 3 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
10	義大利 (Italy)	品牌(Brand) : GINMA 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : XN - 8109	<p>由於導體橫截面積不足，產品可能過熱並引發火災。此外，如果發生短路，帶電部件可能會被觸及。用戶可能觸及這些部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-2-20 的要求。</p> <p>Due to an insufficient cross-section of the conductors, the product can overheat and cause a fire. Moreover, in the event of a short-circuit, live parts can become accessible. A user may touch them and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-2-20.</p>	<p>禁止銷售產品及任何附帶措施</p> <p>Ban on the marketing of the product and any accompanying measures</p>	
10	義大利 (Italy)	品牌(Brand) : GINMA 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : XN - 8006 XN - 8008	<p>由於導體橫截面積不足，產品可能過熱並引發火災。此外，如果發生短路，帶電部件可能會被觸及。用戶可能觸及這些部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-2-20 的要求。</p> <p>Due to an insufficient cross-section of the conductors, the product can overheat and cause a fire. Moreover, in the event of a short-circuit, live parts can become accessible. A user may touch them and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-2-20.</p>	<p>禁止銷售產品及任何附帶措施</p> <p>Ban on the marketing of the product and any accompanying measures</p>	
10	義大利 (Italy)	品牌(Brand) : GINMA 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : XN 8015 XN 8016 XN 8017 XN 8027 XN 8028 XN 8030	<p>由於導體橫截面積不足，產品可能過熱並引發火災。此外，如果發生短路，帶電部件可能會被觸及。用戶可能觸及這些部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-2-20 的要求。</p> <p>Due to an insufficient cross-section of the conductors, the product can overheat and cause a fire. Moreover, in the event of a short-circuit, live parts can become accessible. A user may touch them and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-2-20.</p>	<p>禁止銷售產品及任何附帶措施</p> <p>Ban on the marketing of the product and any accompanying measures</p>	

2025年3月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
10	義大利 (Italy)	品牌(Brand) : GINMA 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : XN - 8054 XN - 8055	<p>由於導體橫截面積不足，產品可能過熱並引發火災。此外，如果發生短路，帶電部件可能會被觸及。用戶可能觸及這些部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-2-20 的要求。</p> <p>Due to an insufficient cross-section of the conductors, the product can overheat and cause a fire. Moreover, in the event of a short-circuit, live parts can become accessible. A user may touch them and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-2-20.</p>	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	
10	義大利 (Italy)	品牌(Brand) : GINMA 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : XN - 8102 XN - 8104 XN - 8107	<p>由於導體橫截面積不足，產品可能過熱並引發火災。此外，如果發生短路，帶電部件可能會被觸及。用戶可能觸及這些部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-2-20 的要求。</p> <p>Due to an insufficient cross-section of the conductors, the product can overheat and cause a fire. Moreover, in the event of a short-circuit, live parts can become accessible. A user may touch them and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-2-20.</p>	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	
10	義大利 (Italy)	品牌(Brand) : GINMA 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : XN - 8031 XN - 8034	<p>由於導體橫截面積不足，產品可能過熱並引發火災。此外，如果發生短路，帶電部件可能會被觸及。用戶可能觸及這些部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-2-20 的要求。</p> <p>Due to an insufficient cross-section of the conductors, the product can overheat and cause a fire. Moreover, in the event of a short-circuit, live parts can become accessible. A user may touch them and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-2-20.</p>	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	

2025 年 3 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
9	德國 (Germany)	<p>品牌(Brand) : Kesun 品名(Name) : 電烤箱 (Electric oven) 型號 (Model) : TO-051</p>	<p>使用隨附的電源插頭適配器時，電源插頭太小。此外，接地保護不足。用戶可能會接觸可觸及的帶電部件並受到電擊。該產品不符合低電壓指令和歐洲標準 EN 60335 的要求。 The mains plug is too small when used with the supplied mains plug adapter. Moreover, the earthing protection is inadequate. The user could touch the accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive and the European standard EN 60335.</p>	<p>禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures 從市場撤回 Withdrawal of the product from the market</p>	
9	德國 (Germany)	<p>品牌(Brand) : Lencent 品名(Name) : 電烤箱 (Extension lead) 型號 (Model) : F09U</p>	<p>插座中的接地觸點未連接，Schuko 插頭中的接地觸點部分覆蓋有塑膠。此外，產品電源線中缺少保護導體。發生短路時，短路電流不會通過接地放電。這可能導致觸電。該產品不符合低壓指令的要求。 The earth contacts in the sockets are not connected and the earth contacts in the Schuko plug are partially covered with plastic. Moreover, the product is missing the protective conductor in the supply cable. In the event of a short circuit, the short-circuit current is not discharged via the earthing. This can lead to an electric shock. The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>線上市場刪除了該產品清單 Removal of this product listing by the online marketplace</p>	
10	德國 (Germany)	<p>品牌(Brand) : Levelone 品名(Name) : 相機套裝 (Camera set) 型號 (Model) : DSK-4001</p>	<p>電源線由 II 類插頭 (不帶保護接地導體) 和 I 類連接器組成。如果電源線用於 I 類電器，則保護接地導體將斷開。發生故障時，故障電流將無法通過保護接地導體，從而導致觸電危險。該產品不符合低壓指令和歐洲標準 EN 60335-1 的要求。 The power supply cable is composed of a Class II plug (without a protective earth conductor) and a Class I connector. If the power supply cable is used with a Class I electric appliance, there is no continuation of the protective earth conductor. In the event of a fault, the fault current would not be able to flow via the protective earth conductor, leading to the risk of an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 更換庫存貨物中的電源線。 Replacement of the power cable in the goods in stock.</p>	

2025 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
10	德國 (Germany)	<p>品牌(Brand) : Retoo 品名(Name) : 電爐 (Electric oven) 型號 (Model) : E762</p>	<p>烤箱沒有接地/保護接地連接。此外，烤箱外殼容易變形，容易接觸烤箱內部的帶電部件。因此，用戶可能會接觸帶電部件並遭受電擊。 該產品不符合低電壓指令和相關的歐洲標準 EN 60335-1。 The oven does not have an earthing connection/protective earth connection. Moreover, the housing of the oven can easily be deformed. coming into contact with live parts inside the oven. As a result, the user could touch live parts and receive an electric shock. The product does not comply with the Low Voltage Directive and the relevant European standard EN 60335-1.</p>	<p>從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	
11	德國 (Germany)	<p>品牌(Brand) : Elgetec 品名(Name) : 直發器 (Hair straightener) 型號 (Model) : 不詳 (unknown)</p>	<p>該產品插頭未正確標記，且保險絲插槽為空。因此，產品可能過熱並引發火災。 該產品不符合低電壓指令的要求。 The product's plug is not properly marked and the slot for the fuse is empty. The product could therefore overheat and cause a fire. The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>終端使用者手中召回產品 Recall of the product from end users</p>	
12	德國 (Germany)	<p>品牌(Brand) : ELI 品名(Name) : 檯燈 (Table lamp) 型號 (Model) : CD8215</p>	<p>該產品未配備變壓器/轉換插頭，該插頭可提供低於 24 V 的安全超低電壓，且未通過 III 級絕緣部件永久連接到燈具，而這正是 II 級防護的要求。用戶可能接觸到可觸及的帶電部件（燈泡插座或故障燈泡），從而遭受電擊。 該產品不符合低電壓指令的要求，也不符合相關的歐洲標準 EN 60598-1 和 EN 60598-2-10。 The product is not equipped with a transformer/converter plug providing safety extra-low voltage of under 24 V and permanently connected to the luminaire by means of class III insulated parts, as required for protection class II. A user can touch accessible live parts (the bulb socket or the defective bulb) and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the relevant European standards EN 60598-1 and EN 60598-2-10.</p>	<p>禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures 從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users</p>	

2025 年 3 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
12	德國 (Germany)	<p>品牌(Brand) : Avatcen 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : AC-HNT-PC608</p>	<p>一次電路與可觸及的二次電路之間的隔離不足。用戶可能被可觸及的帶電部件觸電。此外，外殼材質易燃，可能引發火災。</p> <p>該產品不符合低壓指令和歐洲標準 EN 62368-1。</p> <p>The separation between the primary circuits and the accessible secondary circuits is insufficient. A user could receive an electric shock from accessible live parts. Moreover, the material of the casing is flammable, which may lead to a fire.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 62368-1.</p>	<p>停止銷售 Stop of sales</p>	
12	德國 (Germany)	<p>品牌(Brand) : Paco Home 品名(Name) : 檯燈 (Table lamp) 型號 (Model) : Cosmo 210</p>	<p>該產品未配備提供≤24V 安全超低電壓的變壓器/轉換插頭，且未通過 III 級隔離部件永久連接到燈具。用戶可能輕易接觸帶電部件並遭受電擊。</p> <p>該產品不符合低壓指令的要求，也不符合歐洲標準 EN 60598-1 和 EN 60598-2。</p> <p>The product is not equipped with a transformer/converter plug providing safety extra-low voltage of ≤ 24 V and permanently connected to the luminaire by means of class III isolated parts. The user can easily access live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-1 and EN 60598-2.</p>	<p>禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures 從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users</p>	
12	德國 (Germany)	<p>品牌(Brand) : XUNATA 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : 不詳 (unknown)</p>	<p>LED 燈帶控制裝置的連接器防護等級不符合戶外使用要求。此外，LED 燈帶端蓋的機械強度不足。用戶可能觸及可觸及的帶電部件並遭受電擊。</p> <p>該產品不符合低電壓指令和歐洲標準 EN 60598-2-21 的要求。</p> <p>The connector of the LED strip control gear does not have the level of protection required for outdoor use. Moreover, the LED strip end cap mechanical strength is insufficient. The user could touch the accessible live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598-2-21.</p>	<p>從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users</p>	

2025年3月電子電氣產品召回案例 (北美地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
9	美國 (America)	<p>品牌(Brand) : Ellerbeck 品名(Name) : 壁燈 (Wall Sconces) 型號 (Model) : 43115BK, 43115NBR, 43115PN and 43115CLP</p>	<p>壁燈的電線可能在可調節接頭處損壞，造成觸電危險。 The wall sconce's electrical wires can become damaged at the adjustable joints, posing a risk of electric shock.</p>	<p>替換 Replace</p>	
9	美國 (America)	<p>品牌(Brand) : 不詳 (unknown) 品名(Name) : 太陽能板系列組合電纜 (Series Combiner Cables for Solar Panels) 型號 (Model) : 98715 Goal Zero 4x HPP to 1x HPP+</p>	<p>召回的組合電纜與 Nomad 系列太陽能電池板一起使用時可能會發生故障，從而造成火災隱患。 The recalled combiner cables can malfunction when used with Nomad-series solar panels, posing a fire hazard.</p>	<p>退款 Refund</p>	
10	美國 (America)	<p>品牌(Brand) : Nuby 品名(Name) : 嬰兒車風扇 (Stroller Fans) 型號 (Model) : 25138</p>	<p>嬰兒車風扇的外殼允許消費者的手指接觸風扇的葉片，對幼兒造成割傷危險。 The stroller fan's housing allows consumers' fingers to contact the fan's blade, posing a laceration injury hazard to small children.</p>	<p>替換 Replace</p>	
11	美國 (America)	<p>品牌(Brand) : 不詳 (unknown) 品名(Name) : 水下推進器和替換電池 (僅限黑色電池) (underwater scooters and replacement batteries (black batteries only)) 型號 (Model) : 不詳 (unknown)</p>	<p>鋰離子電池可能過熱並起火，對消費者造成火災隱患。 The lithium-ion batteries can overheat and ignite, posing a fire hazard to consumers.</p>	<p>替換 Replace</p>	

2025年3月電子電氣產品召回案例 (北美地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
11	美國 (America)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：桌面暖風機 (Desktop Heaters) 型號 (Model)：BHN2133</p>	<p>加熱器的風扇可能無法啟動，導致設備過熱並起火，造成火災和燒傷危險。 The heater's fan can fail to turn on and cause the unit to overheat and ignite, posing fire and burn hazards.</p>	<p>退款 Refund</p>	
12	美國 (America)	<p>品牌(Brand)：Aiper 品名(Name)：泳池清潔機器人 (Pool cleaner robot) 型號 (Model)：ZT6001</p>	<p>召回的泳池吸塵器配有大電流適配器，該適配器可能會過熱，造成燒傷和火災危險。 The recalled pool vacuum cleaner has a large current adapter that can overheat, posing burn and fire hazards.</p>	<p>替換 Replace</p>	
12	美國 (America)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：桌面暖風機 (Desktop Heaters) 型號 (Model)：不詳 (unknown)</p>	<p>使用過程中，沖泡杯手柄可能會強力彈出，導致玻璃壺破碎，並造成燒傷和割傷危險。 The brew cup handle can forcefully eject during use, shattering the glass carafe and posing a burn and laceration hazard.</p>	<p>退款 Refund</p>	

2025年3月電子電氣產品召回案例 (亞太地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
9	韓國(Korea)	<p>品牌(Brand) : 셋별하우스 品名(Name) : 白熾燈 (Incandescent lamps) 型號 (Model) : P14-2</p>	<p>接觸帶電部件有觸電危險 接觸產品表面有觸電危險 There is a risk of electric shock when in contact with live parts There is a risk of electric shock when in contact with the surface of the product</p>	<p>聯繫顧客進行維修、換貨、退款等。擁有該產品的消費者應立即停止使用。 Contact the customer to receive repairs, replacements, refunds, etc. Consumers who have the product should stop using it immediately.</p>	
9	韓國(Korea)	<p>品牌(Brand) : VIFAN 品名(Name) : 直流電源 (DC Power Supply) 型號 (Model) : XY18W-0503400USB</p>	<p>如果超過標準溫度，則存在產品著火的風險。 If the standard temperature is exceeded, there is a risk of product fire.</p>	<p>聯繫客戶以獲取維修、更換、退款等。擁有該產品的消費者應立即停止使用。 Contact the customer to receive repairs, replacements, refunds, etc. Consumers who have the product should stop using it immediately.</p>	
9	韓國(Korea)	<p>品牌(Brand) : 모모 品名(Name) : 直流電源 (DC Power Supply) 型號 (Model) : PD25WAC</p>	<p>如果超過標準溫度，則存在產品著火的風險。 If the standard temperature is exceeded, there is a risk of product fire.</p>	<p>聯繫客戶以獲取維修、更換、退款等。擁有該產品的消費者應立即停止使用。 Contact the customer to receive repairs, replacements, refunds, etc. Consumers who have the product should stop using it immediately.</p>	
9	韓國(Korea)	<p>品牌(Brand) : 모던하우스 品名(Name) : 插頭及插座 (Plugs and outlets) 型號 (Model) : XLW-10A3KPP</p>	<p>如果超過標準溫度，則存在產品著火的風險。 If the standard temperature is exceeded, there is a risk of product fire.</p>	<p>聯繫客戶以獲取維修、更換、退款等。擁有該產品的消費者應立即停止使用。 Contact the customer to receive repairs, replacements, refunds, etc. Consumers who have the product should stop using it immediately.</p>	

2025年3月電子電氣產品召回案例 (亞太地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
10	臺灣 (Taiwan)	<p>品牌(Brand)：亞果元素國際股份有限公司</p> <p>品名(Name)：行動電源 (Power Bank)</p> <p>型號 (Model)：GRAVITY CS5/CS10</p>	<p>部分批次產品於電池芯經過一定循環次數後，可能出現過熱變形現象，進而導致電池本身損壞無法使用。</p>	<p>已於官網及相關平臺公告召回資訊，消費者可主動聯繫本公司客服中心或門市辦理免費換貨作業。</p>	