



# 2025 年 11 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
45	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : All-In-One 品名(Name) : 履行適配器 (Travel adaptor) 型號 (Model) : 913D	<p>帶電插針到外邊緣的距離小於最小要求。此外，該產品的安全擋板不足，因此當插頭部分插入時，使用者可能接觸到帶電部件並觸電。</p> <p>該產品不符合低電壓指令的要求。</p> <p>The distance from the live pin to the outside edge is less than the minimum required. Moreover, the product has inadequate safety shutters, so when a plug is partially inserted, the user can touch live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	終端使用者手中召回產品 Recall of the product from end users	
45	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : Henry 品名(Name) : 吸塵器 (Vacuum cleaner) 型號 (Model) : HEC.100	<p>外部螺絲可能與帶電的內部部件接觸。如果使用者在使用產品時觸碰到該螺絲，可能會觸電。</p> <p>該產品不符合低電壓指令的要求。</p> <p>An external screw can be in contact with live internal parts. If a user accesses the screw while the product is in use, they may receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	終端使用者手中召回產品 Recall of the product from end users	
45	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : All-In-One 品名(Name) : 履行適配器 (Travel adaptor) 型號 (Model) : 913E	<p>帶電插針到外邊緣的距離小於最小要求。此外，該產品的安全擋板不足，因此當插頭部分插入時，使用者可能接觸到帶電部件並觸電。</p> <p>該產品不符合低電壓指令的要求。</p> <p>The distance from the live pin to the outside edge is less than the minimum required. Moreover, the product has inadequate safety shutters, so when a plug is partially inserted, the user can touch live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	終端使用者手中召回產品 Recall of the product from end users	




# 2025年11月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
47	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	<p>品牌(Brand) : Sistaco            品名(Name) : 卸甲設備 (Nail polish removal hub)            型號 (Model) : NB3 YLX-413</p>	<p>該產品的插頭未配備符合標準的保險絲。如果產品使用過程中電氣系統發生故障，保險絲可能無法防止火災和爆炸。該產品不符合低電壓指令的要求。</p> <p>The product's plug is not fitted with a conforming fuse. If there is a failure within the electrical system whilst the product is in use, the fuse may fail to prevent fire and explosion.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>邊境拒絕進口            Import rejected at border</p>	
47	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	<p>品牌(Brand) : Foshan Yuexingwang Technology Co., Ltd            品名(Name) : 水泵 (Water pump)            型號 (Model) : SM-028</p>	<p>該電纜橫截面積不足，可能導致過熱和起火，從而引發火災。該產品不符合低電壓指令的要求。</p> <p>The cable has an insufficient cross-sectional area, which may cause it to overheat and ignite, causing a fire.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>終端使用者手中召回產品            Recall of the product from end users</p>	
48	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	<p>品牌(Brand) : THISS (SZYDZS) Technology Co Ltd            品名(Name) : 充電器 (Charger)            型號 (Model) : MTC2003</p>	<p>該產品的變壓器和焊接品質不合格，插頭外緣到零線插腳之間的尺寸過窄。此外，保險絲接地不良。如果在使用過程中發生故障，保險絲可能無法防止觸電、火災和爆炸。該產品不符合低電壓指令的要求。</p> <p>The product's transformer and soldering quality is inadequate, the plug's dimensions between the outside edge to the neutral pin are too narrow. Furthermore, the fuse is inadequately earthed. If a fault occurs during use, the fuse may fail to prevent electric shock, fire and explosion.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>線上市場刪除了該產品清單            Removal of this product listing by the online marketplace</p>	

# 2025 年 11 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
45	立陶宛 (Lithuania)	品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：不詳 (unknown)	<p>該產品絕緣性能不足。用戶可能接觸到裸露的帶電部件，從而導致觸電。</p> <p>該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。</p> <p>The product has inadequate insulation. The user could touch accessible live parts, which can lead to an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	從市場撤回 Withdrawal of the product from the market	
48	立陶宛 (Lithuania)	品牌(Brand)：不詳 (unknown) 品名(Name)：USB 充電器 (USB charger) 型號 (Model)：FK11-1	<p>該設備不耐高溫，其外殼可能會變形，導致內部帶電部件裸露在外。用戶可能因接觸裸露的帶電部件而觸電。</p> <p>該產品不符合低電壓指令的要求。</p> <p>The device is not resistant to high temperatures, its casing may deform, leaving live parts accessible. The user could receive an electric shock from accessible live parts.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	從市場撤回 Withdrawal of the product from the market	
48	立陶宛 (Lithuania)	品牌(Brand)：不詳 (unknown) 品名(Name)：吹風機 (Hair dryer) 型號 (Model)：8020	<p>由於熱塑性材料耐熱性不足，材料可能發生劣化。用戶可能接觸到帶電部件，從而導致觸電風險。</p> <p>該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1 和 60335-2。</p> <p>Due to the inadequate resistance of the thermoplastic material to heat, the material can deteriorate. A user can access live parts, leading to a risk of electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60335-1 and 60335-2.</p>	從市場撤回 Withdrawal of the product from the market	

# 2025 年 11 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
46	匈牙利 (Hungary)	<p>品牌(Brand)：不詳 (unknown)            品名(Name)：燈鏈 (Lighting chain)            型號 (Model)：不詳 (unknown)</p>	<p>電纜未正確固定，裸露的電線絕緣不足。此外，延長線插座僅允許單極插頭插入。而且，插頭和插座的尺寸不符合規定規格。用戶可能接觸到裸露的帶電部件而觸電。            該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。            The cable is not properly anchored, and the accessible wires have inadequate insulation. Additionally, the cord extension socket allows single-pole insertion of plugs. Furthermore, the plug and socket dimensions do not meet the required specifications. The user could touch accessible live parts and receive an electric shock.            The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>從市場撤回            Withdrawal of the product from the market</p>	
46	匈牙利 (Hungary)	<p>品牌(Brand)：不詳 (unknown)            品名(Name)：燈鏈 (Lighting chain)            型號 (Model)：125L LED fény DN-75</p>	<p>該產品絕緣性能不足。此外，插頭和插座的尺寸不符合相關規格要求。用戶可能接觸到帶電部件而觸電。            該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。            The product has inadequate insulation. Furthermore, the plug and socket dimensions do not meet the required specifications. The user could touch accessible live parts and receive an electric shock.            The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>從市場撤回            Withdrawal of the product from the market</p>	
46	匈牙利 (Hungary)	<p>品牌(Brand)：LED Karácsonyi égősor            品名(Name)：燈鏈 (Lighting chain)            型號 (Model)：1101120 120L</p>	<p>電纜未正確固定，裸露的電線絕緣不足。此外，插頭和插座的尺寸不符合規格要求。用戶可能接觸到裸露的帶電部件而觸電。            該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。            The cable is not properly anchored, and the accessible wires have inadequate insulation. Furthermore, the plug and socket dimensions do not meet the required specifications. The user could touch accessible live parts and receive an electric shock.            The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>從市場撤回            Withdrawal of the product from the market</p>	

# 2025 年 11 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
46	匈牙利 (Hungary)	<p>品牌(Brand)：不詳 (unknown)            品名(Name)：燈鏈 (Lighting chain)            型號 (Model)：140HM110</p>	<p>電纜未正確固定，裸露的電線絕緣不足。此外，延長線插座僅允許單極插頭插入。而且，插頭和插座的尺寸不符合規定規格。用戶可能接觸到裸露的帶電部件而觸電。            該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。            The cable is not properly anchored, and the accessible wires have inadequate insulation. Additionally, the cord extension socket allows single-pole insertion of plugs. Furthermore, the plug and socket dimensions do not meet the required specifications. The user could touch accessible live parts and receive an electric shock.            The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598</p>	<p>禁止銷售產品及任何附帶措施            Ban on the marketing of the product and any accompanying measures            從市場撤回            Withdrawal of the product from the market            終端使用者手中召回產品            Recall of the product from end users</p>	
46	匈牙利 (Hungary)	<p>品牌(Brand)：不詳 (unknown)            品名(Name)：燈鏈 (Lighting chain)            型號 (Model)：不詳 (unknown)</p>	<p>該產品絕緣性能不足。用戶可能接觸到裸露的帶電部件，從而導致觸電。此外，電纜缺乏適當的固定（缺少應力消除裝置），插頭尺寸也不符合規格。而且，儘管該產品推薦用於戶外，但並未採取防潮措施。因此，水可能滲入產品內部，導致觸電。            該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。            The product has inadequate insulation. The user could touch accessible live parts, which can lead to an electric shock. Moreover, the cable lacks proper anchoring (missing strain relief), and the plug dimensions do not meet specifications. Furthermore, the product is not protected against moisture, despite being recommended for outdoor use. Consequently, the water could penetrate the product and cause an electric shock.            The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>禁止銷售產品及任何附帶措施            Ban on the marketing of the product and any accompanying measures            從市場撤回            Withdrawal of the product from the market            終端使用者手中召回產品            Recall of the product from end users</p>	

# 2025 年 11 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
46	匈牙利 (Hungary)	<p>品牌(Brand)：不詳 (unknown)            品名(Name)：燈鏈 (Lighting chain)            型號 (Model)：100HM85</p>	<p>電纜未正確固定，裸露的電線絕緣不足。此外，延長線插座僅允許單極插頭插入。而且，插頭和插座的尺寸不符合規定規格。用戶可能接觸到裸露的帶電部件而觸電。            該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。            The cable is not properly anchored, and the accessible wires have inadequate insulation. Additionally, the cord extension socket allows single-pole insertion of plugs. Furthermore, the plug and socket dimensions do not meet the required specifications. The user could touch accessible live parts and receive an electric shock.            The product does not comply with the requirement of the Low Voltage Directive nor with the European Standard EN 60598.</p>	<p>禁止銷售產品及任何附帶措施            Ban on the marketing of the product and any accompanying measures            從市場撤回            Withdrawal of the product from the market            終端使用者手中召回產品            Recall of the product from end users</p>	
47	匈牙利 (Hungary)	<p>品牌(Brand)：XWATT            品名(Name)：燈鏈 (Lighting chain)            型號 (Model)：cool white            XW-KL-102 hideg fehér</p>	<p>該電纜缺乏適當的固定（缺少應力消除裝置），且裸露的導線絕緣不足。用戶可能接觸到裸露的帶電部件，從而導致觸電。此外，儘管該產品推薦用於戶外，但並未採取防潮措施。因此，水可能滲入產品內部並導致觸電。            該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。            The cable lacks proper anchoring (missing strain relief) and the accessible wires have inadequate insulation. The user could touch accessible live parts, which can lead to an electric shock. Furthermore, the product is not protected against moisture, despite being recommended for outdoor use. Consequently, the water could penetrate the product and cause an electric shock.            The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>禁止銷售產品及任何附帶措施            Ban on the marketing of the product and any accompanying measures            從市場撤回            Withdrawal of the product from the market            終端使用者手中召回產品            Recall of the product from end users</p>	

# 2025 年 11 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
47	匈牙利 (Hungary)	<p>品牌(Brand)：不詳 (unknown)            品名(Name)：燈鏈 (Lighting chain)            型號 (Model)：BTDT200B</p>	<p>該電纜缺乏適當的固定（缺少應力消除裝置），且裸露的導線絕緣不足。用戶可能接觸到裸露的帶電部件，從而導致觸電。此外，儘管該產品推薦用於戶外，但並未採取防潮措施。因此，水可能滲入產品內部並導致觸電。            該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。            The cable lacks proper anchoring (missing strain relief) and the accessible wires have inadequate insulation. The user could touch accessible live parts, which can lead to an electric shock. Furthermore, the product is not protected against moisture, despite being recommended for outdoor use. Consequently, the water could penetrate the product and cause an electric shock.            The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>禁止銷售產品及任何附帶措施            Ban on the marketing of the product and any accompanying measures            從市場撤回            Withdrawal of the product from the market</p>	
47	匈牙利 (Hungary)	<p>品牌(Brand)：Lantern Series            品名(Name)：燈鏈 (Lighting chain)            型號 (Model)：CLD-PXD-RGB</p>	<p>電纜未正確固定，裸露的電線絕緣不足。此外，延長線插座僅允許單極插頭插入。而且，插頭和插座的尺寸不符合規定規格。用戶可能接觸到裸露的帶電部件而觸電。            該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。            The cable is not properly anchored, and the accessible wires have inadequate insulation. Additionally, the cord extension socket allows single-pole insertion of plugs. Furthermore, the plug and socket dimensions do not meet the required specifications. The user could touch accessible live parts and receive an electric shock.            The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>禁止銷售產品及任何附帶措施            Ban on the marketing of the product and any accompanying measures            從市場撤回            Withdrawal of the product from the market</p>	
47	匈牙利 (Hungary)	<p>品牌(Brand)：不詳 (unknown)            品名(Name)：燈鏈 (Lighting chain)            型號 (Model)：M510</p>	<p>該產品絕緣性能不足。此外，插座尺寸不符合規定規格。用戶可能接觸到帶電部件而觸電。            該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。            The product has inadequate insulation. Additionally, the socket dimensions do not meet the required specifications. The user could touch accessible live parts and receive an electric shock.            The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>從市場撤回            Withdrawal of the product from the market            終端使用者手中召回產品            Recall of the product from end users</p>	

# 2025 年 11 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
47	匈牙利 (Hungary)	<p>品牌(Brand) : XWATT            品名(Name) : 燈鏈 (Lighting chain)            型號 (Model) : XW-KL-101</p>	<p>電纜未正確固定，裸露的電線絕緣不足。此外，插頭尺寸不符合規格要求。而且，儘管產品推薦用於戶外，但並未採取防潮措施。因此，用戶可能接觸到裸露的帶電部件，或者水可能滲入產品內部導致觸電。            該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。            The cable is not properly anchored, and the accessible wires have inadequate insulation. Additionally, the plug dimensions do not meet the required specifications.            Furthermore, the product is not protected against moisture, despite being recommended for outdoor use.            Consequently, the user could touch accessible live parts or the water could penetrate the product and cause an electric shock.            The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>禁止銷售產品及任何附帶措施            Ban on the marketing of the product and any accompanying measures            從市場撤回            Withdrawal of the product from the market            終端使用者手中召回產品            Recall of the product from end users</p>	
47	匈牙利 (Hungary)	<p>品牌(Brand) : XWATT            品名(Name) : 燈鏈 (Lighting chain)            型號 (Model) : XW-KL-103</p>	<p>電纜未正確固定，裸露的電線絕緣不足。此外，插頭尺寸不符合規格要求。而且，儘管產品推薦用於戶外，但並未採取防潮措施。因此，用戶可能接觸到裸露的帶電部件，或者水可能滲入產品內部導致觸電。            該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。            The cable is not properly anchored, and the accessible wires have inadequate insulation. Additionally, the plug dimensions do not meet the required specifications.            Furthermore, the product is not protected against moisture, despite being recommended for outdoor use.            Consequently, the user could touch accessible live parts or the water could penetrate the product and cause an electric shock.            The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>禁止銷售產品及任何附帶措施            Ban on the marketing of the product and any accompanying measures            從市場撤回            Withdrawal of the product from the market            終端使用者手中召回產品            Recall of the product from end users</p>	

# 2025 年 11 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
47	匈牙利 (Hungary)	<p>品牌(Brand)：不詳 (unknown)            品名(Name)：燈鏈 (Lighting chain)            型號 (Model)：MD200W</p>	<p>該產品絕緣性能不足，且延長線插座僅允許單極插頭插入。此外，插頭和插座的尺寸不符合相關規格要求。用戶可能接觸到帶電部件而觸電。            該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。            The product has inadequate insulation, and the cord extension socket allows single-pole insertion of plugs. Furthermore, the plug and socket dimensions do not meet the required specifications. The user could touch accessible live parts and receive an electric shock.            The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>禁止銷售產品及任何附帶措施            Ban on the marketing of the product and any accompanying measures            從市場撤回            Withdrawal of the product from the market</p>	
47	匈牙利 (Hungary)	<p>品牌(Brand)：不詳 (unknown)            品名(Name)：燈鏈 (Lighting chain)            型號 (Model)：Y5169</p>	<p>電纜未正確固定，裸露的電線絕緣不足。此外，延長線插座僅允許單極插頭插入。而且，插頭和插座的尺寸不符合規定規格。用戶可能接觸到裸露的帶電部件而觸電。            該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。            The cable is not properly anchored, and the accessible wires have inadequate insulation. Additionally, the cord extension socket allows single-pole insertion of plugs. Furthermore, the plug and socket dimensions do not meet the required specifications. The user could touch accessible live parts and receive an electric shock.            The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>禁止銷售產品及任何附帶措施            Ban on the marketing of the product and any accompanying measures            從市場撤回            Withdrawal of the product from the market            終端使用者手中召回產品            Recall of the product from end users</p>	


# 2025 年 11 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
48	匈牙利 (Hungary)	<p>品牌(Brand)：不詳 (unknown)            品名(Name)：燈鏈 (Lighting chain)            型號 (Model)：MD100RGB</p>	<p>該電纜缺乏適當的固定（缺少應力消除裝置），且裸露的電線絕緣不足。此外，延長線插座僅允許單極插頭插入，且插頭尺寸不符合規格要求。用戶可能接觸到裸露的帶電部件，從而導致觸電。而且，儘管該產品推薦用於戶外，但並未進行防潮處理。因此，水可能滲入產品內部，造成觸電事故。該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。</p> <p>The cable lacks proper anchoring (missing strain relief) and the accessible wires have inadequate insulation. Additionally, the cord extension socket allows single-pole insertion of plugs and the plug dimensions do not meet the required specifications. The user could touch accessible live parts, which can lead to an electric shock. Furthermore, the product is not protected against moisture, despite being recommended for outdoor use. Consequently, water could penetrate the product and cause an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>禁止銷售產品及任何附帶措施            Ban on the marketing of the product and any accompanying measures            從市場撤回            Withdrawal of the product from the market            終端使用者手中召回產品            Recall of the product from end users</p>	
46	克羅埃西亞 (Croatia)	<p>品牌(Brand)：不詳 (unknown)            品名(Name)：吸頂燈 (Ceiling lamp)            型號 (Model)：Q-X4-52</p>	<p>由於 LED 驅動器無法插入吸頂燈座，該燈具無法正確安裝。因此，用戶可能接觸到裸露的帶電部件並觸電。此外，產品缺少安全資訊。該產品不符合低電壓指令的要求。</p> <p>The lamp can't be installed properly because the LED driver can't be inserted into the ceiling cup. Consequently, the user could touch accessible live parts and receive an electric shock. Moreover, safety information is missing. The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>線上市場刪除了該產品清單            Removal of this product listing by the online marketplace</p>	

# 2025 年 11 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
48	克羅埃西亞 (Croatia)	品牌(Brand)：不詳 (unknown) 品名(Name)：吸頂燈 (Ceiling lamp) 型號 (Model)：BC-1935	<p>該產品的塑膠材質 (內部連接器) 不防火，可能導致觸電和/或火災。此外，其絕緣性能不足，也可能導致觸電。而且，該產品缺少安全資訊。</p> <p>該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60598-1 和 EN 60598-2。</p> <p>The plastic material (internal connector) of the product is not fire-resistant, which can lead to an electric shock and/or a fire. Additionally, the insulation is insufficient. This may cause an electric shock. Moreover, safety information is missing.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60598-1 and EN 60598-2.</p>	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace	
45	法國 (France)	品牌(Brand)：不詳 (unknown) 品名(Name)：LED 燈 (LED lamp) 型號 (Model)：不詳 (unknown)	<p>由於插頭設計不當，使用者可能接觸到帶電部件並觸電。該產品不符合低電壓指令的要求。</p> <p>Due to the incorrect design of the plug, the user can touch live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace	
48	法國 (France)	品牌(Brand)：DGTL S 品名(Name)：鈕扣電池 (Button batteries) 型號 (Model)：CR2450 3V	<p>包裝並非兒童安全包裝，因此鈕扣電池很容易被兒童拿到。兒童可能會將電池放入口中，導致窒息。如果誤食鈕扣電池，也可能對兒童的消化系統造成損害。</p> <p>本產品不符合通用產品安全法規 (GDPR) 和歐洲標準 EN 60086-4。</p> <p>The packaging is not childproof and therefore the button batteries are easily accessible to children. A child may put them in the mouth, and choke. The button batteries could also cause damage to the child's gastrointestinal tract if they are ingested.</p> <p>This product does not comply with the General Product Safety Regulation nor with the European standard EN 60086-4.</p>	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 終端使用者手中召回產品 Recall of the product from end users	

# 2025 年 11 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
48	法國 (France)	<p>品牌(Brand) : Supacell            品名(Name) : 鈕扣電池 (Button batteries)            型號 (Model) : CR2032</p>	<p>包裝並非兒童安全包裝，因此鈕扣電池很容易被兒童拿到。兒童可能會將電池放入口中，導致窒息。如果誤食鈕扣電池，也可能對兒童的消化系統造成損害。            本產品不符合通用產品安全法規 (GDPR) 和歐洲標準 EN 60086-4。            The packaging is not childproof and therefore the button batteries are easily accessible to children. A child may put them in the mouth, and choke. The button batteries could also cause damage to the child's gastrointestinal tract if they are ingested.            This product does not comply with the General Product Safety Regulation nor with the European standard EN 60086-4.</p>	<p>線上市場刪除了該產品清單            Removal of this product listing by the online marketplace            警告消費者風險            Warning consumers of the risks</p>	
48	法國 (France)	<p>品牌(Brand) : DGTLS            品名(Name) : 鈕扣電池 (Button batteries)            型號 (Model) : CR2430 3V</p>	<p>包裝並非兒童安全包裝，因此鈕扣電池很容易被兒童拿到。兒童可能會將電池放入口中，導致窒息。如果誤食鈕扣電池，也可能對兒童的消化系統造成損害。            本產品不符合通用產品安全法規 (GDPR) 和歐洲標準 EN 60086-4。            The packaging is not childproof and therefore the button batteries are easily accessible to children. A child may put them in the mouth, and choke. The button batteries could also cause damage to the child's gastrointestinal tract if they are ingested.            This product does not comply with the General Product Safety Regulation nor with the European standard EN 60086-4.</p>	<p>線上市場刪除了該產品清單            Removal of this product listing by the online marketplace            終端使用者手中召回產品            Recall of the product from end users</p>	
48	法國 (France)	<p>品牌(Brand) : JANOLTY            品名(Name) : 吹風機 (Hair dryer)            型號 (Model) : STL-8878 pro</p>	<p>使用者可通過產品的排氣口輕鬆接觸到帶電部件，從而存在觸電風險。            該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1 和 60335-2。            A user can easily access live parts through the product's air outlet, leading to a risk of electric shock.            The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60335-1 and 60335-2.</p>	<p>線上市場刪除了該產品清單            Removal of this product listing by the online marketplace</p>	

# 2025 年 11 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
46	波蘭 (Poland)	品牌(Brand) : Rexxer 品名(Name) : 水泵 (Water pump) 型號 (Model) : RF-44-177	<p>由於接地不良、絕緣不足、電源線橫截面積過小以及安全距離和爬電距離不足，該產品存在使用者觸電風險。該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1 和 EN 60335-2-41。</p> <p>Due to inadequate grounding, insulation, cross section area of the power cord and inadequate clearance and creepage distances, the product poses a risk of electric shock to the user.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60335-1 and EN 60335-2-41.</p>	從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks	
48	波蘭 (Poland)	品牌(Brand) : Kraft&Dele 品名(Name) : 水泵 (water pump) 型號 (Model) : KD750-CZ/VMP60	<p>考慮到本產品的額定功率 (450W)，所用的電源線並不適用。該電源線不耐彎折，容易損壞，導致帶電部件裸露。用戶接觸到裸露的帶電部件可能會觸電。本產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1 和 EN 60335-2-41。</p> <p>The applied power cord is not adequate for this product considering its nominal power (450W). The power cord is not resistant to bending and it may get damaged, leaving live parts accessible. The user could touch the accessible live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive, nor with the European standards EN 60335-1 and EN 60335-2-41.</p>	從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks	
48	芬蘭 (Finland)	品牌(Brand) : Classic 品名(Name) : 電池充電器 (Battery charger) 型號 (Model) : PSE50296	<p>該產品的絕緣性能不足。用戶可能因接觸帶電部件而觸電。該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1。</p> <p>The insulation of the product is inadequate. The user could receive an electric shock from accessible live parts.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	終端使用者手中召回產品 Recall of the product from end users	

# 2025 年 11 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
45	奧地利 (Austria)	<p>品牌(Brand) : BlendJet            品名(Name) : 可攜式榨汁機 (Portable blender)            型號 (Model) : BlendJet2</p>	<p>液體容器邊緣與刀片之間的距離過小。使用者在設備運行時可能將手伸入液體容器內並觸及旋轉刀片，從而導致手指或手部被割傷。            該產品不符合機械指令的要求，也不符合歐洲標準 EN 60335-2-14。            The distance between the edge of the liquid container and the blade is too small. A user could insert their hand into the liquid container and reach the rotating blade while the device is operating. Therefore, the user can suffer cuts on the fingers or on the hand.            The product does not comply with the requirements of the Machinery Directive nor with the European standard EN 60335-2-14.</p>	<p>從市場撤回            Withdrawal of the product from the market</p>	
45	瑞典 (Sweden)	<p>品牌(Brand) : 不詳 (unknown)            品名(Name) : 燈 (Lamp)            型號 (Model) : 3058249</p>	<p>該產品中的焊料鉛含量過高 (實測值最高達 73.1% (重量比))。鉛對環境構成風險。            該產品不符合關於限制在電氣和電子設備中使用某些有害物質的指令 (RoHS 2 指令) 的要求。            The solders in the product have an excessive concentration of lead (measured value up to 73.1 % by weight). Lead poses a risk to the environment.            The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>從市場撤回            Withdrawal of the product from the market</p>	
45	瑞典 (Sweden)	<p>品牌(Brand) : 不詳 (unknown)            品名(Name) : LED 燈帶 (LED strip)            型號 (Model) : 3058249</p>	<p>該產品中的焊料鉛和鎘含量過高 (實測值分別高達 65.5% 和 0.326% (重量百分比))。鉛和鎘會對環境造成危害。            該產品不符合關於限制在電氣和電子設備中使用某些有害物質的指令 (RoHS 2 指令) 的要求。            The solders in the product have an excessive concentration of lead and cadmium (measured values up to 65.5 % and 0.326 % by weight, respectively). Lead and cadmium pose a risk to the environment.            The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>從市場撤回            Withdrawal of the product from the market</p>	

# 2025 年 11 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
45	瑞典 (Sweden)	<p>品牌(Brand) : Out of the Blue            品名(Name) : 蹦迪燈 (Disco lamp)            型號 (Model) : 不詳 (unknown)</p>	<p>該產品鉛含量超標 (實測值最高達 77% (重量比))。鉛對環境構成風險。            該產品不符合關於限制在電氣和電子設備中使用某些有害物質的指令 (RoHS 2 指令) 的要求。            The product has an excessive concentration of lead (measured value up to 77 % by weight). Lead poses a risk to the environment.            The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>從市場撤回            Withdrawal of the product from the market</p>	
45	瑞典 (Sweden)	<p>品牌(Brand) : 不詳 (unknown)            品名(Name) : 燈 (Lamp)            型號 (Model) : 3058311</p>	<p>該產品中的焊料鉛含量過高 (實測值最高達 82% (重量比))。鉛會對環境造成危害。            該產品不符合關於限制在電氣和電子設備中使用某些有害物質的指令 (RoHS 2 指令) 的要求。            The solders in the product have an excessive concentration of lead (measured value up to 82 % by weight). Lead poses a risk to the environment.            The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>從市場撤回            Withdrawal of the product from the market</p>	
46	瑞典 (Sweden)	<p>品牌(Brand) : 不詳 (unknown)            品名(Name) : 應急廣播 (Emergency radio)            型號 (Model) : 16555            MD-088</p>	<p>該產品中的焊料鉛含量過高 (實測值最高達 60% 重量比)。鉛對環境構成威脅。            該產品不符合關於限制在電氣和電子設備中使用某些有害物質的指令 (RoHS 2 指令) 的要求。            The solders in the product have an excessive concentration of lead (measured value up to 60% by weight). Lead poses a risk to the environment.            The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>邊境拒絕進口            Import rejected at border</p>	

# 2025 年 11 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
46	瑞典 (Sweden)	<p>品牌(Brand) : YUYU            品名(Name) : 電動機 ( motor)            型號 (Model) : 不詳 (unknown)</p>	<p>該產品中的焊料鉛含量過高 (實測值最高達 63% (重量比))。鉛會對環境造成危害。            該產品不符合關於限制在電氣和電子設備中使用某些有害物質的指令 (RoHS 2 指令) 的要求。            The solders in the product have an excessive concentration of lead (measured value up to 63% by weight). Lead poses a risk to the environment.            The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>邊境拒絕進口            Import rejected at border</p>	
46	瑞典 (Sweden)	<p>品牌(Brand) : 不詳 (unknown)            品名(Name) : 應急廣播 (Emergency radio)            型號 (Model) : 366</p>	<p>該充電器的電纜絕緣層中短鏈氯化石蠟 (SCCP) 含量過高 (實測值最高達 3.7% 重量比) 和鄰苯二甲酸二丁酯 (DBP) 含量過高 (實測值最高達 0.65% 重量比)。產品中的焊料鉛含量過高 (實測值最高達 62% 重量比)。SCCP 會在環境中持久存在，低濃度下即可對水生生物造成毒害，並在野生動物和人體內生物累積，對人類健康和環境構成威脅。長期經皮膚接觸 SCCP 可能導致癌症。鉛對環境構成威脅。DBP 對人類健康和環境構成威脅。該產品不符合持久性有機污染物 (POP) 法規以及關於限制在電氣和電子設備中使用某些有害物質的指令 (RoHS 2 指令) 的要求。            The cable insulation the charger has an excessive concentration of short chain chlorinated paraffins (SCCPs) (measured value up to 3.7% by weight) and di-n-butyl phthalate (DBP) (measured value up to 0.65% by weight).            The solders in the product have an excessive concentration of lead (measured value up to 62 % by weight). SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bio-accumulate in wildlife and humans, posing a risk to human health and the environment. Prolonged exposure to them through the skin may cause cancer. Lead poses a risk to the environment. DBP poses a risk to human health and the environment.            The product does not comply with the Persistent Organic Pollutants (POP) Regulation nor with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>從市場撤回            Withdrawal of the product from the market</p>	

# 2025 年 11 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
46	瑞典 (Sweden)	<p>品牌(Brand) : 不詳 (unknown)            品名(Name) : 無線手柄 (Wireless controller)            型號 (Model) : LongDeLi 5188S</p>	<p>該產品中的焊料鉛含量超標 (實測值最高達 60%重量比) 。電纜塑膠材料中鄰苯二甲酸二(2-乙基己基)酯 (DEHP) 含量超標 (實測值最高達 0.7%重量比) 。該產品還含有超標的短鏈氯化石蠟 (SCCPs) (實測值最高達 2.7%重量比) 。鉛對環境構成風險。DEHP 對人類健康和環境構成風險。SCCPs 會在環境中持久存在，低濃度下即可對水生生物產生毒性，並在野生動物和人體內生物累積，對人類健康和環境構成風險。長期經皮膚接觸可能導致癌症。</p> <p>該產品不符合《關於限制在電氣和電子設備中使用某些有害物質的指令》(RoHS 2 指令) 和《持久性有機污染物 (POP) 條例》的要求。</p> <p>The solders in the product have an excessive concentration of lead (measured value up to 60 % by weight). The plastic material of the cable has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 0.7 % by weight).The product also has an excessive concentration of short chain chlorinated paraffins (SCCPs) (measured value up to 2.7 % by weight). Lead poses a risk to the environment. DEHP poses a risk to human health and the environment. SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bio-accumulate in wildlife and humans, posing a risk to human health and the environment. Prolonged exposure to them through the skin may cause cancer.</p> <p>The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive) nor with the Persistent Organic Pollutants (POP) Regulation.</p>	<p>從市場撤回            Withdrawal of the product from the market</p>	

# 2025 年 11 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
46	瑞典 (Sweden)	<p>品牌(Brand) : Beyond Time            品名(Name) : 鐘 (Wall clock)            型號 (Model) : LongDeLi 5188S</p>	<p>該產品中的焊料鉛和鎘含量過高 (實測值分別高達 71% 和 0.35% (重量百分比))。鉛和鎘會對環境造成危害。            該產品不符合關於限制在電氣和電子設備中使用某些有害物質的指令 (RoHS 2 指令) 的要求。            The solders in the product have an excessive concentration of lead and cadmium (measured values up to 71 % and 0.35 % by weight, respectively). Lead and cadmium pose a risk to the environment.            The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>從市場撤回            Withdrawal of the product from the market</p>	
46	瑞典 (Sweden)	<p>品牌(Brand) : KJH            品名(Name) : 充電支架 (Charging stand)            型號 (Model) : KJHPSLIM-03</p>	<p>該產品中的焊料鉛和鎘含量過高 (實測值分別高達 79% 和 0.4% (重量百分比))。鉛和鎘會對環境造成危害。            該產品不符合關於限制在電氣和電子設備中使用某些有害物質的指令 (RoHS 2 指令) 的要求。            The solders in the product have an excessive concentration of lead and cadmium (measured values up to 79% and 0.4% by weight, respectively). Lead and cadmium pose a risk to the environment.            The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>從市場撤回            Withdrawal of the product from the market</p>	
46	瑞典 (Sweden)	<p>品牌(Brand) : 不詳 (unknown)            品名(Name) : 應急廣播 (Emergency radio)            型號 (Model) : 17115            DAB-375BT</p>	<p>該產品中的焊料鉛含量過高 (實測值最高達 41% (重量比))。鉛會對環境造成危害。            該產品不符合關於限制在電氣和電子設備中使用某些有害物質的指令 (RoHS 2 指令) 的要求。            The solders in the product have an excessive concentration of lead (measured value up to 41% by weight). Lead poses a risk to the environment.            The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>邊境拒絕進口            Import rejected at border</p>	


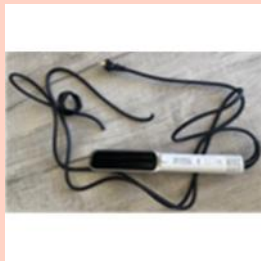
# 2025 年 11 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
46	瑞典 (Sweden)	<p>品牌(Brand) : INNOVA GOODS            品名(Name) : 電熱水袋 (Hot water bottle)            型號 (Model) : 不詳 (unknown)</p>	<p>該產品鉛含量超標 (實測值最高達 0.31% (重量比))。該產品鄰苯二甲酸二(2-乙基己基)酯 (DEHP) 和鄰苯二甲酸二丁酯 (DBP) 含量也超標 (實測值分別最高達 35% 和 0.34% (重量比))。鉛對環境構成風險。鄰苯二甲酸二(2-乙基己基)酯 (DEHP) 和鄰苯二甲酸二丁酯 (DBP) 對人類健康和環境構成風險。            該產品不符合關於限制在電氣和電子設備中使用某些有害物質的指令 (RoHS 2 指令) 的要求。            The product has an excessive concentration of lead (measured value up to 0.31% by weight). The product also has an excessive concentration of DEHP and DBP (measured values up to 35 and 0.34 % by weight respectively). Lead poses a risk to the environment. DEHP and DBP pose a risk to human health and the environment.            The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>從市場撤回            Withdrawal of the product from the market</p>	
47	瑞典 (Sweden)	<p>品牌(Brand) : FCBARCELONA            品名(Name) : 收音機 (Radio)            型號 (Model) : 3005056</p>	<p>該產品中的焊料鉛含量過高 (實測值最高達 66.3% (重量比))。鉛會對環境造成危害。            該產品不符合關於限制在電氣和電子設備中使用某些有害物質的指令 (RoHS 2 指令) 的要求。            The solders in the product have an excessive concentration of lead (measured value up to 66.3% by weight). Lead poses a risk to the environment.            The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>線上市場刪除了該產品清單            Removal of this product listing by the online marketplace</p>	

# 2025 年 11 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
48	瑞典 (Sweden)	品牌(Brand)：不詳 (unknown) 品名(Name)：舞蹈墊子 (Dance mat) 型號 (Model)：不詳 (unknown)	<p>該產品中的焊料鉛含量過高（實測值最高達 68.9%（重量比））。鉛會對環境造成危害。</p> <p>該產品不符合關於限制在電氣和電子設備中使用某些有害物質的指令（RoHS 2 指令）的要求。</p> <p>The solders in the product have an excessive concentration of lead (measured values up to 68.9% by weight). Lead poses a risk to the environment.</p> <p>The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>線上市場刪除了該產品清單</p> <p>Removal of this product listing by the online marketplace</p>	

# 2025 年 11 月 電子電氣產品召回案例 (北美地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
46	美國 (America)	<p>品牌(Brand)：不詳 (unknown)            品名(Name)：鈕扣電池 (Button Cell and Coin Batteries)            型號 (Model)：00263，00264，00265，00271，00272，00276</p>	<p>鈕扣電池和鋰鈕扣電池沒有採用兒童安全包裝，也沒有貼上裡斯法案要求的警告標籤。如果兒童吞食鈕扣電池或鋰鈕扣電池，吞入的電池可能會造成嚴重傷害，包括內部化學灼傷甚至死亡。            The button cell and lithium coin batteries are not in child-resistant packaging and do not bear the warning labels required under Reese's Law. If a child swallows button cell or coin batteries, the ingested batteries can cause serious injuries, including internal chemical burns and death.</p>	<p>退款            Refund</p>	
48	美國 (America)	<p>品牌(Brand)：MyOnlyStyler            品名(Name)：鈕扣電池 (Root Booster Hair Dryers)            型號 (Model)：不詳 (unknown)</p>	<p>這些掌上型吹風機缺少浸水保護裝置，對消費者構成重大產品危險，如果吹風機在插電狀態下掉入水中，可能會因觸電或電擊而導致死亡或嚴重傷害。            The handheld hair dryers lack an immersion protection device, which presents a substantial product hazard to consumers, posing the risk of death or serious injury from electrocution or shock if the hair dryers fall into water while plugged in.</p>	<p>退款            Refund</p>	

# 2025 年 11 月電子電氣產品召回案例 (亞太地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
46	澳洲 (Australia)	<p>品牌(Brand) : Zap Pad            品名(Name) : 無線充電寶            ( wireless magnetic power bank )            型號 (Model) : ZZ-WMSPB-5K</p>	<p>受影響的移動電源在使用或充電時可能會過熱。            The affected power bank can overheat when used or being charged.</p>	<p>請立即停止使用受影響的移動電源。            請聯繫 Zip Zap Chargers 安排更換產品。            請根據當地鋰離子電池處理規定處置受影響的移動電源。請勿將移動電源丟棄在生活垃圾桶中。在處理更換產品之前，我們將確認您的處置方式。            Stop using affected power banks immediately.            Contact Zip Zap Chargers to arrange for a replacement product.            Dispose of affected power banks in accordance with local requirements for lithium-ion batteries. Do not place power banks in domestic garbage bins.            Confirmation of disposal will be sought prior to processing a replacement product.</p>	
47	澳洲 (Australia)	<p>品牌(Brand) : 不詳            (unknown)            品名(Name) : 用於櫥櫃和廚房 LED 照明系統的掌上型遙控器 ( Handheld remote control for cabinet and kitchen LED lighting systems. )            型號 (Model) : 3110701, 3111701, 3112501, 3116301.</p>	<p>電池未固定，兒童可能接觸到鈕扣電池。            遙控器缺少以下警告資訊：            鈕扣電池對兒童的危險性；            當懷疑有人吞食或將鈕扣電池放入體內任何部位時應採取的措施。            The battery isn't secured, and children could access the button/coin battery.            The remote is missing warning information about the dangers of button/coin batteries to children            what to do when a person suspects someone has swallowed or placed a button/coin battery inside any part of their body.</p>	<p>請立即停止使用遙控器，並將其放置在兒童接觸不到的地方。            請將遙控器退回海蒂詩或購買地點，我們將免費為您更換一個符合標準的遙控器。            Stop using the remote immediately and place out of reach of children.            Return the remote to Hettich or the place of purchase for a free replacement with a compliant remote.</p>	

# 2025 年 11 月電子電氣產品召回案例 (亞太地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
48	澳洲 (Australia)	<p>品牌(Brand)：不詳 (unknown)</p> <p>品名(Name)：可攜式無線充電寶 (Portable wireless power bank)</p> <p>型號 (Model)：BPB002btBK BPB002btWH</p>	<p>移動電源中的鋰離子電池可能會過熱，這可能會對消費者造成火災隱患。</p> <p>The lithium-ion battery in the power bank can overheat, which could pose a fire hazard to consumers.</p>	<p>請立即停止使用受影響的移動電源。</p> <p>斷開移動電源與電源或其他產品的連接，並將其放置在安全乾燥的地方，遠離任何易燃物或可能損壞移動電源的物品。</p> <p>請訪問 Belkin 召回頁面，瞭解如何獲得退款或商店積分。</p> <p>請根據當地鋰離子電池處理要求處置受影響的移動電源。請勿將移動電源放入生活垃圾或回收箱中。</p> <p>Stop using affected power banks immediately.</p> <p>Disconnect from any power supply or other products and place in a safe dry location away from anything flammable or anything that can damage the power bank.</p> <p>Visit the Belkin recall page for instructions on how to obtain a refund or store credit.</p> <p>Dispose of affected power banks in accordance with local requirements for lithium-ion batteries. Do not place power banks in household rubbish or recycling bins.</p>	