


2025年9月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
38	丹麥 (Denmark)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：適配器 (Power adaptor) 型號 (Model)：JT-AG1091-3A2C</p>	<p>該產品頂部可輕鬆拆卸，露出帶電部件。因此，用戶可能會觸碰這些可接觸的帶電部件，從而導致觸電。 該產品不符合低電壓指令的要求。 The top of the product can be easily detached, exposing live parts. Consequently, the user could touch these accessible live parts, which may result in an electric shock. The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>終端使用者手中召回產品 Recall of the product from end users</p>	
39	愛爾蘭(Ireland)	<p>品牌(Brand)：Devielle 品名(Name)：暖風機 (Fan heater) 型號 (Model)：DEF978005</p>	<p>暖風機的格柵很容易斷裂，導致帶電部件觸及。用戶可能觸碰這些部件並遭受電擊。 該產品不符合低壓指令和歐洲標準 EN 60335-1 的要求。 The grille of the fan heater can easily break leaving live parts accessible. A user could touch them and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-1.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market</p>	
36	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	<p>品牌(Brand)：Christine Shelly 品名(Name)：美甲燈 (UV nail lamp) 型號 (Model)：STET-1261000-UKD1 X20</p>	<p>插頭插針過寬，深度不足。因此，它們無法與連接處正確接觸，並損壞插座。插頭過熱可能引發火災。此外，用戶可能接觸到可觸及的帶電部件，從而遭受電擊。 本產品不符合低電壓指令的要求。 The plug pins are too wide and not as deep as they should be. Therefore, they do not make proper contact with the connections and damage the socket. The plug can overheat causing a fire. Moreover, the user can touch the accessible live parts and receive an electric shock. This product does not comply with the requirements of the Low Voltage Directive.</p>	<p>邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product 線上市場刪除了該產品清單 Removal of this product listing by the online marketplace</p>	

2025 年 9 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
37	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : Floson 品名(Name) : 電源延長線 (Extension lead) 型號 (Model) : ST-8933	<p>電路之間的爬電距離和電氣間隙不足，且不符合規定的絕緣要求。這可能導致用戶被可觸及的帶電部件觸電。此外，該產品還包含一個接地錯誤的保險絲。如果在使用過程中發生故障，插頭可能會過熱並起火。</p> <p>本產品不符合低電壓指令的要求。</p> <p>There is insufficient creepage and clearance distance between circuits, and it does not meet required insulation requirements. This can lead to the user receiving an electric shock from accessible live parts. Moreover, the product also has a fuse link that is incorrectly earthed. If a fault occurs during use, the plug can overheat and catch fire.</p> <p>This product does not comply with the requirements of the Low Voltage Directive.</p>	<p>線上市場刪除了該產品清單</p> <p>Removal of this product listing by the online marketplace</p>	
38	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : 不詳 (unknown) 品名(Name) : 縫紉機 (Sewing machine) 型號 (Model) : DZ012ELL060150B (adapter) UFR-738 (machine)	<p>插頭上的插針距離產品邊緣太近，尺寸不夠。使用者在拔插插頭時可能會觸碰到插針，從而可能導致觸電。</p> <p>本產品不符合低電壓指令的要求。</p> <p>The pins on the plug are too close to the periphery of the product and their dimension is inadequate. The user could touch the pins while removing or inserting the plug, potentially leading to electric shock.</p> <p>This product does not comply with the requirements of the Low Voltage Directive.</p>	<p>邊境拒絕進口</p> <p>Import rejected at border</p> <p>線上市場刪除了該產品清單</p> <p>Removal of this product listing by the online marketplace</p>	
38	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : SREMTCH 品名(Name) : 電烙鐵 (Soldering iron kit) 型號 (Model) : MH2001	<p>保險絲太短，可能無法正常工作。這可能會導致電器過熱並起火。</p> <p>本產品不符合低電壓指令的要求。</p> <p>The fuse link is too short and may not function properly. This may result in the appliance overheating and catching fire.</p> <p>This product does not comply with the requirements of the Low Voltage Directive.</p>	<p>邊境拒絕進口</p> <p>Import rejected at border</p> <p>產品銷毀</p> <p>Destruction of the product</p>	

2025 年 9 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
38	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand)：不詳 (unknown) 品名(Name)：電磁爐 (Induction cooker) 型號 (Model)：不詳 (unknown)	<p>該產品的插頭未安裝符合要求的保險絲，且該保險絲疑似假冒。如果產品在使用過程中電氣系統發生故障，保險絲可能無法有效防止火災和爆炸。</p> <p>本產品不符合低壓指令的要求。</p> <p>The product's plug is not fitted with a conforming fuse and the fuse is suspected to be counterfeit. If there is a failure within the electrical system whilst the product is in use, the fuse may fail to prevent fire and explosion.</p> <p>This product does not comply with the requirements of the Low Voltage Directive.</p>	邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product	
38	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand)：不詳 (unknown) 品名(Name)：殺蟲燈 (Insect killer) 型號 (Model)：M01000000006507356 B0400000001284951745	<p>該產品缺乏 IP 防護等級 (入口防護代碼)，且不具備防潮保護，儘管建議在戶外使用。因此，水可能會滲入產品，或使用者可能接觸到可觸及的帶電部件並遭受電擊。</p> <p>該產品不符合低壓指令的要求。</p> <p>The product lacks an IP rating (ingress protection code) and is not protected against moisture although it is recommended for outdoor use. Consequently, water could penetrate the product or the user could touch accessible live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive.</p>	邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product	
38	立陶宛 (Lithuania)	品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：LCL-100C/2021	<p>該產品絕緣不足。用戶可能會觸及可接觸帶電部件，從而導致觸電。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598 的要求。</p> <p>The product has inadequate insulation. The user could touch accessible live parts, causing an electric shock.</p> <p>The product does not IP comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	從市場撤回 Withdrawal of the product from the market	

2025 年 9 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
38	立陶宛 (Lithuania)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：電熱板 (Electrical hot plate) 型號 (Model)：JX-1010A</p>	<p>該產品絕緣不足。用戶可能會觸及可接觸帶電部件，從而導致觸電。 該產品不符合低壓指令的要求，也不符合歐洲標準 EN 60335。 The product has inadequate insulation. The user could touch accessible live parts, causing an electric shock. The product does not comply with the requirements of the Low Voltage Directive, nor with the European standard EN 60335.</p>	<p>從市場撤回 Withdrawal of the product from the market</p>	
36	匈牙利(Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：C-3</p>	<p>電纜缺乏電纜應力消除裝置，因此未正確固定。此外，連接插頭和插座的尺寸不正確，且可觸及電線的絕緣不足。用戶可能會接觸可觸及的帶電部件，從而導致觸電。 該產品不符合低壓指令和歐洲標準 EN 60598 的要求。 The cable lacks a cable strain relief and therefore is not properly anchored. Moreover, the dimensions of the connection plug and socket are incorrect and the accessible wires have inadequate insulation.. The user could touch accessible live parts, which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures 從市場撤回 Withdrawal of the product from the market</p>	
36	匈牙利(Hungary)	<p>品牌(Brand)：W/PROOF 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：MD100RGB</p>	<p>電纜固定不當。此外，可觸及電線的絕緣不足。因此，用戶可能接觸可觸及帶電部件並遭受電擊。 該產品不符合低壓指令和歐洲標準 EN 60598 的要求。 The cable is not properly anchored. Additionally, the accessible wires have inadequate insulation. Consequently, the user could touch accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive and the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	

2025 年 9 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
36	匈牙利(Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：不詳 (unknown)</p>	<p>該產品的電纜固定不當，且可觸及電線的絕緣不足。此外，儘管建議在戶外使用，但該產品未配備防潮保護。因此，水可能會滲入產品，或使用者可能接觸可觸及帶電部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598 的要求。</p> <p>The cable of the product is not properly anchored and the accessible wires have inadequate insulation. Additionally, the product is not protected against moisture although it is recommended for outdoor use. Consequently, water could penetrate the product or the user could touch accessible live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	
36	匈牙利(Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：200W</p>	<p>電纜缺乏電纜應力消除裝置，因此無法正確固定。此外，可觸及電線的絕緣不足。儘管建議在戶外使用，但該產品未採用防潮保護措施。因此，水可能會滲入產品，或者使用者可能會接觸到可觸及的帶電部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598 的要求。</p> <p>The cable lacks a cable strain relief and therefore is not properly anchored. Additionally, the accessible wires have inadequate insulation. The product is not protected against moisture although it is recommended for outdoor use. Consequently, the water could penetrate the product or the user could touch accessible live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	



2025 年 9 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
36	匈牙利(Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：200B</p>	<p>電纜缺乏電纜應力消除裝置，因此無法正確固定。此外，可觸及電線的絕緣不足。儘管建議在戶外使用，但該產品未採用防潮保護措施。因此，水可能會滲入產品，或者使用者可能會接觸到可觸及的帶電部件並遭受電擊。 該產品不符合低壓指令和歐洲標準 EN 60598 的要求。 The cable lacks a cable strain relief and therefore is not properly anchored. Additionally, the accessible wires have inadequate insulation. The product is not protected against moisture although it is recommended for outdoor use. Consequently, water could penetrate the product or the user could touch accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	
36	匈牙利(Hungary)	<p>品牌(Brand)：Lampki choinkowe led 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：200ML</p>	<p>電纜缺乏電纜應力消除裝置，因此固定不當。此外，可觸及電線的絕緣不足，且延長線插座的結構允許單極插入插頭。雖然建議戶外使用，但該產品不具備防潮保護。因此，水可能會滲入產品，或者使用者可能會接觸到可觸及的帶電部件，從而導致觸電。 該產品不符合低壓指令和歐洲標準 EN 60598 的要求。 The cable lacks a cable strain relief and therefore is not properly anchored. Moreover, the accessible wires have inadequate insulation and the structure of the cord extension socket allows single-pole insertion of plugs. The product is not protected against moisture although it is recommended for outdoor use. Consequently, water could penetrate the product or the user could touch accessible live parts, which may cause an electric shock. The product doesn't comply with the requirements of the Low Voltage directive nor with the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	

2025 年 9 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
37	匈牙利(Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：DN-73</p>	<p>電纜缺乏電纜應力消除裝置，因此固定不當。此外，連接插頭和插座的尺寸不正確，且可觸及電線的絕緣不足。用戶可能會觸及可觸及帶電部件，從而導致觸電。該產品不具備防潮保護，但建議在戶外使用。因此，水可能會滲入產品，或者使用者可能會觸及可觸及帶電部件，從而導致觸電。該產品不符合低壓指令和歐洲標準 EN 60598 的要求。</p> <p>The cable lacks a cable strain relief and, therefore, is not properly anchored. Moreover, the dimensions of the connection plug and socket are incorrect, and the accessible wires have inadequate insulation. The user could touch accessible live parts, which may cause an electric shock. The product is not protected against moisture, although it is recommended for outdoor use. Consequently, water could penetrate the product, or the user could touch accessible live parts, which may cause an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	
37	匈牙利(Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：LDE-8908, XM-196-R-C-LN</p>	<p>可觸及電線絕緣不足。因此，用戶可能會觸及可觸及帶電部件，從而導致觸電。該產品不符合低壓指令和歐洲標準 EN 60598 的要求。</p> <p>The accessible wires have inadequate insulation. Consequently, the user could touch accessible live parts, which may result in an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	

2025 年 9 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
37	匈牙利(Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：C-2</p>	<p>該產品的可觸及電線絕緣不足。因此，用戶可能接觸可觸及帶電部件並遭受電擊。 該產品不符合低壓指令的要求，也不符合歐洲標準 EN 60598。 The product's accessible wires have inadequate insulation. Consequently, the user could touch accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	
37	匈牙利(Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：CLD144W</p>	<p>電纜固定不當。此外，可觸及電線的絕緣不足，且延長線插座的結構允許單極插入插頭。用戶可能接觸可觸及帶電部件並遭受電擊。 該產品不符合低壓指令和歐洲標準 EN 60598 的要求。The cable is not properly anchored. Additionally, the accessible wires have inadequate insulation and the structure of the cord extension socket allows single-pole insertion of plugs. The user could touch accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	

2025 年 9 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
37	匈牙利(Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：C-27</p>	<p>電纜缺乏電纜應力消除裝置，因此固定不當。此外，可觸及電線的絕緣不足，且延長線插座的結構允許單極插入插頭。雖然建議戶外使用，但該產品不具備防潮保護。因此，水可能會滲入產品，或者使用者可能會接觸到可觸及的帶電部件，從而導致觸電。 該產品不符合低壓指令和歐洲標準 EN 60598 的要求。 The cable lacks a cable strain relief and therefore is not properly anchored. Moreover, the accessible wires have inadequate insulation, and the structure of the cord extension socket allows single-pole insertion of plugs. The product is not protected against moisture although it is recommended for outdoor use. Consequently, the water could penetrate the product, or the user could touch accessible live parts, which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	
38	匈牙利(Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：M160/M120</p>	<p>該產品絕緣不足，電纜固定不當。用戶可能觸及可接觸帶電部件，從而導致觸電。 該產品不符合低壓指令的要求，也不符合歐洲標準 EN 60598。 The product has inadequate insulation, and the cable is not properly anchored. The user could touch accessible live parts, causing an electric shock. The product does not comply with the requirements of the Low Voltage Directive, nor with the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	

2025年9月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
38	匈牙利(Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：M205/M155</p>	<p>該產品絕緣不足。用戶可能會觸及可接觸帶電部件，從而導致觸電。 該產品不符合低壓指令的要求，也不符合歐洲標準 EN 60598。</p> <p>The product has inadequate insulation. The user could touch accessible live parts, causing an electric shock. The product does not comply with the requirements of the Low Voltage Directive, nor with the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	
38	匈牙利(Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：不詳 (unknown)</p>	<p>電纜固定不當，可觸及電線絕緣不足。此外，延長線插座僅允許單極插入插頭。此外，插頭和插座尺寸不符合規格要求，閃光燈的電線未牢固固定，不易拉扯和扭曲。用戶可能接觸可觸及帶電部件並遭受電擊。 該產品不符合低壓指令和歐洲標準 EN 60598 的要求。</p> <p>The cable is not properly anchored, and the accessible wires have inadequate insulation. Additionally, the cord extension socket allows single-pole insertion of plugs. Furthermore, the plug and socket dimensions do not meet the required specifications, and the flashing unit's wires are not well-secured against pulling and twisting. The user could touch accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	

2025年9月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
38	匈牙利(Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：不詳 (unknown)</p>	<p>基本的絕緣電線和熱縮管容易接觸，主電源線以及閃光燈的電線未得到妥善固定，以防止拉扯和扭曲。這些問題可能導致用戶接觸到可接觸的帶電部件，從而引發觸電。此外，電纜缺乏適當的固定（缺少應力消除裝置），插頭尺寸也不符合規格。此外，儘管建議在戶外使用，但該產品並未配備防潮保護措施。因此，水可能會滲入產品並導致觸電。該產品不符合低壓指令和歐洲標準 EN 60598 的要求。</p> <p>The basic insulated wires and heat shrink tubes are accessible, and the mains power cable, as well as the wires from the flashing unit, are not properly secured against pulling and twisting. These issues may expose users to touching accessible live parts, which may cause an electric shock. Moreover, the cable lacks proper anchoring (missing strain relief), and the plug dimensions do not meet specifications. Furthermore, the product is not protected against moisture, despite being recommended for outdoor use. Consequently, the water could penetrate the product and cause an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	
38	匈牙利(Hungary)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：M210/M210</p>	<p>該產品絕緣不足。用戶可能會觸及可接觸帶電部件，從而導致觸電。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598 的要求。</p> <p>The product has inadequate insulation. The user could touch accessible live parts, causing an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	



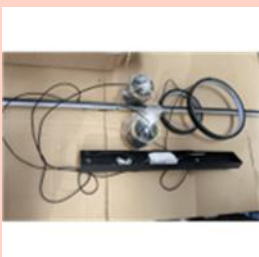
2025年9月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
39	匈牙利(Hungary)	<p>品牌(Brand) : W/PROOF 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : MD100W</p>	<p>電纜固定不當。此外，可觸及電線的絕緣不足。因此，用戶可能接觸可觸及帶電部件並遭受電擊。 該產品不符合低壓指令和歐洲標準 EN 60598 的要求。 The cable is not properly anchored. Additionally, the accessible wires have inadequate insulation. Consequently, the user could touch accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	
39	匈牙利(Hungary)	<p>品牌(Brand) : W/PROOF 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : MD200RGB</p>	<p>電纜固定不當。此外，可觸及電線的絕緣不足。因此，用戶可能接觸可觸及帶電部件並遭受電擊。 該產品不符合低壓指令和歐洲標準 EN 60598 的要求。 The cable is not properly anchored. Additionally, the accessible wires have inadequate insulation. Consequently, the user could touch accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	
39	匈牙利(Hungary)	<p>品牌(Brand) : 不詳 (unknown) 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : YK002-F</p>	<p>燈頭的帶電部件易於觸及。用戶可能觸及可觸及的帶電部件，從而導致觸電。 該產品不符合低壓指令的要求，也不符合歐洲標準 EN 60598 和 EN 60238。 The live parts of the lamp cap are easily accessible. The user could touch the accessible live parts, causing an electric shock. The product does not comply with the requirements of the Low Voltage Directive, nor with the European standard EN 60598 and EN 60238.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	

2025 年 9 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
37	西班牙 (Spain)	<p>品牌(Brand) : Funny Clown 品名(Name) : 鐳射投影儀 (Laser projector) 型號 (Model) : SNW10-6Q</p>	<p>雷射光束功率過高 (測量值高達 7.72 毫瓦)。直視雷射光束可能會損害視力。此外，長時間暴露在雷射光束下可能會導致灼傷。該產品不符合鐳射產品的標籤要求。 該產品不符合《通用產品安全法規》。 The laser beam is too powerful (measured value up to 7.72 mW). Direct viewing of the laser beam could cause damage to sight. Moreover, prolonged exposure to the beam can lead to burns. The product does not comply with the labelling requirements for laser products. The product does not comply with the General Product Safety Regulation.</p>	<p>從市場撤回 Withdrawal of the product from the market</p>	
37	法國 (France)	<p>品牌(Brand) : KLINDO 品名(Name) : 風扇 (Fan) 型號 (Model) : KCSF17-23</p>	<p>在振盪模式下使用本產品可能會導致中央電纜護套隨著時間的推移而磨損並引發火災。 本產品不符合低電壓指令的要求。 Using the product in oscillation mode may cause the sheath of the central cable to wear out over time and cause a fire. The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market</p>	
39	法國 (France)	<p>品牌(Brand) : EURO VANADIUM 品名(Name) : 電焊槍 (Soldering gun) 型號 (Model) : 9545</p>	<p>電路板上，初級電路和次級電路之間的爬電距離不足，絕緣不足。用戶可能會觸電。 該產品不符合低電壓指令的要求。 On the circuit board, the creepage distances between the primary and the secondary circuits is inadequate and insulation is insufficient. The user could receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 從市場撤回 Withdrawal of the product from the market</p>	

2025 年 9 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
36	波蘭(Poland)	品牌(Brand)：Amansour 品名(Name)：吸頂燈 (Ceiling lamp) 型號 (Model)：C0070	<p>該產品的電纜固定不當。電線僅採用基本絕緣層保護，且容易與鋒利的邊緣接觸。如果絕緣層損壞，用戶可能會接觸到可觸及的帶電部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-1 的要求。</p> <p>The cable of the product is not properly anchored. The wires are protected with basic insulation only and are in contact with sharp edges. In case of insulation damage the user could touch accessible live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598-1.</p>	邊境拒絕進口 Import rejected at border	
36	波蘭(Poland)	品牌(Brand)：不詳 (unknown) 品名(Name)：吸頂燈 (Ceiling lamp) 型號 (Model)：HGDec2306006012	<p>電線僅受基本絕緣層保護，並與金屬部件接觸。如果絕緣層損壞，用戶可能會接觸可觸及的帶電部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-1 的要求。</p> <p>The wires are protected with basic insulation only and are in contact with the metal parts. In case of insulation damage the user could touch accessible live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598-1.</p>	邊境拒絕進口 Import rejected at border	
36	波蘭(Poland)	品牌(Brand)：不詳 (unknown) 品名(Name)：吸頂燈 (Ceiling lamp) 型號 (Model)：ZQ-1X-ZQ	<p>電線僅受基本絕緣層保護，並與金屬部件接觸。如果絕緣層損壞，用戶可能會接觸可觸及的帶電部件並遭受電擊。</p> <p>該產品不符合低壓指令和歐洲標準 EN 60598-1 的要求。</p> <p>The wires are protected with basic insulation only and are in contact with the metal parts. In case of insulation damage the user could touch accessible live parts and receive an electric shock.</p> <p>The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598-1.</p>	邊境拒絕進口 Import rejected at border	

2025 年 9 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
36	波蘭(Poland)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：壁燈 (Wall luminaire) 型號 (Model)：S-50-24</p>	<p>電線絕緣不足，與金屬部件接觸。如果絕緣損壞，用戶可能會接觸可觸及的帶電部件並遭受電擊。 該產品不符合低壓指令和歐洲標準 EN 60598-1 的要求。 The wires are insufficiently insulated and are in contact with the metal parts. In case of insulation damage the user could touch accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598-1.</p>	<p>邊境拒絕進口 Import rejected at border</p>	
36	波蘭(Poland)	<p>品牌(Brand)：Kraft&Dele 品名(Name)：逆變焊機 (Inverter welder) 型號 (Model)：KD1872 MIG/MMA-200</p>	<p>電源線和所用插座的橫截面積不足。電線可能過熱並導致絕緣層損壞，從而導致帶電部件觸及。用戶可能接觸帶電部件並遭受電擊。 該產品不符合低壓指令和歐洲標準 EN 60974-1 的要求。 The cross-sectional area of the power supply cable and the socket applied are inadequate. The wire may overheat and cause the insulation to become damaged making live parts accessible. The user could touch the live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60974-1.</p>	<p>從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks</p>	
36	芬蘭(Finland)	<p>品牌(Brand)：Euroshrink 品名(Name)：LED 控制裝置 (LED control gear) 型號 (Model)：TR-IP67/40W</p>	<p>電氣絕緣不足，一次電路與可觸及二次電路之間的電氣間隙不足。用戶可能因可觸及帶電部件而觸電。 該產品不符合低壓指令和歐洲標準 EN 61347 的要求。 The electrical insulation is inadequate and the clearance distance between the primary circuit and the accessible secondary circuits are not sufficient. The user could receive an electric shock from accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 61347.</p>	<p>終端使用者手中召回產品 Recall of the product from end users</p>	




2025年9月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
37	荷蘭 (The Netherlands)	<p>品牌(Brand) : Impression 品名(Name) : 太陽能充電寶 (Solar power bank) 型號 (Model) : 009333-05</p>	<p>移動電源的電池可能會過熱、膨脹甚至爆炸，從而對用戶造成火災和燙傷風險。 該產品不符合《通用產品安全法規》。 The battery of the power bank can overheat, expand and explode, causing risks of fire and burns to users. The product does not comply with the General Product Safety Regulation.</p>	<p>終端使用者手中召回產品 Recall of the product from end users</p>	
36	斯洛維尼亞 (Slovenia)	<p>品牌(Brand) : Hisense 品名(Name) : 滾筒烘乾機 (Tumble dryer) 型號 (Model) : DH5S102BB, DH5S102BB/PL, DH5S102BW, DH5S102BW/PL, DH5S102BW/UA, DH5S902BW</p>	<p>壓縮機線束可能因與支撐鼓輪接觸而損壞。這可能導致過熱和火災。 該產品不符合低壓指令的要求。 The compressor wiring harness may be damaged due to contact with the support drum wheel. This can lead to overheating and fire. The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market</p>	
36	斯洛維尼亞 (Slovenia)	<p>品牌(Brand) : Gorenje 品名(Name) : 滾筒烘乾機 (Tumble dryer) 型號 (Model) : DHNA93, DHNA93/DE, DHNA93/PL, DHNE93/DE</p>	<p>壓縮機線束可能因與支撐鼓輪接觸而損壞。這可能導致過熱和火災。 該產品不符合低壓指令的要求。 The compressor wiring harness may be damaged due to contact with the support drum wheel. This can lead to overheating and fire. The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>暫時禁止供應和展示該產品 Temporary ban on the supply, offer to supply and display of the product 終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market</p>	

2025 年 9 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
36	瑞典 (Sweden)	品牌(Brand) : Benson Outdoor 品名(Name) : 露營燈 (Camping lantern) 型號 (Model) : 014360/Y5110	<p>產品中的焊料鉛含量超標 (測量值高達 61.4% (重量百分比))。塑膠中的短鏈氯化石蠟 (SCCP) 含量超標 (測量值高達 5.9% (重量百分比))。此外, 塑膠中的鄰苯二甲酸二丁酯 (DBP) 和鄰苯二甲酸二 (2-乙基己基) 酯 (DEHP) 含量也超標 (測量值分別高達 0.89%和 1.52% (重量百分比))。鉛對環境構成威脅。SCCP 會在環境中持續存在, 低濃度時對水生生物具有毒性, 並在野生動物和人類體內生物累積, 對人類健康和環境構成威脅。長期通過皮膚接觸這些物質可能致癌。DBP 和 DEHP 對人類健康和環境構成威脅。</p> <p>該產品不符合《限制在電氣和電子設備中使用某些有害物質的指令》(RoHS 2 指令) 的要求, 也不符合《持久性有機污染物》(POP) 法規的要求。</p> <p>The solders in the product have an excessive concentration of lead (measured value up to 61.4% by weight). The plastic has an excessive concentration of short-chain chlorinated paraffins (SCCPs) (measured value up to 5.9 % by weight). The plastic also has an excessive concentration of dibutyl phthalate (DBP) and bis(2-ethylhexyl) phthalate (DEHP) (measured values up to 0.89 and 1.52 % by weight respectively). Lead poses a risk to the environment. SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bio-accumulate in wildlife and humans, posing a risk to human health and the environment. Prolonged exposure to them through the skin may cause cancer. DBP and DEHP pose a risk to human health and the environment.</p> <p>The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive) nor with the Persistent Organic Pollutants (POP) Regulation.</p>	從市場撤回 Withdrawal of the product from the market	

2025 年 9 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
36	瑞典 (Sweden)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：貓玩具 (Cat toy) 型號 (Model)：P02, CWQ-431-Default Title, C04-03-03</p>	<p>焊料中鉛含量超標 (經測量, 含量高達 72.6% (重量百分比))。鉛對環境構成威脅。 該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》(RoHS 2.0) 的要求。 The solders have an excessive concentration of lead (measured value up to 72.6% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>從市場撤回 Withdrawal of the product from the market</p>	
37	瑞典 (Sweden)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：N140M110</p>	<p>電纜固定不當。此外, 產品絕緣不足。此外, 延長線插座的結構允許單極插入插頭。此外, 連接插頭和插座的尺寸不符合規格。因此, 用戶可能會觸及可接觸帶電部件, 從而導致觸電。 該產品不符合低壓指令和歐洲標準 EN 60598 的要求。 The cable is not properly anchored. Moreover, the product has inadequate insulation. Additionally, the structure of the cord extension socket allows single-pole insertion of plugs. Furthermore, the dimensions of the connection plug and socket do not comply with the specifications. Therefore, the user could touch accessible live parts, causing an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures</p>	
37	瑞典 (Sweden)	<p>品牌(Brand)：TERMO 品名(Name)：電風扇 (Electric fan) 型號 (Model)：700059</p>	<p>該產品的 USB 線鉛含量超標 (測得值高達 0.62% (重量百分比))。鉛對環境構成威脅。 該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》(RoHS 2.0) 的要求。 The USB cord of the product has an excessive concentration of lead (measured value up to 0.62 % by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>從市場撤回 Withdrawal of the product from the market</p>	

2025 年 9 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
37	瑞典 (Sweden)	<p>品牌(Brand) : Innovagoods 品名(Name) : LED 燈 (LED lamp) 型號 (Model) : V0103129</p>	<p>線纜塑膠材質中鄰苯二甲酸二(2-乙基己基)酯 (DEHP)、鄰苯二甲酸二丁酯 (DBP) 和短鏈氯化石蠟 (SCCP) 的含量超標 (測量值分別高達 3%、2% 和 1.7% (按重量計))。產品印刷電路板 (PCB) 焊料中鉛的含量超標 (測量值高達 76.4% (按重量計))，遙控器 PCB 焊料中鎘的含量超標 (測量值：0.37% (按重量計))。DEHP 和 DBP 對人類健康和環境構成風險。SCCP 會在環境中持續存在，低濃度時對水生生物有毒，並在野生動物和人類體內生物累積，對人類健康和環境構成風險。鉛對環境構成風險，鎘會生物累積，對環境構成風險。</p> <p>該產品不符合《限制在電氣和電子設備中使用某些有害物質的指令》(RoHS 2 指令) 的要求，也不符合《持久性有機污染物》(POP) 法規的要求。</p> <p>The plastic material of the cable has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP), dibutyl phthalate (DBP) and short-chain chlorinated paraffins (SCCPs) (measured values up to 3%, 2% and 1.7% by weight, respectively). The solders in the product's Printed Circuit Board (PCB) have excessive concentrations of lead (measured value up to 76.4% by weight), while the solder in the remote' PCB have an excessive concentration of cadmium (measured value: 0.37% by weight). DEHP and DBP pose a risk to human health and the environment. SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bio-accumulate in wildlife and humans, posing a risk to human health and the environment. Lead poses a risk to the environment, and cadmium bio-accumulates and poses a risk to the environment.</p> <p>The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive) nor with the Persistent Organic Pollutants (POP) Regulation.</p>	<p>從市場撤回 Withdrawal of the product from the market</p>	

2025 年 9 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
37	瑞典 (Sweden)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：鑰匙扣燈 (Keychain light) 型號 (Model)：ZL2021130577963.9</p>	<p>該產品焊料中的鉛和鎘含量超標（經測量，含量分別高達 80.3%和 0.08%（重量百分比））。鉛和鎘對環境構成威脅。 該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》（RoHS 2.0）的要求。 The solders in the product have an excessive concentration of lead and cadmium (measured values up to 80.3% and 0.08% by weight, respectively). Lead and cadmium pose a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	<p>從市場撤回 Withdrawal of the product from the market</p>	
37	瑞典 (Sweden)	<p>品牌(Brand)：JBL (counterfeit) 品名(Name)：揚聲器 (Speaker) 型號 (Model)：718587941</p>	<p>產品中的焊料鎘含量超標（測量值：0.74%（重量百分比））。電纜塑膠材質中鄰苯二甲酸二（2-乙基己基）酯 (DEHP) 和短鏈氯化石蠟 (SCCP) 的濃度超標（測量值分別高達 2.1% 和 2.5%（重量百分比））。鎘具有生物累積性，對環境構成風險。DEHP 對人類健康和環境構成風險。SCCP 會在環境中持續存在，低濃度時對水生生物具有毒性，並在野生動物和人類體內生物累積，對人類健康和環境構成風險。該產品不符合《限制在電子電氣設備中使用某些有害物質指令》（RoHS 2 指令）和《持久性有機污染物 (POP) 法規》的要求。 The solders in the product have an excessive concentration of cadmium (measured value: 0.74% by weight). The plastic material of the cable has excessive concentrations of bis(2-ethylhexyl) phthalate (DEHP) and short-chain chlorinated paraffins (SCCPs) (measured values up to 2.1% and 2.5% by weight, respectively). Cadmium bio-accumulates and poses a risk to the environment. DEHP poses a risk to human health and the environment. SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bio-accumulate in wildlife and humans, posing a risk to human health and the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive) nor with the Persistent Organic Pollutants (POP) Regulation.</p>	<p>線上市場刪除了該產品清單 Removal of this product listing by the online marketplace</p>	

2025 年 9 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
37	瑞典 (Sweden)	品牌(Brand) : LedSavers 品名(Name) : 露營燈 (Camping lantern) 型號 (Model) : 64657	<p>該產品焊料中的鉛含量超標 (經測量, 含量高達 1.29% (重量百分比))。鉛對環境構成威脅。該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》(RoHS 2.0) 的要求。</p> <p>The solders in the product have an excessive concentration of lead (measured value up to 1.29% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	從市場撤回 Withdrawal of the product from the market	
37	瑞典 (Sweden)	品牌(Brand) : 不詳 (unknown) 品名(Name) : 空氣淨化器 (Air humidifier) 型號 (Model) : p502-z416jiashiqi-blue	<p>該產品焊料中的鉛含量超標 (經測量, 含量高達 64.3% (重量百分比))。鉛對環境構成威脅。該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》(RoHS 2.0) 的要求。</p> <p>The solders in the product have an excessive concentration of lead (measured value up to 64.3% by weight). Lead poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	從市場撤回 Withdrawal of the product from the market	
37	瑞典 (Sweden)	品牌(Brand) : 不詳 (unknown) 品名(Name) : 無線滑鼠 (Wireless Mouse) 型號 (Model) : SMRGBCD001	<p>電纜塑膠材質中鄰苯二甲酸二(2-乙基己基)酯 (DEHP) 濃度超標 (測量值高達 2% 重量百分比)。此外, 產品焊料中鉛和鎘的濃度也超標 (測量值分別高達 62.3% 和 0.06% 重量百分比)。DEHP 對人體健康和環境構成風險。鉛對環境構成風險, 鎘具有生物累積性, 對環境構成風險。該產品不符合《關於限制在電子電氣設備中使用某些有害物質的指令》(RoHS 2.0 指令) 的要求。</p> <p>The plastic material of the cable has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) (measured value up to 2% by weight). Moreover, the solders in the product have excessive concentrations of lead and cadmium (measured values up to 62.3% and 0.06% by weight, respectively). DEHP poses a risk to human health and the environment. Lead poses a risk to the environment, and cadmium bio-accumulates and poses a risk to the environment. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive).</p>	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace	

2025 年 9 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
37	瑞典 (Sweden)	<p>品牌(Brand) : Beats by Dr. Dre (counterfeit) 品名(Name) : 無線耳機 (Wireless headphones) 型號 (Model) : 不詳 (unknown)</p>	<p>產品中的焊料鉛和鎘含量超標 (測量值分別高達 78.4%和 0.25% (按重量計))。USB 數據線的塑膠材質中鄰苯二甲酸二 (2-乙基己基) 酯 (DEHP)、鄰苯二甲酸二丁酯 (DBP) 和短鏈氯化石蠟 (SCCP) 含量超標 (測量值分別高達 2.1%、2.4%和 2.3% (按重量計))。鉛對環境構成風險。鎘具有生物累積性，對環境構成風險。DEHP 和 DBP 對人類健康和環境構成風險。SCCP 在環境中持久存在，低濃度時對水生生物有毒，並會在野生動物和人類體內生物累積，對人類健康和環境構成風險。</p> <p>該產品不符合《限制在電氣和電子設備中使用某些有害物質的指令》 (RoHS 2 指令) 的要求，也不符合《持久性有機污染物》 (POP) 法規的要求。</p> <p>The solders in the product have excessive concentrations of lead and cadmium (measured values up to 78.4% and 0.25% by weight, respectively). The plastic material of the USB cable has excessive concentrations of bis(2-ethylhexyl) phthalate (DEHP), dibutyl phthalate (DBP) and short-chain chlorinated paraffins (SCCPs) (measured values up to 2.1%, 2.4% and 2.3% by weight, respectively). Lead poses a risk to the environment. Cadmium bio-accumulates and poses a risk to the environment. DEHP and DBP pose a risk to human health and the environment. SCCPs persist in the environment, are toxic to aquatic organisms at low concentrations and bio-accumulate in wildlife and humans, posing a risk to human health and the environment.</p> <p>The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS 2 Directive) nor with the Persistent Organic Pollutants (POP) Regulation.</p>	<p>從市場撤回 Withdrawal of the product from the market</p>	

2025 年 9 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
36	德國(Germany)	<p>品牌(Brand)：HONGYEE 品名(Name)：USB 充電器 (USB charger) 型號 (Model)：Yili-PD0004</p>	<p>電氣絕緣不足，可能發生短路，導致用戶觸電。此外，該產品的塑膠外殼不具備自熄性，短路可能導致火災。 該產品不符合低壓指令和歐洲標準 EN 60950-1 的要求。 The electrical insulation is not sufficient and a short circuit can occur, causing the user to receive an electric shock. Moreover, the plastic case of the product is not self-extinguishing and a short circuit can lead to a fire. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60950-1.</p>	<p>從市場撤回 Withdrawal of the product from the market</p>	
37	德國 (Germany)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：鍋蓋 (Mixing-bowl lid) 型號 (Model)：不詳 (unknown)</p>	<p>由於產品設計原因，整只手可以伸入攪拌碗並接觸旋轉的刀片。因此，用戶可能會割傷手指或手部。 該產品不符合《通用產品安全法規》和歐洲標準 EN 60335-2-14。 Due to the design of the product, a whole hand can reach into the mixing bowl and touch the rotating blade. Therefore, the user can suffer cuts in the fingers or in the hand. The product does not comply with the General Product Safety Regulation nor with the European standard EN 60335-2-14.</p>	<p>線上市場刪除了該產品清單 Removal of this product listing by the online marketplace</p>	
37	德國 (Germany)	<p>品牌(Brand)：unbekannt 品名(Name)：鍋蓋 (Mixing-bowl lid) 型號 (Model)：不詳 (unknown)</p>	<p>由於產品設計原因，整只手可以伸入攪拌碗並接觸旋轉的刀片。因此，用戶可能會割傷手指或手部。 該產品不符合《通用產品安全法規》和歐洲標準 EN 60335-2-14。 Due to the design of the product, a whole hand can reach into the mixing bowl and touch the rotating blade. Therefore, the user can suffer cuts in the fingers or in the hand. The product does not comply with the General Product Safety Regulation nor with the European standard EN 60335-2-14.</p>	<p>線上市場刪除了該產品清單 Removal of this product listing by the online marketplace</p>	

2025 年 9 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
37	德國 (Germany)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：電動可麗餅機 (Electric crepe maker) 型號 (Model)：AN-279A</p>	<p>該產品的開關很容易脫落，導致帶電部件觸及。因此，用戶可能會觸電。 該產品不符合低電壓指令的要求。 The product's on-off switch can easily detach, making live parts accessible. As a consequence, the user could receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>邊境拒絕進口 Import rejected at border</p>	
37	德國 (Germany)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：鍋蓋 (Mixing-bowl lid) 型號 (Model)：不詳 (unknown)</p>	<p>由於產品設計原因，整只手可以伸入攪拌碗並接觸旋轉的刀片。因此，用戶可能會割傷手指或手部。 該產品不符合《通用產品安全法規》和歐洲標準 EN 60335-2-14。 Due to the design of the product, a whole hand can reach into the mixing bowl and touch the rotating blade. Therefore, the user can suffer cuts in the fingers or in the hand. The product does not comply with the General Product Safety Regulation nor with the European standard EN 60335-2-14.</p>	<p>線上市場刪除了該產品清單 Removal of this product listing by the online marketplace</p>	
38	德國 (Germany)	<p>品牌(Brand)：Meilepai / facaio 品名(Name)：電源延長線 (Extension lead) 型號 (Model)：F06</p>	<p>該產品的電源線缺少接地系統。因此，連接到該產品的 1 級防護設備 (Schuko 插頭) 未連接到電氣設備的保護接地。如果連接的設備出現故障，可能會導致使用者觸電。 該產品不符合低壓指令和歐洲標準 EN 62368-1 的要求。 The product's power supply cable is missing an earthing system. Protection class 1 devices (Schuko plugs) connected to the product are therefore not connected to the protective earthing of the electrical installation. If the connected device has a fault, this can lead to the user receiving an electric shock from accessible live parts. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 62368-1.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks</p>	

2025 年 9 月 電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
38	德國 (Germany)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：電源延長線 (Extension lead) 型號 (Model)：CX-U613-B</p>	<p>電源線缺乏完善的接地系統。因此，連接到產品的 1 級防護設備 (Schuko 插頭) 未連接到電氣設備的保護接地。如果連接的設備出現故障，可觸及的導電部件 (例如金屬外殼) 可能帶電。用戶可能會因此觸電。 該產品不符合低壓指令的要求。 The power supply cable has no adequate earthing system. Protection class 1 devices (Schuko plugs) connected to the product are therefore not connected to the protective earthing of the electrical installation. If the connected device has a fault, accessible conductive parts (e.g. metal housing) may be live. The user could therefore receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive.</p>	<p>終端使用者手中召回產品 Recall of the product from end users 從市場撤回 Withdrawal of the product from the market</p>	

2025 年 9 月 電子電氣產品召回案例 (北美地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
37	美國 (America)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：美護冰箱 (Beauty Fridges) 型號 (Model)：PH11887，PH11887-1，PZB02-E001，PH12540，PZP01-E001，PZW01-E001</p>	<p>召回的迷你冰箱的電氣開關可能短路，導致其過熱，造成火災和燒傷危險。 The recalled mini fridge's electrical switch can short circuit, causing it to overheat, posing a fire and burn hazard.</p>	<p>退款 Refund</p>	
38	美國 (America)	<p>品牌(Brand)：不詳 (unknown) 品名(Name)：可攜式噴霧風扇 (Portable Misting Fans) 型號 (Model)：不詳 (unknown)</p>	<p>噴霧風扇在充電時可能會過熱並起火，造成火災隱患。 The misting fan can overheat while charging and ignite, posing a fire hazard.</p>	<p>退款 Refund</p>	
38	美國 (America)	<p>品牌(Brand)：Ambiano 品名(Name)：棉花糖製造機 (Cotton Candy Makers) 型號 (Model)：836098</p>	<p>如果消費者使用該產品時沒有使用附帶的糖容器，加熱元件可能會導致糖燃燒，從而造成火災隱患。 The heating element can cause sugar to ignite, if a consumer uses the product without the included sugar receptacle, posing a fire hazard.</p>	<p>退款 Refund</p>	

2025 年 9 月 電子電氣產品召回案例 (北美地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
38	美國 (America)	<p>品牌(Brand) : Arizer Solo 品名(Name) : 可攜式電子蒸發器設備 (portable electronic vaporizer devices) 型號 (Model) : M2</p>	<p>內部鋰離子電池可能會過熱、產生煙霧和/或彈出物質，造成火災和燒傷危險。 The internal lithium-ion battery can overheat, produce smoke, and/or eject material, posing fire and burn hazards.</p>	<p>替換 Replace</p>	
38	美國 (America)	<p>品牌(Brand) : Anker 品名(Name) : 充電寶 (Power Banks) 型號 (Model) : A1647, A1652, A1257, A1681 and A1689</p>	<p>移動電源中的鋰離子電池可能會過熱，對消費者造成火災和燒傷危險。 The lithium-ion battery in the power bank can overheat, posing fire and burn hazards to consumers.</p>	<p>退款 Refund</p>	
38	美國 (America)	<p>品牌(Brand) : Oster 品名(Name) : 臺式烤箱 (Door Countertop Ovens) 型號 (Model) : TSSTTVFDXL, TSSTTVFDDG, TSSTTVDMAF and TSSTTVFDDAF</p>	<p>烤箱門可能會意外關閉，對消費者造成燙傷危險。 The oven's doors can unexpectedly close, posing a burn hazard to consumers.</p>	<p>修理 Repair</p>	

2025 年 9 月 電子電氣產品召回案例 (亞太地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
36	澳大利亞 (Australia)	品牌(Brand)：不詳 (unknown) 品名(Name)：電源供電器 (power supply units) 型號 (Model)：120500	這些產品的插針上沒有絕緣層，不符合澳大利亞電氣安全標準。 These products have no insulation on the pins and do not comply with required Australian electrical safety standards.	立即停止使用受影響的電源設備並斷開電源。請聯繫您當地的 Bitek 分公司，安排符合澳大利亞電氣安全標準的替換設備。 Stop using affected power supply units immediately and disconnect from power source. Contact your local Bitek branch to arrange a replacement unit that complies with Australian electrical safety standards.	
36	澳大利亞 (Australia)	品牌(Brand)：不詳 (unknown) 品名(Name)：USB 充電線 (USB charging cable) 型號 (Model)：不詳 (unknown)	黑色 USB 電纜可能會過熱並著火。The black USB cable can overheat and catch on fire.	立即停止使用黑色 USB 充電線，並將其從藍牙音箱上拔下。 將黑色 USB 充電線剪成兩半，並根據當地法規進行處理。請勿將其與藍牙音箱或任何其他設備一起使用。請在以下網站填寫表格，確認您已剪斷並處理黑色 USB 充電線： https://afl-forms.formstack.com/forms/superkick_speaker_recall 。 請等待白色 USB 充電線更換完畢後再為音箱充電。 Immediately stop using the black USB charging cable and unplug it from the Bluetooth speaker. Cut the black USB charging cable in half and dispose of it in accordance with local regulations. Do not use it with the Bluetooth speaker or any other device. Complete the form to confirm you have cut and disposed of the black USB charging cable on the following website: https://afl-forms.formstack.com/forms/superkick_speaker_recall . Wait for the replacement white USB cable before charging your speaker.	