

2026 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
10	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : Jinhua Jiebo Electronics Co. Ltd 品名(Name) : 耳機 (Headset) 型號 (Model) : AP092	隨附的 USB 資料線無法承受標準 USB 電源的輸出。這意味著在為產品充電時，資料線可能會熔化，並導致用戶燙傷。 本產品不符合無線電設備指令 (RED) 的要求。 The supplied USB cable cannot handle outputs from standard USB power sources. This means it may melt when it is used to charge the product, and cause burn injuries to the user. The product does not comply with the requirements of the Radio Equipment Directive (RED).	終端使用者手中召回產品 Recall of the product from end users	
10	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : 不詳 (unknown) 品名(Name) : LED 燈 (LED lamp) 型號 (Model) : 不詳 (unknown)	連接插頭和插座的尺寸不符合規格。此外，內部電路之間的爬電距離和間隙不足。如果電流超載或產品出現故障，插頭可能過熱和/或爆炸，從而引發火災風險。 該產品不符合低電壓指令的要求。 The dimensions of the connection plug and socket do not comply with the specifications. Moreover, there is insufficient creepage and clearance distances between internal circuits. If there is a surge in the current or fault with the product, the plug may overheat and/or explode, leading to a risk of fire. The product does not comply with the requirements of the Low Voltage Directive.	邊境拒絕進口 Import rejected at border	
10	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand) : Southern Arbor 品名(Name) : 電熱水袋 (Electric hot water bottle) 型號 (Model) : QM-01	該產品存在嚴重的火災隱患，因為缺乏熱保護措施，可能導致過熱。此外，如果產品在插電充電時內部沒有水，則可能自燃，從而引發火災。 該產品不符合低電壓指令的要求。 The product presents a serious risk of fire because there is a lack of thermal protection, which could lead to overheating. Additionally, in case there is no water in it when it is plugged in and charging, it may ignite, leading to a risk of fire. The product does not comply with the requirements of the Low Voltage Directive	終端使用者手中召回產品 Recall of the product from end users	

2026 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
10	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand)：不詳 (unknown) 品名(Name)：旅行適配器 (Travel adaptor) 型號 (Model)：不詳 (unknown)	該插頭尺寸不符合要求。此外，該插頭未配備合格的保險絲。因此，該插頭可能過熱和/或爆炸，存在火災風險。 該產品不符合低電壓指令的要求。 The plug does not meet the dimensional requirements. Moreover the plug is not manufactured with a conforming fuse. As a result, the plug may overheat and/or explode. There is a risk of fire. The product does not comply with the requirements of the Low Voltage Directive.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 邊境拒絕進口 Import rejected at border	
10	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand)：不詳 (unknown) 品名(Name)：吹風機 (Hairdryer) 型號 (Model)：YM42	插頭保險絲填充物顆粒不足，且插頭端面尺寸不符合要求。因此，插頭可能過熱和/或爆炸，存在火災風險。 該產品不符合低電壓指令和歐洲標準 EN 60335 的要求。 The plug fuse has insufficient granular filler, and the plug face does not meet the dimensional requirements. As a result, the plug may overheat and/or explode. There is a risk of fire. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335.	邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product	
10	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand)：GBP-FLO 品名(Name)：迴圈泵 (Circulating pump) 型號 (Model)：不詳 (unknown)	電源線可能接反，導致火線引腳與地線引腳接觸，使帶電部件暴露在外。用戶接觸這些帶電部件可能會觸電。 該產品不符合低電壓指令的要求。 The mains cable can be connected to the pump in reverse, allowing the live pin to connect to the earth pin causing live parts to become accessible. The user could touch these accessible live parts and receive an electric shock. The product does not meet the requirements of the Low Voltage Directive.	不詳 (unknown)	
11	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand)：不詳 (unknown) 品名(Name)：暖風機 (Fan heater) 型號 (Model)：X9	插頭保險絲填充物顆粒不足，且插頭端面尺寸不符合要求。因此，插頭可能過熱和/或爆炸，存在火災風險。 該產品不符合低電壓指令的要求。 The plug fuse has insufficient granular filler, and the plug face does not meet the dimensional requirements. As a result, the plug may overheat and/or explode. There is a risk of fire. The product does not comply with the requirements of the Low Voltage Directive.	邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product	

2026 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
11	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand): 不詳 (unknown) 品名(Name): DVD 播放機 (DVD player) 型號 (Model) : HD229	該插頭沒有保險絲，且插頭表面尺寸不符合要求。為確保插頭在故障情況下安全運行，必須使用額定電流合適的保險絲；否則，插頭可能過熱甚至爆炸，引發火災。 該產品不符合低電壓指令的要求。 The plug has no fuse, and the plug face does not meet the dimensional requirements. A correctly rated fuse is required to ensure the safe operation of the plug under fault conditions, and its absence could lead to the plug overheating and/or exploding, leading to fire. The product does not comply with the requirements of the Low Voltage Directive.	邊境拒絕進口 Import rejected at border	
12	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand): 不詳 (unknown) 品名(Name): 吸頂燈 (Ceiling lamp) 型號 (Model) : CT:6000K	該產品絕緣、爬電距離和安全距離不足。發生電氣故障時，使用者可能觸電。 該產品不符合低電壓指令的要求。 The product has insufficient insulation, creepage and clearance distances. In the event of an electrical fault, the user could receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 邊境拒絕進口 Import rejected at border	
12	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand): 不詳 (unknown) 品名(Name): 吸頂燈 (Ceiling lamp) 型號 (Model) : CCT:6000-6500K	該產品絕緣、爬電距離和安全距離不足。發生電氣故障時，使用者可能觸電。 該產品不符合低電壓指令的要求。 The product has insufficient insulation, creepage and clearance distances. In the event of an electrical fault, the user could receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product	
12	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand): 不詳 (unknown) 品名(Name): 制冰機 (Ice Crusher) 型號 (Model) : KE-2268	由於產品設計缺陷，使用者可以伸手觸摸到產品內部的運動刀片，從而可能導致手指或手部割傷。 該產品不符合低電壓指令的要求。 Due to the design of the product, the user can reach into the product and touch the moving blade. Therefore, the user can suffer cuts in the fingers or in the hand. The product does not comply with the requirements of the Low Voltage Directive.	邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product	

2026 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
12	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand)：不詳 (unknown) 品名(Name)：攪拌機 (Blender) 型號 (Model)：不詳 (unknown)	即使處理器打開，刀片可能仍在旋轉且觸手可及。消費者可能在打開蓋子的情況下將食物放入處理器，從而造成手部受傷。此外，該產品還配備了重量不足的保險絲，可能導致插頭過熱和/或爆炸。產品文檔和標識也需要改進。 本產品不符合低電壓指令的要求。 The blades may still be spinning and accessible when the processor is open. The consumer may be able to place food into the processor while the lid is removed and injure their hands. Moreover, the product is also fitted with a underweight fuse that could lead to the plug overheating and/or exploding. Improvements are also required to product documentation and marking. This product does not comply with the requirements of the Low Voltage Directive.	邊境拒絕進口 Import rejected at border	
13	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand)：不詳 (unknown) 品名(Name)：取暖器 (Air Heater) 型號 (Model)：CRY-786	插頭的插腳距離外緣過近且過短。如果電流過大，插頭可能會起火。 該產品不符合低電壓指令的要求。 The plug's pins are too close to the periphery and too short. If there is a surge in current, the plug could catch fire. The product does not comply with the requirements of the Low Voltage Directive.	邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product	
13	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand)：不詳 (unknown) 品名(Name)：折疊洗衣機 (Folding washing machine) 型號 (Model)：01 (Box only) AC/DC Adaptor - SM-1220	插頭插腳尺寸不符合要求，無法與插座牢固連接。長期如此，會損壞插座和插頭，並可能導致產品過熱起火。 該產品不符合低電壓指令的要求。 The plug pins do not meet the dimensional requirements and cannot make a secure connection to the plug socket. Over time, this will damage the socket and plug, which may cause the product to overheat and catch fire. The product does not comply with the requirements of the Low Voltage Directive.	邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product	

2026 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
13	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand): 不詳 (unknown) 品名(Name): 縫紉機 (Sewing machine) 型號 (Model): SM-505A	插頭插腳不符合尺寸要求。因此，插頭可能無法牢固地插入插座，長期使用會導致損壞，並可能引發過熱和火災。 本產品不符合低電壓指令的要求。 The plug pins do not meet the dimensional requirements. As a result, the plug may not fit securely into a socket, causing damage over time and leading to overheating and fire. This product does not comply with the requirements of the Low Voltage Directive.	邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product	
13	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand): 不詳 (unknown) 品名(Name): 電動牙刷充電器 (Electric toothbrush charger) 型號 (Model): WY-HX6100	該產品的插頭尺寸不符合要求。此外，熔斷絲的額定值低於最小允許公差。必須使用額定值合適的熔斷絲才能確保插頭在故障情況下安全運行，否則可能導致插頭過熱和/或爆炸。 該產品不符合低電壓指令的要求。 The plug dimensions of the product are inadequate. Moreover, the fuse link is below the minimum permitted tolerance. A correctly rated fuse is required to ensure the safe operation of the plug under fault conditions, and its absence could lead to the plug overheating and/or exploding. The product does not comply with the requirements of the Low Voltage Directive.	邊境拒絕進口 Import rejected at border	
13	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand): Superlex 品名(Name): 電動飯盒 (Electric lunch box) 型號 (Model): KCA0102UK	插頭內的保險絲填充物不足。填充物對於確保保險絲在故障情況下安全工作至關重要，填充物缺失可能導致插頭過熱和/或爆炸。 該產品不符合低電壓指令的要求。 The fuse within the plug has insufficient granular filler. The filler is required to ensure the safe operation of the fuse under fault conditions, and its absence could lead to the plug overheating and/or exploding. The product does not comply with the requirements of the Low Voltage Directive	邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product	
13	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand): 不詳 (unknown) 品名(Name): 電源適配器 (Power adaptor) 型號 (Model): 不詳 (unknown)	該產品的插頭端面尺寸不符合要求，且保險絲內的填充物不足。如果產品出現故障或電流超載，產品可能過熱並引發火災。 該產品不符合低電壓指令的要求。 The plug face of the product does not meet the dimensional requirements and there is not enough filler in the fuse. If there is a fault with the product or a surge in current, the product could overheat and catch fire. The product does not meet the requirements of the Low Voltage Directive.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 邊境拒絕進口 Import rejected at border	

2026 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
13	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand): 不詳 (unknown) 品名(Name): 縫紉機 (Sewing machine) 型號 (Model) : SM-202A	插頭插腳不符合尺寸要求。因此，插頭可能無法牢固地插入插座，長期使用會導致損壞，並可能引發過熱和火災。 本產品不符合低電壓指令的要求。 The plug pins do not meet the dimensional requirements. As a result, the plug may not fit securely into a socket, causing damage over time and leading to overheating and fire. This product does not comply with the requirements of the Low Voltage Directive.	邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product	
13	北愛爾蘭 (United Kingdom in respect of Northern Ireland)	品牌(Brand): EIDISUNY 品名(Name): 牆燈 (Wall lamp) 型號 (Model) : BN1061-2	如果安裝此燈具，其絕緣層可能會隨著時間推移而損壞。這可能導致電流驟升，使產品帶電，從而造成觸電危險。 該產品不符合低電壓指令的要求。 The insulation may break down over time, if the light fitting is installed. This may cause a surge in current and the product to become live, leading to electric shock. The product does not comply with the requirements of the Low Voltage Directive.	邊境拒絕進口 Import rejected at border 產品銷毀 Destruction of the product 線上市場刪除了該產品清單 Removal of this product listing by the online marketplace	
12	立陶宛 (Lithuania)	品牌(Brand): 不詳 (unknown) 品名(Name): 燈鏈 (Lighting chains) 型號 (Model) : 不詳 (unknown)	該產品絕緣性能不足。因此，用戶可能接觸到裸露的帶電部件，從而導致觸電。 該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。 The product has inadequate insulation. Therefore, the user could touch accessible live parts, which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.	從市場撤回 Withdrawal of the product from the market	
12	立陶宛 (Lithuania)	品牌(Brand): 不詳 (unknown) 品名(Name): 燈鏈 (Lighting chains) 型號 (Model) : CL0405	該產品絕緣性能不足。因此，用戶可能接觸到裸露的帶電部件，從而導致觸電。 該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。 The product has inadequate insulation. Therefore, the user could touch accessible live parts, which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.	從市場撤回 Withdrawal of the product from the market	

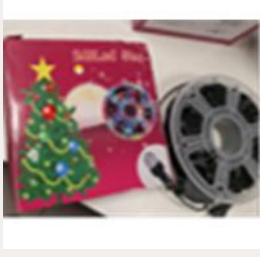
2026 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
12	立陶宛 (Lithuania)	品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chains) 型號 (Model)：CL0129	該產品絕緣性能不足。因此，用戶可能接觸到裸露的帶電部件，從而導致觸電。 該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。 The product has inadequate insulation. Therefore, the user could touch accessible live parts, which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.	從市場撤回 Withdrawal of the product from the market	
11	匈牙利 (Hungary)	品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：XM-180-R-I-LN	電纜未正確固定，且裸露的電線絕緣不足。此外，插頭尺寸不符合規格要求。因此，用戶可能接觸到裸露的帶電部件，從而導致觸電風險。 該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。 The cable is not properly anchored, and the accessible wires have inadequate insulation. Additionally, the plug dimensions do not meet the required specifications. Consequently, the user could touch accessible live parts, leading to a risk of electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.	從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users 禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	
11	匈牙利 (Hungary)	品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：100LED	電纜未正確固定。此外，該產品絕緣性能不足。另外，延長線插座的結構設計允許單極插頭插入。因此，用戶可能接觸到裸露的帶電部件，從而導致觸電。 該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。 The cable is not properly anchored. Moreover, the product has inadequate insulation. Additionally, the structure of the cord extension socket allows single-pole insertion of plugs. Therefore, the user could touch accessible live parts, which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures 從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users	

2026 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
11	匈牙利 (Hungary)	品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：XM-180-C-L-LO	電纜未正確固定。此外，裸露的電線絕緣不足。而且，該產品未採取防潮措施，卻推薦用於戶外。因此，水可能滲入產品內部，或者使用者可能接觸到裸露的帶電部件，從而導致觸電。該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。 The cable is not properly anchored. Moreover, the accessible wires have inadequate insulation. Additionally, the product is not protected against moisture but is recommended for outdoor use. Therefore, the water could penetrate the product or the user could touch accessible live parts, which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures 從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users	
11	匈牙利 (Hungary)	品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：不詳 (unknown)	電纜未正確固定，且裸露的電線絕緣不足。用戶可能接觸到裸露的帶電部件，從而導致觸電。此外，儘管該產品推薦用於戶外，但並未採取防潮措施。因此，水可能滲入產品內部，導致觸電。該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。 The cable is not properly anchored and the accessible wires have inadequate insulation. The user could touch accessible live parts, which may cause an electric shock. Furthermore, the product is not protected against moisture, despite being recommended for outdoor use. Consequently, water could penetrate the product and cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures 從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users	
11	匈牙利 (Hungary)	品牌(Brand)：BPS Buena Pet Shop 品名(Name)：水族燈 (Aquarium lamp) 型號 (Model)：LUCE COLORATO QL-T4KG-20LED BPS-6106	電源外殼的機械強度不足。此外，該產品不具備防潮功能。用戶可能接觸到裸露的帶電部件，從而導致觸電。該產品不符合低電壓指令和歐洲標準 EN 606598 的要求。 The mechanical strength of the power supply housing is inadequate. Moreover, the product is not protected against moisture. The user could touch accessible live parts, which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 606598.	從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users	

2026 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
11	匈牙利 (Hungary)	品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：L2X1.5 (2M x 1.5M / LED)	電纜未正確固定，裸露的電線絕緣不足。此外，插頭尺寸不符合規格要求。而且，儘管產品推薦用於戶外，但並未採取防潮措施。因此，用戶可能接觸到裸露的帶電部件，或者水可能滲入產品內部導致觸電。 該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。 The cable is not properly anchored, and the accessible wires have inadequate insulation. Additionally, the plug dimensions do not meet the required specifications. Furthermore, the product is not protected against moisture, despite being recommended for outdoor use. Consequently, the user could touch accessible live parts or the water could penetrate the product and cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures 從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users	
12	匈牙利 (Hungary)	品牌(Brand)：不詳 (unknown) 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：MS-30SMD	電纜未正確固定，且產品絕緣不足。用戶可能接觸到裸露的帶電部件，從而導致觸電。 該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。 The cable is not properly anchored, and the product lacks adequate insulation. The user could touch accessible live parts, which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures 從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users	
12	匈牙利 (Hungary)	品牌(Brand)：Merry Christmas 品名(Name)：燈鏈 (Lighting chain) 型號 (Model)：不詳 (unknown)	電纜未正確固定，且產品絕緣不足。用戶可能接觸到裸露的帶電部件，從而導致觸電。 該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。 The cable is not properly anchored, and the product lacks adequate insulation. The user could touch accessible live parts, which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures 從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users	

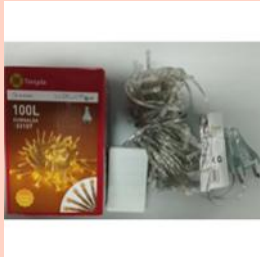
2026 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
12	匈牙利 (Hungary)	品牌(Brand) : X3 Aquarium light 品名(Name) : 水族燈 (Aquarium lamp) 型號 (Model) : X3-A 5W	該產品不具備防潮功能。用戶可能接觸到裸露的帶電部件，從而導致觸電。 該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。 The product is not protected against moisture. The user could touch accessible live parts, which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.	從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users	
12	匈牙利 (Hungary)	品牌(Brand) : Merry Christmas 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : Cold White, 50M-9A	電纜未正確固定，且裸露的電線絕緣不足。因此，用戶可能接觸到裸露的帶電部件，從而導致觸電風險。 該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。 The cable is not properly anchored, and the accessible wires have inadequate insulation. Consequently, the user could touch accessible live parts, leading to a risk of electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures 從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users	
12	匈牙利 (Hungary)	品牌(Brand) : Zhe Jiang Gorgeous Lighting Factory 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : 41 XL-35 LED	電纜未正確固定，裸露的電線絕緣不足。此外，插頭尺寸不符合規格要求。因此，用戶可能接觸到裸露的帶電部件，從而導致觸電。 該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。 The cable is not properly anchored, and the accessible wires have inadequate insulation. Additionally, the plug dimensions do not meet the required specifications. Consequently, the user could touch accessible live parts, which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures 從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users	

2026 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
12	匈牙利 (Hungary)	品牌(Brand) : BPS Buena Pet Shop 品名(Name) : 狗項圈 (Dog collar) 型號 (Model) : BPS-5552	該電池管理系統缺少電芯溫度監控裝置。產品可能過熱，導致灼傷或起火。 該產品不符合通用產品安全法規 (GDPR) 和歐洲標準 EN 62133-2。 The battery management system lacks a cell temperature monitoring device. The product can overheat and cause burns or a fire. The product does not comply with the General Product Safety Regulation, nor with the European standard EN 62133-2.	終端使用者手中召回產品 Recall of the product from end users	
12	匈牙利 (Hungary)	品牌(Brand) : roxin 品名(Name) : 水族燈 (Aquarium lamp) 型號 (Model) : GX-K200	電源外殼的機械強度不足。此外，該產品不具備防潮功能。用戶可能接觸到裸露的帶電部件，從而導致觸電。 該產品不符合低電壓指令和歐洲標準 EN 606598 的要求。The mechanical strength of the power supply housing is inadequate. Moreover, the product is not protected against moisture. The user could touch accessible live parts, which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 606598.	從市場撤回 Withdrawal of the product from the market	
13	匈牙利 (Hungary)	品牌(Brand) : Deebow 品名(Name) : 水族燈 (Aquarium lamp) 型號 (Model) : Dee-40A	電源外殼的機械強度不足。此外，該產品不具備防潮功能。用戶可能接觸到裸露的帶電部件，從而導致觸電。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 606598-1 和 EN 60598-2。 The mechanical strength of the power supply housing is inadequate. Moreover, the product is not protected against moisture. The user could touch accessible live parts, which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 606598-1 and EN 60598-2.	從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users	
13	匈牙利 (Hungary)	品牌(Brand) : Codos 品名(Name) : 寵物美容剪 (Grooming clipper) 型號 (Model) : CP-9600 TS-A005-050010EY	該電池管理系統缺少電芯溫度監控裝置。產品可能過熱，導致灼傷或起火。 該產品不符合通用產品安全法規 (GDPR) 和歐洲標準 EN 62133-2。 The battery management system lacks a cell temperature monitoring device. The product can overheat and cause burns or a fire. The product does not comply with the General Product Safety Regulation nor with the European standard EN 62133-2.	從市場撤回 Withdrawal of the product from the market	

2026 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
13	匈牙利 (Hungary)	品牌(Brand) : Dasounds 品名(Name) : 無線耳機 (Wireless earphones) 型號 (Model) : 348349 751001	該電池管理系統缺少電芯溫度監控裝置。產品可能過熱並導致燙傷。 該產品不符合通用產品安全法規 (GDPR) 和歐洲標準 EN 62368-1。 The battery management system lacks a cell temperature monitoring device. The product can overheat and cause burns. The product does not comply with the General Product Safety Regulation, nor with the European standard EN 62368-1.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 從市場撤回 Withdrawal of the product from the market	
10	西班牙 (Spain)	品牌(Brand) : 不詳 (unknown) 品名(Name) : 電水壺 (Electric kettle) 型號 (Model) : W68-650 YS-2008	使用過程中，電器內的溫控器可能發生短路，產生危險的火焰和濃煙。用戶可能會嘗試滅火，但如果衣物著火，則可能被燒傷。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1 和 60335-2-15。 During use, the thermostat in the appliance may short-circuit, producing dangerous amounts of flames and smoke. The user may try to extinguish the fire. They may sustain burns if their clothes catch fire. The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60335-1 and 60335-2-15.	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	
12	西班牙 (Spain)	品牌(Brand) : Tengda 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : 33107	該產品的照明控制裝置容易損壞，且由於設計缺陷，無需工具即可輕易打開，導致用戶能夠接觸到帶電部件。此外，由於電纜的耐壓性較差，容易脫落，用戶可能因此觸電。 該產品不符合低電壓指令的要求，也不符合歐洲標準 60598-2-20。 The lighting control device of the product can easily break and, due to incorrect design, it can be easily opened without the use of tools, leaving live parts accessible to the user. Moreover, due to the weak resistance of the cables, they can easily become detached. The user can therefore receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive, nor with the European standard. 60598-2-20.	禁止銷售產品及任何附帶措施 Ban on the marketing of the product and any accompanying measures	

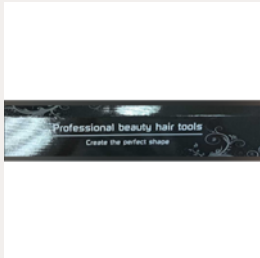
2026 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
10	法國 (France)	品牌(Brand) : *Lepro le* 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : PR4300008-WW-EU	該產品不具備防潮功能。因此，水可能滲入產品內部並造成短路，進而引發火災。 該產品不符合低電壓指令的要求。 The product is not protected against moisture. Consequently, water could penetrate the product and create a short circuit, which could lead to a fire. The product does not comply with the requirements of the Low Voltage Directive.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace	
11	法國 (France)	品牌(Brand) : *LAC LAICHY* 品名(Name) : 吹風機 (Hair dryer) 型號 (Model) : L-1100	設備的進氣口可能接觸到帶電部件（電線和電氣元件），這可能導致觸電。此外，設備的塑膠外殼及其某個配件可能會熔化，從而造成燙傷風險。 該產品不符合低電壓指令的要求。 The live parts (wire and electrical components) can be accessed through the air intake of the appliance, which could lead to an electric shock. Moreover, the plastic casing of the appliance and one of its accessories may melt, which could lead to a risk of burns. The product does not comply with the requirements of the Low Voltage Directive.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 終端使用者手中召回產品 Recall of the product from end users	
11	法國 (France)	品牌(Brand) : *LANGE PZNE* 品名(Name) : 燈鏈 (Lighting chain) 型號 (Model) : CMC-ORG30A QJ6E122026AOG	儘管該產品推薦用於戶外，但它並不具備防潮功能。因此，水可能會滲入產品內部，導致觸電。此外，由於絕緣不足，短路可能引發火災。 該產品不符合低電壓指令的要求。 The product is not protected against moisture, despite being recommended for outdoor use. Consequently, water could penetrate the product and cause an electric shock. Moreover, due to inadequate insulation, a short circuit could cause a risk of fire. The product does not comply with the requirements of the Low Voltage Directive.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace	

2026 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
11	法國 (France)	品牌(Brand) : *SEBRUANC* 品名(Name) : LED 燈投影儀 (LED light projector) 型號 (Model) : G8552-ZQ06007EU	該產品含有未正確接地的裸露金屬部件。因此，用戶可能接觸到裸露的帶電部件而觸電。 該產品不符合低電壓指令的要求。 The product has accessible metal parts which have not been correctly earthed. The user could therefore touch accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 終端使用者手中召回產品 Recall of the product from end users	
12	法國 (France)	品牌(Brand) : *UKLISS* 品名(Name) : 直發器 (Hair straightener) 型號 (Model) : WT-056	電路間的爬電距離和安全距離不足，且產品絕緣性能不佳。用戶可能接觸到帶電部件並遭受電擊。此外，產品手柄可能過熱，導致用戶燙傷。 本產品不符合低電壓指令的要求。 There is insufficient creepage and clearance distance between circuits and the product has insufficient insulation. The user can access live parts and receive an electric shock. Moreover, the handle of the product can overheat and cause burns to the user. This product does not comply with the requirements of the Low Voltage Directive.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 終端使用者手中召回產品 Recall of the product from end users	
12	法國 (France)	品牌(Brand) : 不詳 (unknown) 品名(Name) : 吹風機 (Hair dryer) 型號 (Model) : BL-5286	該產品電氣絕緣性能不足。因此，用戶可能接觸到帶電部件並觸電。 該產品不符合低電壓指令的要求。 The product lacks sufficient electrical insulation. The user could therefore touch accessible live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 終端使用者手中召回產品 Recall of the product from end users	
12	法國 (France)	品牌(Brand) : X3 Aquarium light 品名(Name) : 水族燈 (Aquarium lamp) 型號 (Model) : X3 WHITE	該產品不具備防潮功能。用戶可能接觸到裸露的帶電部件，從而導致觸電。 該產品不符合低電壓指令和歐洲標準 EN 60598 的要求。 The product is not protected against moisture. The user could touch accessible live parts, which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60598.	從市場撤回 Withdrawal of the product from the market 終端使用者手中召回產品 Recall of the product from end users	

2026 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
12	法國 (France)	品牌(Brand) : *PANCERKA* 品名(Name) : 電鍋 (Electric cooker) 型號 (Model) : BD-113-Z001	該產品的把手可能會過熱，導致用戶燙傷。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-2-15 和 EN 60335-1。 The product's handle can overheat, and cause burns to the user. The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60335-2-15 and EN 60335-1	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 終端使用者手中召回產品 Recall of the product from end users	
12	法國 (France)	品牌(Brand) : 不詳 (unknown) 品名(Name) : 卷髮棒 (Curling wand) 型號 (Model) : KS-C203	卷髮棒手柄在使用過程中可能會過熱，導致燙傷。 該產品不符合低電壓指令的要求。 The handle of the curling wand can overheat during use, causing burns. The product does not comply with the requirements of the Low Voltage Directive.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 終端使用者手中召回產品 Recall of the product from end users	
13	法國 (France)	品牌(Brand) : 不詳 (unknown) 品名(Name) : 食物混合器 (Food mixer) 型號 (Model) : DH133_Z1	固定產品內部導線的焊點可能斷裂，導致帶電部件裸露。用戶可能接觸到帶電部件並遭受電擊。 該產品不符合低電壓指令的要求。 The solder holding the internal wire of the product may break, leaving live parts accessible. The user can access live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 終端使用者手中召回產品 Recall of the product from end users	

2026 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
13	法國 (France)	品牌(Brand)：不詳 (unknown) 品名(Name)：可攜式研磨機 (Portable grinder) 型號 (Model)：SK-1805A	電機使用的潤滑劑（礦物油或潤滑油）可能與盛放食物的容器直接接觸。這意味著，不應攝入的潤滑劑殘留物可能會污染使用此設備製備的任何食物。此外，該設備沒有任何有效的保護措施來防止接地端子意外鬆動。如果發生鬆動，接地系統將無法正常工作。因此，用戶可能會觸電。 本產品不符合低電壓指令的要求。 The lubricant used for the motor (mineral or lubricating oil) may come into direct contact with the container for the food. This means that traces of lubricant, which should not be ingested, could contaminate any food prepared with this appliance. Moreover, the appliance does not have any effective protection against an accidental loosening of the earth terminal. If any loosening occurred, the earthing system would no longer work properly. User could therefore receive an electric shock. This product does not comply with the requirements of the Low Voltage Directive.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 終端使用者手中召回產品 Recall of the product from end users	
13	法國 (France)	品牌(Brand)：Rowenta 品名(Name)：吸塵器 (Vacuum cleaner) 型號 (Model)：X Force Flex 14.60 X Force Flex 15.60	由於電池組中某個元件存在缺陷，產品在使用過程中可能會過熱，導致用戶燙傷或引發火災。 該產品不符合低電壓指令的要求。 Due to a defective component in the battery pack, the product can overheat during use, causing burns to the user or starting a fire. The product does not comply with the requirements of the Low Voltage Directive.	終端使用者手中召回產品 Recall of the product from end users	
13	法國 (France)	品牌(Brand)：不詳 (unknown) 品名(Name)：電水壺 (Electric kettle) 型號 (Model)：ZB-6	接地端子未採取防意外鬆動保護措施，在發生電氣故障時可能導致使用者觸電。 該產品不符合低電壓指令的要求。 The earth terminal is not protected against accidental loosening, which may lead to electric shock to the user in the event of an electrical fault The product does not comply with the requirements of the Low Voltage Directive.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 終端使用者手中召回產品 Recall of the product from end users	

2026 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
13	法國 (France)	品牌(Brand)：不詳 (unknown) 品名(Name)：直發器 (Hair straightener) 型號 (Model)：RD-216	由於設計缺陷，部分內部導線保護或固定不足。此外，電路間的爬電距離和安全距離不足，且產品絕緣性能不佳。用戶可能接觸到帶電部件並遭受電擊。 本產品不符合低電壓指令的要求。 Due to a design defect, some internal wires are not sufficiently protected or fixed. Moreover, there is insufficient creepage and clearance distance between circuits and the product has insufficient insulation. The user can access live parts and receive an electric shock. This product does not comply with the requirements of the Low Voltage Directive.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 終端使用者手中召回產品 Recall of the product from end users	
13	法國 (France)	品牌(Brand)：不詳 (unknown) 品名(Name)：直發器 (Hair straightener) 型號 (Model)：825	內部導線不夠堅固，可能會接觸到金屬銘牌，從而導致觸電。 該產品不符合低電壓指令的要求。 The internal wires are not stiff enough and could touch the metallic type plate. This could cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 終端使用者手中召回產品 Recall of the product from end users	
13	法國 (France)	品牌(Brand)：不詳 (unknown) 品名(Name)：吹風機 (Hair dryer) 型號 (Model)：A6	內部電線與電器可觸及部件之間的絕緣不足，可能導致觸電危險。 該產品不符合低電壓指令的要求。 The insulation between the internal wires and the accessible parts of the appliance is not sufficient. This may result in a risk of electric shock. The product does not comply with the requirements of the Low Voltage Directive.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 終端使用者手中召回產品 Recall of the product from end users	
13	法國 (France)	品牌(Brand)：*PANCERKA* 品名(Name)：電動絞肉機 (Electric mincer) 型號 (Model)：MC-101A	如果電器蓋未正確放置或固定，電器可能繼續運轉。因此，用戶可能會接觸到電器內部的活動部件，從而造成人身傷害風險。 該產品不符合低電壓指令的要求。 The appliance may continue to operate if the lid of the appliance is not correctly placed or fixed. Therefore moving parts inside the device become accessible to the user. This could lead to a risk of injury. The product does not comply with the requirements of the Low Voltage Directive.	線上市場刪除了該產品清單 Removal of this product listing by the online marketplace 終端使用者手中召回產品 Recall of the product from end users	

2026 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
12	波蘭 (Poland)	品牌(Brand) : Bluesky 品名(Name) : 電水壺 (Electric kettle) 型號 (Model) : BWK 17S-24	該產品絕緣性能不足。用戶可能接觸到帶電部件並遭受電擊。 該產品不符合低電壓指令的要求，也不符合歐洲標準 EN 60335-1 和 60335-2。 The product has insufficient insulation. The user can access live parts and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standards EN 60335-1 and 60335-2.	從市場撤回 Withdrawal of the product from the market 警告消費者風險 Warning consumers of the risks 產品銷毀 Destruction of the product	
10	芬蘭 (Finland)	品牌(Brand) : Wozinsky 品名(Name) : USB 充電器 (USB charger) 型號 (Model) : WUTWC	由於產品設計缺陷，帶電部件易於觸及。用戶可能因接觸這些部件而觸電。 該產品不符合低電壓指令和歐洲標準 EN 60884-1 的要求。 Due to the inadequate design of the product, live parts are easily accessible. The user could touch them and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60884-1.	終端使用者手中召回產品 Recall of the product from end users	
13	挪威 (Norway)	品牌(Brand) : Al Sultan 品名(Name) : 加熱板 (Hot plate) 型號 (Model) : HD26-290 220V 600W	該產品中的焊料鉛、鄰苯二甲酸二(2-乙基己基)酯 (DEHP)、鄰苯二甲酸二異丁酯 (DIBP) 和鄰苯二甲酸二丁酯 (DBP) 的含量過高 (實測值分別為：0.27%、5.2%、0.25% 和 0.3% (重量百分比))。鉛對環境構成風險。這些鄰苯二甲酸酯可能損害生殖系統，從而危害健康。 該產品不符合關於限制在電氣和電子設備中使用某些有害物質的指令 (RoHS2 指令) 的要求。 The solders in the product have an excessive concentration of lead, bis(2-ethylhexyl) phthalate (DEHP), diisobutyl phthalate (DIBP) and dibutyl phthalate (DBP) (measured values: 0.27%, 5.2%, 0.25% and 0.3% by weight, respectively). Lead poses a risk to the environment. These phthalates may harm the health by causing possible damage to the reproductive system. The product does not comply with the requirements of the Directive on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS2 Directive).	從市場撤回 Withdrawal of the product from the market	

2026 年 3 月電子電氣產品召回案例 (歐洲地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
10	德國 (Germany)	品牌(Brand) : Ehaho 品名(Name) : 迪斯可燈 (Disco lamp) 型號 (Model) : L2700A	雷射光束功率過高。直視雷射光束可能造成視力損傷。此外，該產品未附帶必要的使用警告。 該產品不符合通用產品安全法規 (GDPR) 和歐洲標準 EN 60825-1。 The laser beam is too powerful. Direct viewing of it could cause damage to sight. Moreover, the product is not accompanied by the necessary warnings regarding its use. The product does not comply with the General Product Safety Regulation nor with the European standard EN 60825-1.	禁止銷售 Stop of sales	
11	德國 (Germany)	品牌(Brand) : 7MAGIC 品名(Name) : 防蟲燈 (Anti-insect lamp) 型號 (Model) : MA-007A	該產品存在可觸及的帶電部件 (手指可穿過格柵)，且電氣元件缺乏足夠的防觸電保護。因此，用戶可能接觸到這些帶電部件，從而導致觸電風險。 該產品不符合低電壓指令和歐洲標準 EN 60335-2 的要求。 The product has accessible live parts (fingers can be inserted through the grille) and the electrical components do not provide sufficient protection against contact. Consequently, the user could touch accessible live parts, leading to a risk of electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-2.	從市場撤回 Withdrawal of the product from the market	
11	德國 (Germany)	品牌(Brand) : 不詳 (unknown) 品名(Name) : 防蟲燈 (Anti-insect lamp) 型號 (Model) : SY-A204	該產品存在可觸及的帶電部件 (手指可穿過格柵)，且電氣元件缺乏足夠的防觸電保護。因此，用戶可能接觸到這些帶電部件，從而導致觸電風險。 該產品不符合低電壓指令和歐洲標準 EN 60335-2 的要求。 The product has accessible live parts (fingers can be inserted through the grille) and the electrical components do not provide sufficient protection against contact. Consequently, the user could touch accessible live parts, leading to a risk of electric shock. The product does not comply with the requirements of the Low Voltage Directive nor with the European standard EN 60335-2.	從市場撤回 Withdrawal of the product from the market	

2026 年 3 月電子電氣產品召回案例 (北美地區)

周	通報國家/地區	產品	危險	通報國家採取的措施	照片
13	美國 (America)	品牌(Brand)：Sunnyyes 品名(Name)：LED 迷你燈 (LED Mini Lights) 型號 (Model)：不詳 (unknown)	此次召回的 LED 燈違反了含鈕扣電池的消費品強制性標準，因為這些燈具內含鋰鈕扣電池，兒童很容易接觸到，存在誤食風險。此外，遙控器上用於固定電池倉（內含鋰鈕扣電池）的螺絲容易脫落。而且，包裝上也沒有符合裡斯法案（Reese's Law）要求的警告標識。誤食鈕扣電池會導致嚴重傷害、內部化學灼傷甚至死亡。 The recalled LED lights violate the mandatory standard for consumer products containing button cell or coin batteries because the lights contain lithium coin batteries that can be accessed easily by children, posing an ingestion hazard. Additionally, the screw used on the remote controls to secure the battery compartments that contain a lithium coin battery does not remain attached. Also, the packaging does not have the warnings as required by Reese's Law. When button cell or coin batteries are swallowed, the ingested batteries can cause serious injuries, internal chemical burns and death.	退款 Refund	
13	美國 (America)	品牌(Brand)：CCCEI 品名(Name)：電源插座 (Power Strips) 型號 (Model)：不詳 (unknown)	這些電源插座沒有額外的過流保護裝置，如果超載使用，可能會引發火災。由此引發的火災會導致吸入濃煙和燒傷，造成嚴重人身傷害甚至死亡。 The power strips do not contain supplementary overcurrent protection, which creates a risk of fire if the power strips are overloaded. The resulting fire can cause serious injury or death from smoke inhalation and burns.	退款 Refund	